

FACTORY AUTOMATION

Servo System Motion Module Quick Start Guide

Quick Start Guide

MELSEC iQ-R Series Motion Module

[PLCopen[®] Motion Control FB Mode]



mitsubishi electric servo system
MELSERVO-J5
MELSEC iQ-R
series

Applicable Model

- RD78G
- RD78GH
- MR-J5-G

● SAFETY PRECAUTIONS ●

(Read these precautions before using this product.)

Before using this product, please read this manual and the relevant manuals carefully and pay full attention to safety to handle the product correctly.

The precautions given in this manual are concerned with this product only. Refer to the MELSEC iQ-R Module Configuration Manual for a description of the PLC system safety precautions.

In this manual, the safety precautions are classified into two levels: "⚠ WARNING" and "⚠ CAUTION".

 **WARNING**

Indicates that incorrect handling may cause hazardous conditions, resulting in death or severe injury.

 **CAUTION**

Indicates that incorrect handling may cause hazardous conditions, resulting in minor or moderate injury or property damage.

Under some circumstances, failure to observe the precautions given under "⚠ CAUTION" may lead to serious consequences.

Observe the precautions of both levels because they are important for personal and system safety. Make sure that the end users read this manual and then keep the manual in a safe place for future reference.

[Design Precautions]

WARNING

- Configure safety circuits external to the programmable controller to ensure that the entire system operates safely even when a fault occurs in the external power supply or the programmable controller. Failure to do so may result in an accident due to an incorrect output or malfunction.
 - (1) Emergency stop circuits, protection circuits, and protective interlock circuits for conflicting operations (such as forward/reverse rotations or upper/lower limit positioning) must be configured external to the programmable controller.
 - (2) When the programmable controller detects an abnormal condition, it stops the operation and all outputs are:
 - Turned off if the overcurrent or overvoltage protection of the power supply module is activated.
 - Held or turned off according to the parameter setting if the self-diagnostic function of the CPU module detects an error such as a watchdog timer error.
 - (3) All outputs may be turned on if an error occurs in a part, such as an I/O control part, where the CPU module cannot detect any error. To ensure safety operation in such a case, provide a safety mechanism or a fail-safe circuit external to the programmable controller. For a fail-safe circuit example, refer to the MELSEC iQ-R Module Configuration Manual.
 - (4) Outputs may remain on or off due to a failure of a component such as a relay and transistor in an output circuit. Configure an external circuit for monitoring output signals that could cause a serious accident.
- In an output circuit, when a load current exceeding the rated current or an overcurrent caused by a load short-circuit flows for a long time, it may cause smoke and fire. To prevent this, configure an external safety circuit, such as a fuse.
- Configure a circuit so that the programmable controller is turned on first and then the external power supply. If the external power supply is turned on first, an accident may occur due to an incorrect output or malfunction.
- When the programmable controller is turned off, configure a circuit so that the external power supply is turned off first and then the programmable controller. If the programmable controller is turned off first, an accident may occur due to an incorrect output or malfunction.
- For the operating status of each station after a communication failure, refer to manuals for the network used. For the manuals, please consult your local Mitsubishi representative. Incorrect output or malfunction due to a communication failure may result in an accident.
- When connecting an external device with a CPU module or intelligent function module to modify data of a running programmable controller, configure an interlock circuit in the program to ensure that the entire system will always operate safely. For other forms of control (such as program modification, parameter change, forced output, or operating status change) of a running programmable controller, read the relevant manuals carefully and ensure that the operation is safe before proceeding. Improper operation may damage machines or cause accidents. When a Safety CPU is used, data cannot be modified while the Safety CPU is in SAFETY MODE.

[Design Precautions]

WARNING

- Especially, when a remote programmable controller is controlled by an external device, immediate action cannot be taken if a problem occurs in the programmable controller due to a communication failure. To prevent this, configure an interlock circuit in the program, and determine corrective actions to be taken between the external device and CPU module in case of a communication failure.
- Do not write any data to the "system area" and "write-protect area" of the buffer memory in the module. Also, do not use any "use prohibited" signals as an output signal from the CPU module to each module. Doing so may cause malfunction of the programmable controller system. For the "system area", "write-protect area", and the "use prohibited" signals, refer to the user's manual for the module used. For areas used for safety communications, they are protected from being written by users, and thus safety communications failure caused by data writing does not occur.
- If a communication cable is disconnected, the network may be unstable, resulting in a communication failure of multiple stations. Configure an interlock circuit in the program to ensure that the entire system will always operate safely even if communications fail. Incorrect output or malfunction due to a communication failure may result in an accident. When safety communications are used, an interlock by the safety station interlock function protects the system from an incorrect output or malfunction.
- Configure safety circuits external to the programmable controller to ensure that the entire system operates safely even when a fault occurs in the external power supply or the programmable controller. Failure to do so may result in an accident due to an incorrect output or malfunction.
 - (1) Machine homing is controlled by two kinds of data: a homing direction and a homing speed. Deceleration starts when the proximity dog signal turns on. If an incorrect homing direction is set, motion control may continue without deceleration. To prevent machine damage caused by this, configure an interlock circuit external to the programmable controller.
 - (2) When the module detects an error, the motion slows down and stops or the motion rapidly stops, depending on the stop group setting in parameter. Set the parameter to meet the specifications of a positioning control system. In addition, set the homing parameter and positioning data within the specified setting range.
 - (3) Outputs may remain on or off, or become undefined due to a failure of a component such as an insulation element and transistor in an output circuit, where the module cannot detect any error. In a system that the incorrect output could cause a serious accident, configure an external circuit for monitoring output signals.
- If safety standards (ex., robot safety rules, etc.) apply to the system using the module, drive unit and servomotor, make sure that the safety standards are satisfied.
- Construct a safety circuit externally of the module or drive unit if the abnormal operation of the module or drive unit differs from the safety directive operation in the system.

[Design Precautions]

CAUTION

- Do not install the control lines or communication cables together with the main circuit lines or power cables. Doing so may result in malfunction due to electromagnetic interference. Keep a distance of 100 mm or more between those cables.
- During control of an inductive load such as a lamp, heater, or solenoid valve, a large current (approximately ten times greater than normal) may flow when the output is turned from off to on. Therefore, use a module that has a sufficient current rating.
- After the CPU module is powered on or is reset, the time taken to enter the RUN status varies depending on the system configuration, parameter settings, and/or program size. Design circuits so that the entire system will always operate safely, regardless of the time.
- Do not power off the programmable controller or reset the CPU module while the settings are being written. Doing so will make the data in the flash ROM and SD memory card undefined. The values need to be set in the buffer memory and written to the flash ROM and SD memory card again. Doing so also may cause malfunction or failure of the module.
- When changing the operating status of the CPU module from external devices (such as the remote RUN/STOP functions), select "Do Not Open by Program" for "Opening Method" of "Module Parameter". If "Open by Program" is selected, an execution of the remote STOP function causes the communication line to close. Consequently, the CPU module cannot reopen the line, and external devices cannot execute the remote RUN function.

[Security Precautions]

WARNING

- To maintain the security (confidentiality, integrity, and availability) of the programmable controller and the system against unauthorized access, denial-of-service (DoS) attacks, computer viruses, and other cyberattacks from external devices via the network, take appropriate measures such as firewalls, virtual private networks (VPNs), and antivirus solutions.

[Installation Precautions]

WARNING

- Shut off the external power supply (all phases) used in the system before mounting or removing the module. Failure to do so may result in electric shock or cause the module to fail or malfunction.

[Installation Precautions]

CAUTION

- Use the programmable controller in an environment that meets the general specifications in the MELSEC iQ-R Module Configuration Manual. Failure to do so may result in electric shock, fire, malfunction, or damage to or deterioration of the product.
- To mount a module, place the concave part(s) located at the bottom onto the guide(s) of the base unit, and push in the module, and fix it with screw(s). Incorrect interconnection may cause malfunction, failure, or drop of the module.
- To mount a module with no module fixing hook, place the concave part(s) located at the bottom onto the guide(s) of the base unit, push in the module, and fix it with screw(s). Incorrect interconnection may cause malfunction, failure, or drop of the module.
- Tighten the screws within the specified torque range. Undertightening can cause drop of the component or wire, short circuit, or malfunction. Overtightening can damage the screw and/or module, resulting in drop, short circuit, or malfunction. For the specified torque range, refer to the MELSEC iQ R Module Configuration Manual.
- When using an extension cable, connect it to the extension cable connector of the base unit securely. Check the connection for looseness. Poor contact may cause malfunction.
- When using an SD memory card, fully insert it into the SD memory card slot. Check that it is inserted completely. Poor contact may cause malfunction.
- Securely insert an extended SRAM cassette or a battery-less option cassette into the cassette connector of the CPU module. After insertion, close the cassette cover and check that the cassette is inserted completely. Poor contact may cause malfunction.
- Beware that the module could be very hot while power is on and immediately after power-off.
- Do not directly touch any conductive parts and electronic components of the module, SD memory card, extended SRAM cassette, battery-less option cassette, or connector. Doing so can cause malfunction or failure of the module.

[Wiring Precautions]

WARNING

- Shut off the external power supply (all phases) used in the system before installation and wiring. Failure to do so may result in electric shock or cause the module to fail or malfunction.
- After installation and wiring, attach a blank cover module (RG60) to each empty slot before powering on the system for operation. Also, attach an extension connector protective cover^{*1} to each unused extension cable connector as necessary. Directly touching any conductive parts of the connectors while power is on may result in electric shock.

^{*1} For details, please consult your local Mitsubishi Electric representative.

[Wiring Precautions]

CAUTION

- Individually ground the FG and LG terminals of the programmable controller with a ground resistance of 100 ohms or less. Failure to do so may result in electric shock or malfunction.
- Use applicable solderless terminals and tighten them within the specified torque range. If any spade solderless terminal is used, it may be disconnected when the terminal screw comes loose, resulting in failure.
- Check the rated voltage and signal layout before wiring to the module, and connect the cables correctly. Connecting a power supply with a different voltage rating or incorrect wiring may cause fire or failure.
- Connectors for external devices must be crimped or pressed with the tool specified by the manufacturer, or must be correctly soldered. Incomplete connections may cause short circuit, fire, or malfunction.
- Securely connect the connector to the module. Poor contact may cause malfunction.
- Do not install the control lines or communication cables together with the main circuit lines or power cables. Doing so may result in malfunction due to noise. Keep a distance of 100 mm or more between those cables.
- Place the cables in a duct or clamp them. If not, dangling cables may swing or inadvertently be pulled, resulting in malfunction or damage to modules or cables. In addition, the weight of the cables may put stress on modules in an environment of strong vibrations and shocks. Do not clamp the extension cables with the jacket stripped. Doing so may change the characteristics of the cables, resulting in malfunction.
- Check the interface type and correctly connect the cable. Incorrect wiring (connecting the cable to an incorrect interface) may cause failure of the module and external device.
- Tighten the terminal screws or connector screws within the specified torque range. Undertightening can cause drop of the screw, short circuit, fire, or malfunction. Overtightening can damage the screw and/or module, resulting in drop, short circuit, fire, or malfunction.
- When disconnecting the cable from the module, do not pull the cable by the cable part. For the cable with connector, hold the connector part of the cable. For the cable connected to the terminal block, loosen the terminal screw. Pulling the cable connected to the module may result in malfunction or damage to the module or cable.
- Prevent foreign matter such as dust or wire chips from entering the module. Such foreign matter can cause a fire, failure, or malfunction.
- When a protective film is attached to the top of the module, remove it before system operation. If not, inadequate heat dissipation of the module may cause a fire, failure, or malfunction.
- Programmable controllers must be installed in control panels. Connect the main power supply to the power supply module in the control panel through a relay terminal block. Wiring and replacement of a power supply module must be performed by qualified maintenance personnel with knowledge of protection against electric shock. For wiring, refer to the MELSEC iQ-R Module Configuration Manual.
- For Ethernet cables to be used in the system, select the ones that meet the specifications in the user's manual for the module used. If not, normal data transmission is not guaranteed.

[Startup and Maintenance Precautions]

WARNING

- Do not touch any terminal while power is on. Doing so will cause electric shock or malfunction.
- Correctly connect the battery connector. Do not charge, disassemble, heat, short-circuit, solder, or throw the battery into the fire. Also, do not expose it to liquid or strong shock. Doing so will cause the battery to produce heat, explode, ignite, or leak, resulting in injury and fire.
- Shut off the external power supply (all phases) used in the system before cleaning the module or retightening the terminal screws, connector screws, or module fixing screws. Failure to do so may result in electric shock.

[Startup and Maintenance Precautions]

CAUTION

- When connecting an external device with a CPU module or intelligent function module to modify data of a running programmable controller, configure an interlock circuit in the program to ensure that the entire system will always operate safely. For other forms of control (such as program modification, parameter change, forced output, or operating status change) of a running programmable controller, read the relevant manuals carefully and ensure that the operation is safe before proceeding. Improper operation may damage machines or cause accidents.
- Especially, when a remote programmable controller is controlled by an external device, immediate action cannot be taken if a problem occurs in the programmable controller due to a communication failure. To prevent this, configure an interlock circuit in the program, and determine corrective actions to be taken between the external device and CPU module in case of a communication failure.
- Do not disassemble or modify the modules. Doing so may cause failure, malfunction, injury, or a fire.
- Use any radio communication device such as a cellular phone or PHS (Personal Handy-phone System) more than 25 cm away in all directions from the programmable controller. Failure to do so may cause malfunction.
- Shut off the external power supply (all phases) used in the system before mounting or removing the module. Failure to do so may cause the module to fail or malfunction.
- Tighten the screws within the specified torque range. Undertightening can cause drop of the component or wire, short circuit, or malfunction. Overtightening can damage the screw and/or module, resulting in drop, short circuit, or malfunction.
- After the first use of the product, do not perform each of the following operations more than 50 times (IEC 61131-2/JIS B 3502 compliant). Exceeding the limit may cause malfunction.
 - Mounting/removing the module to/from the base unit
 - Inserting/removing the extended SRAM cassette or battery-less option cassette to/from the CPU module
 - Mounting/removing the terminal block to/from the module
 - Connecting/disconnecting the extension cable to/from the base unit
- After the first use of the product, do not insert/remove the SD memory card to/from the CPU module more than 500 times. Exceeding the limit may cause malfunction.

[Startup and Maintenance Precautions]

CAUTION

- Do not touch the metal terminals on the back side of the SD memory card. Doing so may cause malfunction or failure of the module.
- Do not touch the integrated circuits on the circuit board of an extended SRAM cassette or a battery-less option cassette. Doing so may cause malfunction or failure of the module.
- Do not drop or apply shock to the battery to be installed in the module. Doing so may damage the battery, causing the battery fluid to leak inside the battery. If the battery is dropped or any shock is applied to it, dispose of it without using.
- Startup and maintenance of a control panel must be performed by qualified maintenance personnel with knowledge of protection against electric shock. Lock the control panel so that only qualified maintenance personnel can operate it.
- Before handling the module, touch a conducting object such as a grounded metal to discharge the static electricity from the human body. Wearing a grounded antistatic wrist strap is recommended. Failure to discharge the static electricity may cause the module to fail or malfunction.
- After unpacking, eliminate static electricity from the module to prevent electrostatic discharge from affecting the module. If an electrostatically charged module comes in contact with a grounded metal object, a sudden electrostatic discharge of the module may cause failure. For details on how to eliminate static electricity from the module, refer to the following.
Safety Precautions For Static Electricity Before Using MELSEC MX Controller MX-R Model and MELSEC iQ-R Series Models (FA-A-0368)
- Use a clean and dry cloth to wipe off dirt on the module.
- Before testing the operation, set a low speed value for the speed limit parameter so that the operation can be stopped immediately upon occurrence of a hazardous condition.
- Confirm and adjust the program and each parameter before operation. Unpredictable movements may occur depending on the machine.
- When using the absolute position system function, on starting up, and when the module or absolute position motor has been replaced, always perform a homing.
- Before starting the operation, confirm the brake function.
- Do not perform a megger test (insulation resistance measurement) during inspection.
- After maintenance and inspections are completed, confirm that the position detection of the absolute position detection function is correct.
- Lock the control panel and prevent access to those who are not certified to handle or install electric equipment.

[Operating Precautions]

CAUTION

- When changing data and operating status, and modifying program of the running programmable controller from an external device such as a personal computer connected to an intelligent function module, read relevant manuals carefully and ensure the safety before operation. Incorrect change or modification may cause system malfunction, damage to the machines, or accidents.
- Do not power off the programmable controller or reset the CPU module while the setting values in the buffer memory are being written to the flash ROM in the module. Doing so will make the data in the flash ROM and SD memory card undefined. The values need to be set in the buffer memory and written to the flash ROM and SD memory card again. Doing so can cause malfunction or failure of the module.
- Note that when the reference axis speed is specified for interpolation operation, the speed of the partner axis (2nd, 3rd, or 4th axis) may exceed the speed limit value.
- Do not go near the machine during test operations or during operations such as teaching. Doing so may lead to injuries.

[Computer Connection Precautions]

CAUTION

- When connecting a personal computer to a module having a USB interface, observe the following precautions as well as the instructions described in the manual for the personal computer used. Failure to do so may cause the module to fail.

(1) When the personal computer is AC-powered

When the personal computer has a 3-pin AC plug or an AC plug with a grounding wire, connect the plug to a grounding receptacle or ground the grounding wire. Ground the personal computer and the module with a ground resistance of 100 ohms or less.

When the personal computer has a 2-pin AC plug without a grounding wire, connect the computer to the module by following the procedure below. For power supplied to the personal computer and the module, using the same power source is recommended.

1. Unplug the personal computer from the AC receptacle.
2. Check that the personal computer is unplugged. Then, connect the personal computer to the module with a USB cable.
3. Plug the personal computer into the AC receptacle.

(2) When the personal computer is battery-powered

The personal computer can be connected to the module without taking specific measures.

For details, refer to the following.

Cautions When Using Mitsubishi Electric Controllers or GOTs Connected to a Personal Computer Via RS-232/USB Interface (FA-A-0298)

When the USB cable used is the GT09-C30USB-5P manufactured by Mitsubishi Electric, specific measures are not required to connect the AC-powered personal computer to the module.

However, note that the signal ground (SG) is common for the module and its USB interface.

Therefore, if an SG potential difference occurs between the module and the connected devices, it causes failures of the module and the connected devices.

[Disposal Precautions]

CAUTION

- When disposing of this product, treat it as industrial waste.
- When disposing of batteries, separate them from other wastes according to the local regulations. For details on battery regulations in EU member states, refer to the MELSEC iQ-R Module Configuration Manual.

[Transportation Precautions]

CAUTION

- When transporting lithium batteries, follow the transportation regulations. For details on the regulated models, refer to the MELSEC iQ-R Module Configuration Manual.
- The halogens (such as fluorine, chlorine, bromine, and iodine), which are contained in a fumigant used for disinfection and pest control of wood packaging materials, may cause failure of the product. Prevent the entry of fumigant residues into the product or consider other methods (such as heat treatment) instead of fumigation. The disinfection and pest control measures must be applied to unprocessed raw wood.

REVISIONS

Revision Date	Manual No.	Description
Oct. 2020	L(NA)03191ENG-A	First edition
Mar. 2026	L(NA)03191ENG-B	Procedures and descriptions partially updated and errors corrected

This manual confers no industrial property rights or any rights of any other kind, nor does it confer any patent licenses. Mitsubishi Electric Corporation cannot be held responsible for any problems involving industrial property rights which may occur as a result of using the contents noted in this manual.

INTRODUCTION

Please read this manual carefully so that equipment is used to its optimum.

CONTENTS

SAFETY PRECAUTIONS.....	A- 1
REVISIONS	A-12
CONTENTS.....	A-13

1. OVERVIEW	1- 1 to 1- 7
--------------------	---------------------

1.1 What Is A Servo System?	1- 1
1.2 Application Examples of Servo Systems	1- 1
1.3 Role of Servo System Controllers	1- 2
1.4 Features of MELSEC iQ-R Series Motion Module RD78G(H).....	1- 2
1.5 Programming Methods	1- 3
1.6 Organization of This Document.....	1- 4
1.7 Relevant Manuals	1- 5

2. SYSTEM STARTUP	2- 1 to 2-13
--------------------------	---------------------

2.1 System Overview	2- 1
2.2 System Configuration.....	2- 2
2.3 System Components Preparation	2- 3
2.4 Firmware/Software Installation	2- 4
2.4.1 Firmware/software preparation	2- 4
2.4.2 MELSOFT GX Works3 installation	2- 5
2.4.3 Motion control setting installation.....	2- 6
2.4.4 Profile registration	2- 7
2.4.5 MELSOFT iQ-R Series Motion Module FB library	2- 8
2.5 Module Installation	2- 9
2.6 Wiring and Cable Connection	2-10

3. PARAMETER SETTING	3- 1 to 3-39
-----------------------------	---------------------

3.1 Parameter Setting Procedure	3- 1
3.2 Creating a Project	3- 2
3.3 Connecting a Personal Computer and a PLC CPU Module	3- 3
3.4 Initial Setting	3- 5
3.4.1 Initializing a PLC CPU module.....	3- 5
3.4.2 Checking firmware version.....	3- 6
3.5 Creating a Module Configuration Diagram.....	3- 7
3.6 Network Configuration	3- 9
3.6.1 Setting a network configuration	3- 9
3.6.2 PDO mapping	3-11
3.6.3 Setting a motion control station	3-12
3.7 Servo Parameter Setting	3-13
3.8 Module Parameter Application	3-16
3.9 Motion Control Setting	3-17

3.10 Basic Setting and System Setting	3-17
3.11 Axis Parameter Setting	3-18
3.11.1 Setting a station address and an axis type	3-18
3.11.2 Setting each item	3-21
3.11.3 Driver unit conversion (electronic gear).....	3-25
3.11.4 Reflecting axis parameters	3-27
3.12 Axes Group Setting.....	3-28
3.13 Labels.....	3-30
3.13.1 Creating a label.....	3-30
3.14 Public Labels	3-32
3.14.1 Public label registration	3-32
3.14.2 Public label reflection	3-33
3.14.3 A program example using public labels	3-34
3.15 Writing to a Motion Module.....	3-35
3.16 Saving a Project	3-36
3.17 Parameter List	3-37

4. PROGRAMMING BY A PLC CPU MODULE ONLY

4- 1 to 4-56

4.1 Programming Procedure for PLC CPU modules	4- 2
4.1.1 Creating a program block.....	4- 2
4.1.2 Program execution type	4- 3
4.1.3 Inputting a FB	4- 4
4.2 Naming Rules of Labels.....	4-11
4.3 Projects.....	4-12
4.3.1 Program names.....	4-12
4.3.2 Settings for global and public labels	4-13
4.4 PLC READY (Program Name: ServoON_Jog).....	4-17
4.5 Servo ON (Program Name: ServoON_Jog).....	4-18
4.6 JOG Operation (Program Name: ServoON_Jog).....	4-19
4.7 Homing (Program Name: Homing).....	4-24
4.8 Single Axis Positioning Control (Program Name: Positioning).....	4-27
4.9 Single Axis Continuous Positioning (Program Name: ContinuousPositioning)	4-29
4.10 Interpolation Control (Program Name: LinearInterpolation)	4-33
4.10.1 Procedure for interpolation control	4-33
4.10.2 Enabling/disabling an axes group.....	4-33
4.10.3 Interpolation control.....	4-33
4.10.4 Program example for linear interpolation	4-34
4.11 Synchronous Control (Program Name: Synchronous).....	4-39
4.11.1 Procedures for executing synchronous control.....	4-39
4.11.2 Calculation profile.....	4-40
4.11.3 Single axis synchronous control FBs	4-42
4.11.4 Axes configuration.....	4-43
4.11.5 Program example.....	4-43
4.12 Error Reset (Program Name: ErrorReset)	4-48
4.13 Checking Operation	4-49
4.13.1 Conversion and Writing of Programs	4-49
4.13.2 Axis monitor	4-50
4.13.3 Program monitor	4-52
4.13.4 Watch	4-53

4.13.5 Event History	4-55
----------------------------	------

5. PROGRAMMING BY A PLC CPU MODULE AND THE MOTION MODULE	5- 1 to 5-56
---	---------------------

5.1 Programming Procedure for Motion Module	5- 2
5.1.1 Creating a program block.....	5- 2
5.1.2 Program execution type	5- 3
5.1.3 Inputting a FB	5- 4
5.1.4 ENUM enumerator	5-10
5.1.5 Conversion of all the programs and reflection of public labels	5-11
5.2 Naming Rules of Labels	5-12
5.3 Projects.....	5-13
5.3.1 Program names	5-13
5.3.2 Settings for global and public labels	5-15
5.4 PLC READY (Program Name: ServoON_Jog).....	5-17
5.5 Servo ON (Program Name: ServoON_Jog).....	5-18
5.6 JOG Operation (Program Name: ServoON_Jog).....	5-19
5.7 Homing (Program Name: Homing).....	5-24
5.8 Single Axis Positioning Control (Program Name: Positioning).....	5-27
5.9 Single Axis Continuous Positioning (Program Name: ContinuousPositioning)	5-29
5.10 Interpolation Control (Program Name: LinearInterpolation)	5-33
5.10.1 Procedure for interpolation control	5-33
5.10.2 Enabling/disabling an axes group.....	5-33
5.10.3 Interpolation control.....	5-33
5.10.4 Program example for linear interpolation	5-34
5.11 Synchronous Control (Program Name: Synchronous).....	5-39
5.11.1 Procedures for executing synchronous control.....	5-39
5.11.2 Calculation profile.....	5-40
5.11.3 Single axis synchronous control FBs	5-42
5.11.4 Axes configuration.....	5-43
5.11.5 Program example.....	5-44
5.12 Error Reset (Program Name: ErrorReset)	5-49
5.13 Checking Operation	5-50
5.13.1 Conversion and Writing of Programs	5-50
5.13.2 Axis monitor.....	5-51
5.13.3 Program monitor	5-52
5.13.4 Watch.....	5-53
5.13.5 Event History	5-55

APPENDICES	APP- 1 to APP-25
-------------------	-------------------------

APPENDIX 1 Configuring Settings Using External Devices.....	APP- 1
APPENDIX 1.1 Using the DI signal of the servo amplifier	APP- 1
APPENDIX 1.2 Using the input signal of the PLC CPU module	APP- 9
APPENDIX 1.3 Using the input signal of the remote input module	APP-16
APPENDIX 2 Precautions When the Absolute Position Detection is Used	APP-23
APPENDIX 3 Checking the Firmware Version.....	APP-24

[illegible]

1. OVERVIEW


This document is intended for first-time users of Mitsubishi Electric's servo system controller RD78G(H) to learn about necessary system components, software, parameter settings, and programming methods to configure a servo system.

1.1 What Is A Servo System?

A servo system controls an object following the input command values, such as the position, direction, attitude, etc. of the controlled object.


The Mitsubishi Electric's servo system, as shown below, controls a servo motor by transmitting position and speed commands from a controller (a programmable controller and a servo system controller) to a servo amplifier.

An encoder is mounted on the servo motor to detect the position and speed. The detected data is fed back to the servo amplifier so that the deviation between the position/speed commands and the actual position/speed is minimized.

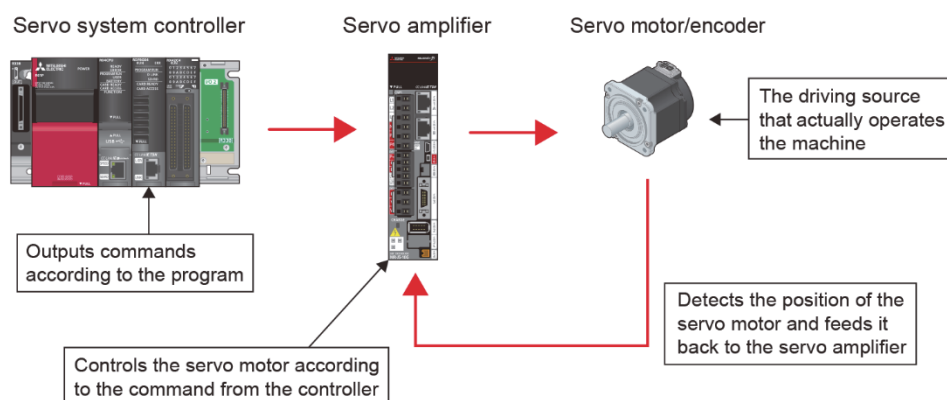

1.2 Application Examples of Servo Systems

A servo system is used in a wide range of machines such as ones that require high-accuracy positioning, ones that require accurate synchronization such as packing machines and printing machines, and ones that require tension control (torque control) and speed control such as unwinding/winding machines, etc.

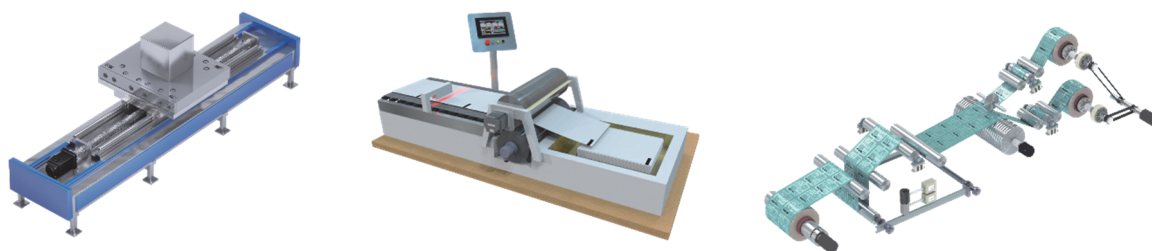

[A machine that requires position control] [A machine that requires synchronous control] [A machine that requires torque control]

1.3 Role of Servo System Controllers

The servo system controller outputs position/speed commands to servo amplifiers and generates commands to execute interpolation and synchronous control using multiple axes.


In addition, the controller changes the position/speed commands according to the value of the sensors and other devices controlled by a programmable controller.

1.4 Features of MELSEC iQ-R Series Motion Module RD78G(H)

MELSEC iQ-R series Motion module RD78G(H) is a servo system controller supporting CC-Link IE TSN that enables mixing of real-time control communication required for motion control and non-real time information communication utilized by the IT systems. By supporting the network, the Motion module can flexibly connect various devices including servo amplifiers, I/O modules, and high-speed counters.

Main features of RD78G(H)

- High-speed processing with multi-core processor
- Up to 256 control axes
- Programming with the PLCopen® Motion Control FB (function block) for positioning control, etc.

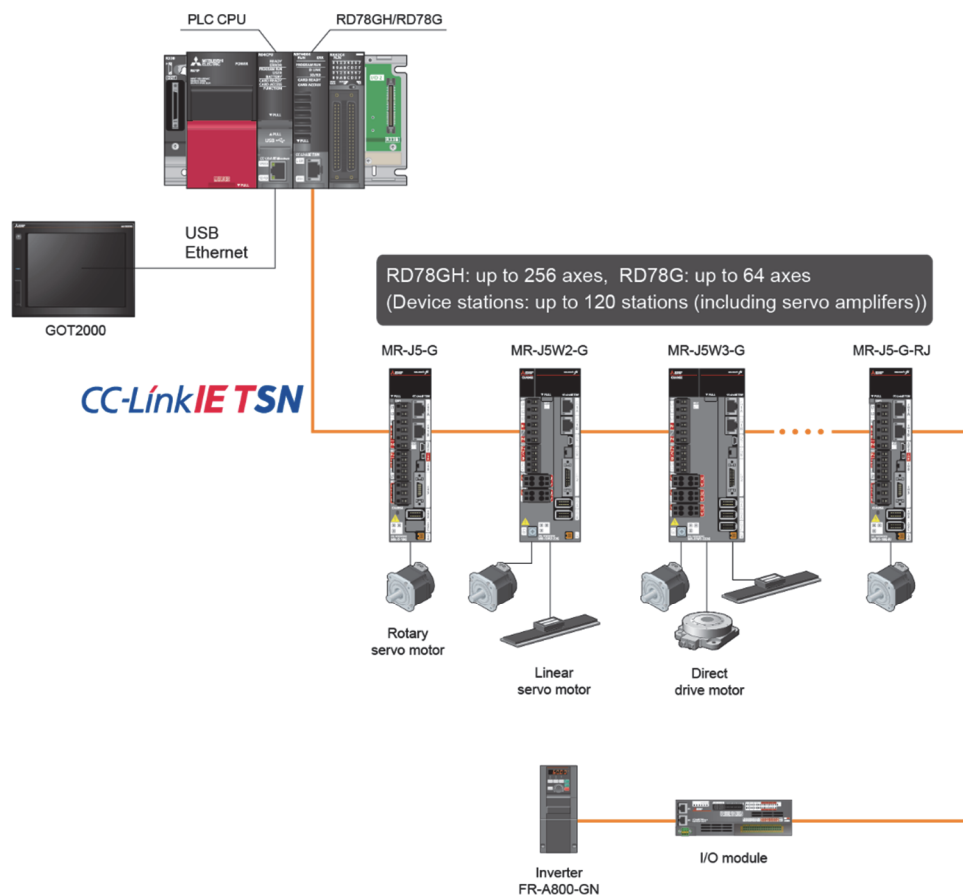


1.5 Programming Methods

There are two programming methods for a servo system using RD78G(H): programming by a PLC CPU module only and programming by a PLC CPU module and the Motion module.

Selectable programming languages vary depending on the controller:

- Motion module : structured text language (ST)
- PLC CPU module : ladder diagram (Ladder), function block diagram/ladder diagram (FBD/LD), sequential function chart (SFC), and structured text language (ST)
(These languages are compliant with IEC 61131-3.)

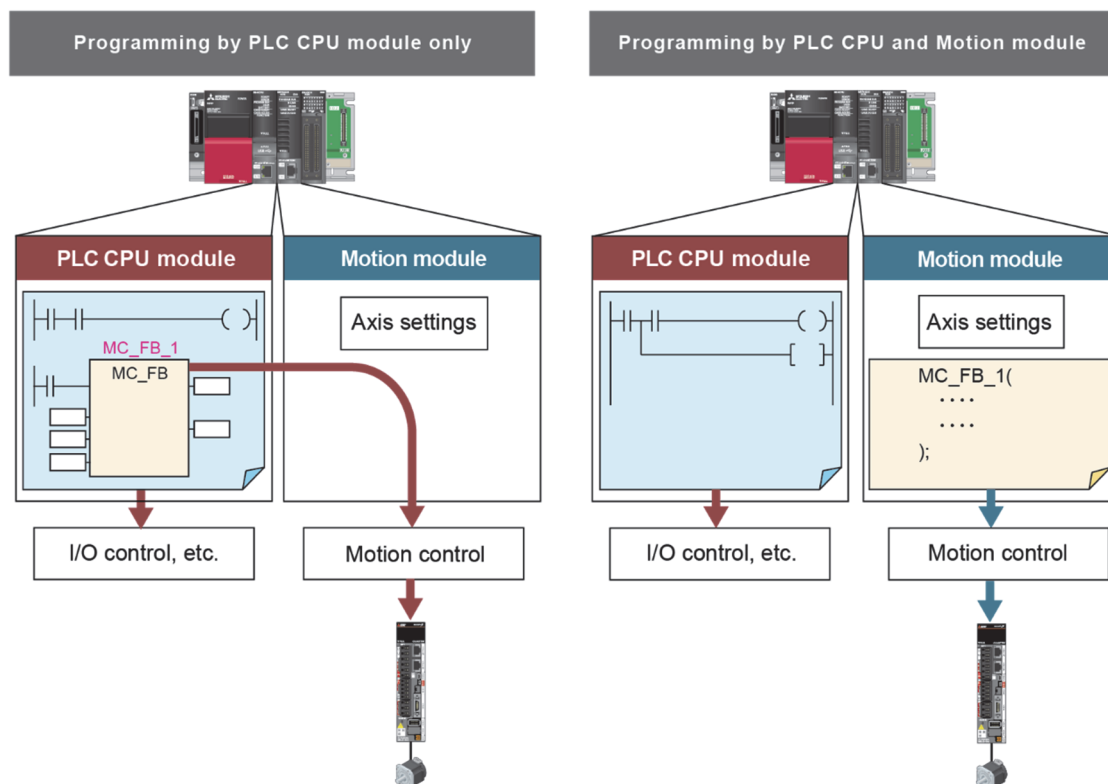

(1) Programming by a PLC CPU module only

- Advantages : Easy program management by programming with only one CPU.
- Disadvantages : Longer scan time due to processing by one CPU.


(2) Programming by a PLC CPU module and the Motion module

- Advantages : Reduced scan time because motion control is programmed to the Motion module, not affecting other processing in a sequence program.
- Disadvantages : Necessary to manage programs of both the PLC CPU module and the Motion module.

1.6 Organization of This Document

This document describes procedures from startup to debugging by taking a two-axis XY table as an example.

The programming part consists of two chapters: programming by a PLC CPU module only (Chapter 4), and programming by a PLC CPU module and the Motion module (Chapter 5).

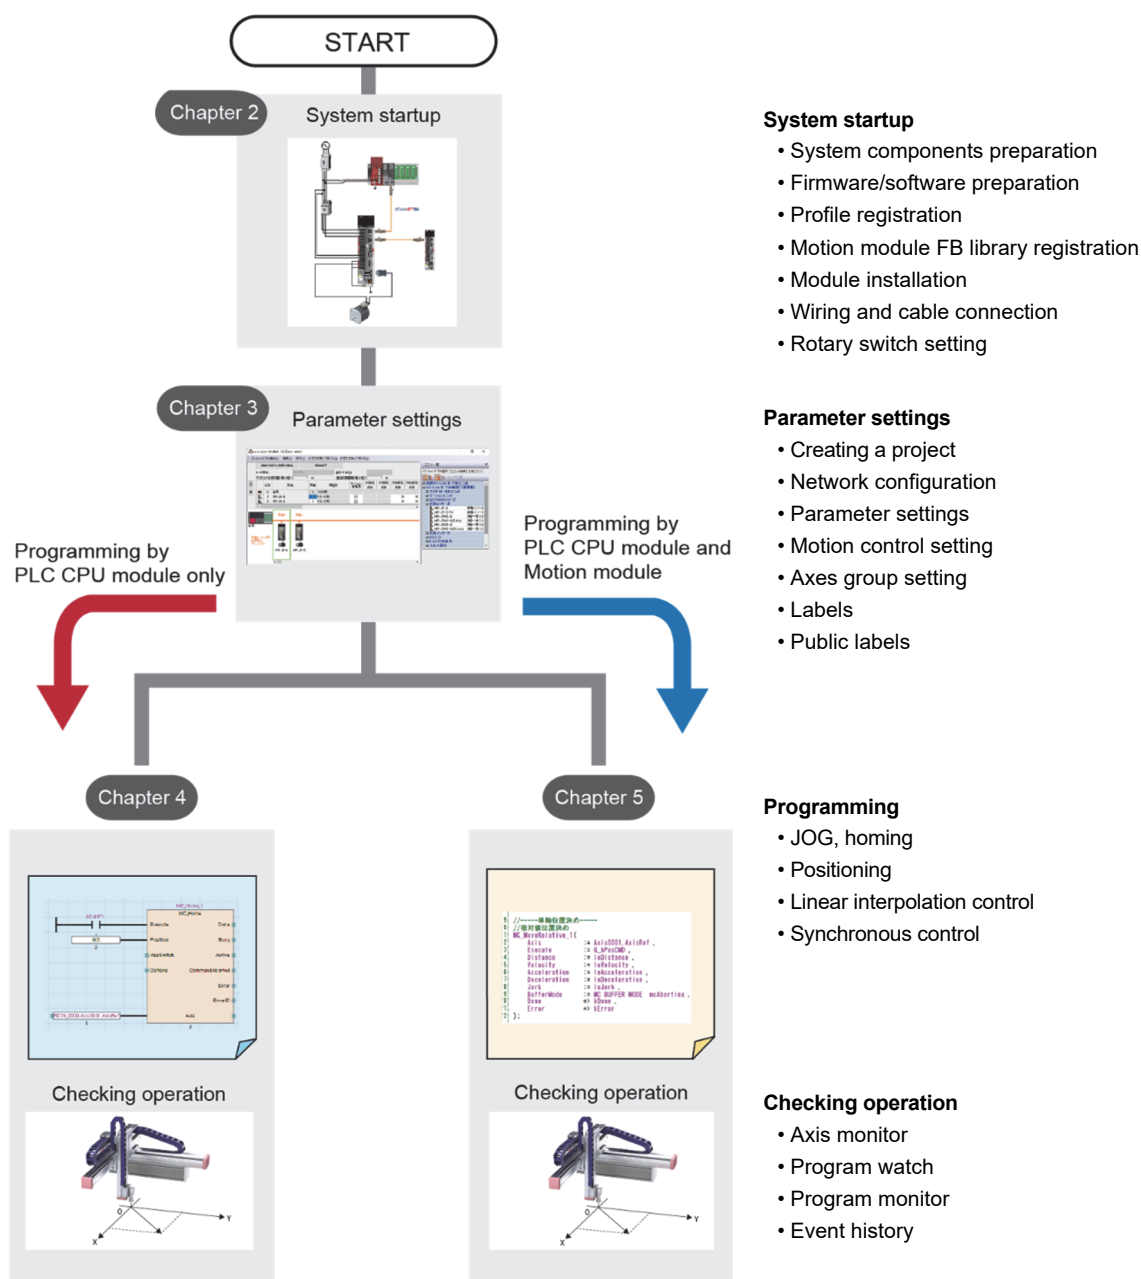

1.7 Relevant Manuals

(1) Motion module

Manual title	Manual No.
MELSEC iQ-R Motion Module User's Manual (Startup)	IB-0300406ENG
MELSEC iQ-R Motion Module User's Manual (Application)	IB-0300411ENG
MELSEC iQ-R Motion Module User's Manual (Network)	IB-0300426ENG
MELSEC iQ-R Programming Manual (Motion Control Function Blocks)	IB-0300533ENG
MELSEC iQ-R Programming Manual (Motion Module Instructions, Standard Functions/Function Blocks)	IB-0300431ENG

(2) Programmable controller

Manual title	Manual No.
MELSEC iQ-R CPU Module User's Manual (Startup)	SH-081263ENG
MELSEC iQ-R CPU Module User's Manual (Application)	SH-081264ENG
MELSEC iQ-R Ethernet/CC-Link IE User's Manual (Startup)	SH-081256ENG
MELSEC iQ-R Ethernet/CC-Link IE User's Manual (Application)	SH-081257ENG
MELSEC iQ-R Programming Manual (Program Design)	SH-081265ENG
MELSEC iQ-R Structured Text (ST) Programming Guide Book	SH-081483ENG
MELSEC iQ-R Programming Manual (CPU Module Instructions, Standard Functions/Function Blocks)	SH-081266ENG

(3) Servo amplifier

Manual title	Manual No.
MR-J5 User's Manual (Hardware)	SH-030298ENG
MR-J5D User's Manual (Hardware)	IB-0300548ENG
MR-J5-G/MR-J5W-G User's Manual (Introduction)	SH-030294ENG
MR-J5D-G User's Manual (Introduction)	IB-0300538ENG
MR-CV Power Regeneration Converter Unit User's Manual	IB-0300553ENG
MR-J5-G/MR-J5W-G User's Manual (Parameters)	SH-030308ENG
MR-J5 User's Manual (Function)	SH-030300ENG
MR-J5 User's Manual (Communication Function)	SH-030302ENG
MR-J5 User's Manual (Trouble Shooting)	SH-030312ENG
MR-J5 User's Manual (Object Dictionary)	SH-030304ENG
MR-J5-G/MR-J5W-G User's Manual (Object Dictionary)	SH-030304ENG


[illegible]

2. SYSTEM STARTUP

2.1 System Overview

The following shows an example of a two-axis machine that uses ball screws.

(1) Machine

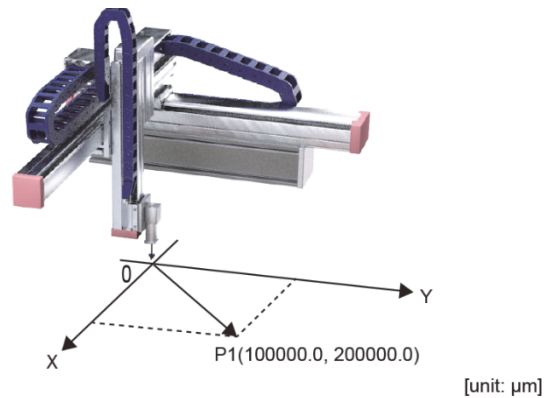

(2) Specifications

Lead of the ball screw (PB) : 10.0 [mm]


Reduction ratio (NL/NM) : 1/2 (Load side [NL]/Motor side [NM])

When the servo motor rotates twice, the ball screw of the load side rotates once.

Encoder resolution : 26 bits (67108864 [pulse])

2.2 System Configuration



The following shows a system configuration example using a Motion module (RD78G), a servo amplifier (MR-J5-G), and a servo motor (HK-KT series).

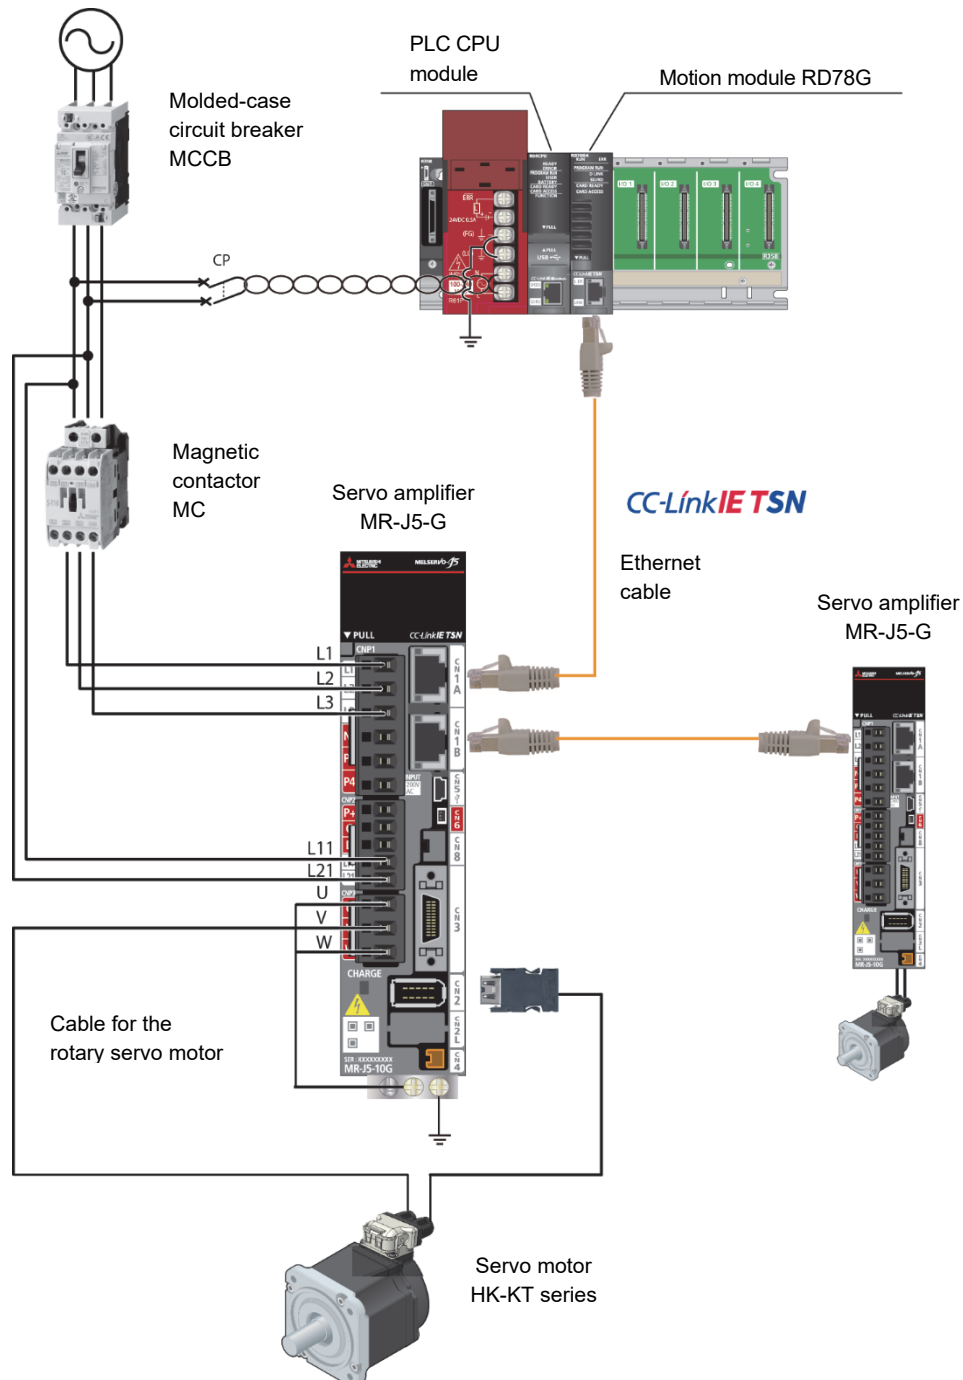

2.3 System Components Preparation

This document describes a project using the following components.

  Prepare modules, devices, cables, and software according to the user's system.

PLC CPU module	Motion module	Servo amplifier
R04CPU 	RD78G4 	MR-J5-10G 
Main base unit	Power supply module	Servo motor
R35B 	R61P 	HK-KT13W 
Ethernet cable	Communication cable	Cable for the rotary servo motor
Category 5e or higher (double shielded/STP) straight cable 	Between a personal computer and a PLC CPU module (USB A type – USB mini B type) 	MR-AEP2CBL2M-A1-L 
Engineering environment	Molded-case circuit breaker (MCCB)	Magnetic contactor (MC)
MELSOFT GX Works3 		

2.4 Firmware/Software Installation

2.4.1 Firmware/software preparation

Contents of this document are based on the specifications of the firmware, software, and engineering environment listed in the following tables.

The screen displays may differ depending on the version of the firmware/software to be used.

Please contact your local sales office for the latest version.

[Firmware/software]

Module	Description	Module model	Version
PLC CPU module	Firmware update information file	R00CPU/R01CPU/R02CPU	14 or later
		R04CPU/R08CPU/R16CPU/R32CPU/R120CPU (Note-2)	46 or later
		R□ENCPU (Note-2)	46 or later
Motion module	Network boot software	RD78G/RD78GH	13 or later
	Boot software		13 or later
	Basic system software		28 or later
Servo amplifier	Firmware for CC-Link IE TSN-compatible servo amplifier MR-J5-G		Note-3

(Note-1): This version can be installed to a controller with ver. 23 or later.

[Engineering environment]

Item	Description	Version
MELSOFT GX Works3	PLC engineering software	1.087R or later
Motion control setting	Software to set and monitor the Motion module	1.030G or later
MELSOFT MR Configurator2	Servo amplifier setup software	1.105K or later
MELSOFT GX LogViewer	An easy-to-use tool to display and analyze large-capacity data collected by a module with the logging function	1.106K or later

[Profile]

Item	Description	Version
Profile for MR-J5-G	Profiles for MELSERVO-J5 series CC-Link IE TSN-compatible servo amplifier	Note-3

[FB library] *Use it when programming with a PLC CPU module.

Item	Description	Version
MELSEC iQ-R Motion module FB library	An FB library for the systems using the MELSEC iQ-R series Motion module	01B or later

(Note-1): For details on how to check the version, refer to Appendix 3..

(Note-2): This version can be installed to a controller with ver. 23 or later.

(Note-3): Please contact your local sales office for the latest version.

2.4.2 MELSOFT GX Works3 installation

(1) Installation procedure

■ Installing with the MELSOFT GX Works3 product DVD

- 1) Insert the MELSOFT GX Works3 DVD-ROM to the DVD-ROM drive, and double-click "setup.exe" in the Disk1 folder on the DVD-ROM.

- 2) Select or enter the necessary information by following the on-screen instructions. ^(Note-1)

(Note-1): The product ID is written on the "License certificate" included with the product.
Enter the 12-digit number divided into 3 and 9 digits.

■ Installing and downloading the update module (updated version)

- 1) Please contact your local sales office for the latest version of MELSOFT GX Works3.

- 2) After unzipping the downloaded file in any location, double-click "sw1dnd-gxw3-e_****.exe" ^(Note-1) in the "sw1dnd-gxw3-e_**** ^(Note-1)" folder.

(Note-1): **** indicates the MELSOFT GX Works3 version.

- 3) Select or enter the necessary information by following the on-screen instructions. ^(Note-1)

(Note-1): The product ID is written on the "License certificate" included with the product.
Enter the 12-digit number divided into 3 and 9 digits.

2.4.3 Motion control setting installation

When the product version of MELSOFT GX Works3 is installed, motion control setting is also installed.

However, motion control setting must be installed in the following cases:

- When motion control setting is not installed
- When upgrading to the latest version of motion control setting
- When MELSOFT GX Works3 was installed with the update module
- When a previous version of MELSOFT GX Works3 is installed

(1) Check before installation

- Log on to the personal computer as an administrator.
- Close all running applications before installation. If the product is installed while other applications are running, it may not operate normally.

(2) Installation procedure

1) Please contact your local sales office for the latest version of motion control setting.

2) After unzipping the downloaded file in any location, double-click "sw1dnn-mucnf-e_****.exe
(Note-1)" in the "sw1dnn-mucnf-e_**** (Note-1)" folder.

(Note-1): **** indicates the motion control setting version.

3) Select or enter the necessary information by following the on-screen instructions. (Note-1)

(Note-1): The product ID is written on the "License certificate" included with the product.

Enter the 12-digit number divided into 3 and 9 digits.

2.4.4 Profile registration

Register the profiles for the devices such as a servo amplifier and a remote I/O module to be used. (The profiles for MR-J5-G/MR-J5W_-G servo amplifiers are automatically registered when MELSOFT GX Works3 is installed.)

(1) Downloading the profiles


Please contact your local sales office for downloading the profiles.

(2) Installing the profiles

After unzipping the downloaded file in any location, register a CSP+ file (zip file).

1) Start MELSOFT GX Works3, click [Tool] → [Profile Management] → [Register], and display the "Register Profile" screen.

Select the file of the language to be used from the unzipped profile, and click the [Register] button.

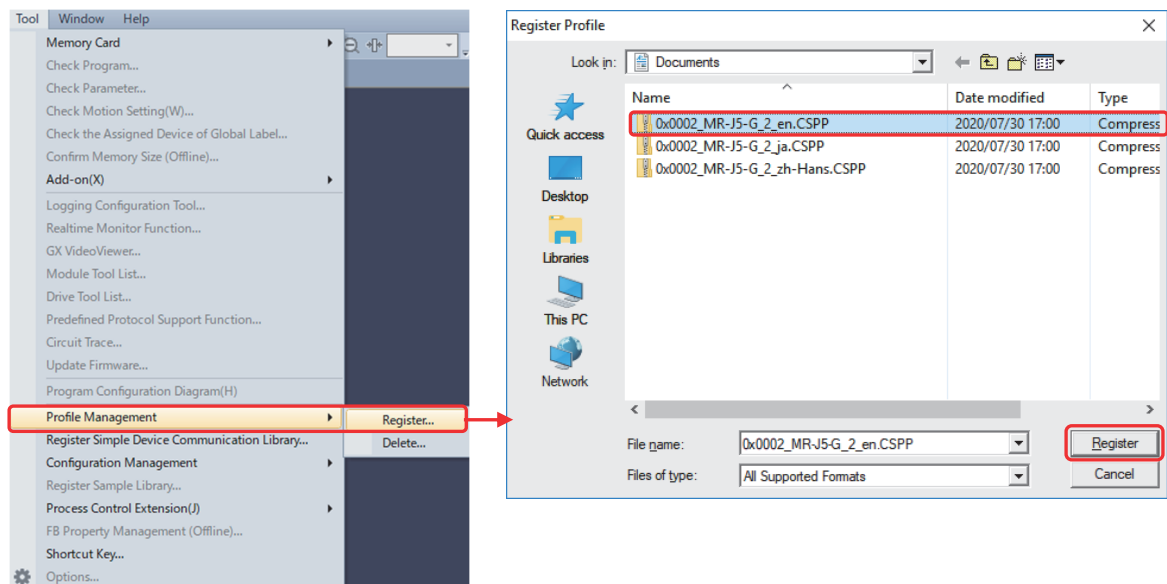

2.4.5 MELSOFT iQ-R Series Motion Module FB library

To create programs with the PLC CPU module, register the FB library with the following procedure.

(1) Downloading the Motion module FB


Please contact your local sales office for downloading the Motion module FBs.

(2) Registration procedure of the Motion module FB library

1) Start MELSOFT GX Works3.


2) Open any project.

Select [Project] → [Library Operation] → [Register to Library List] → [Library], and then click the [OK] button on the confirmation screen.

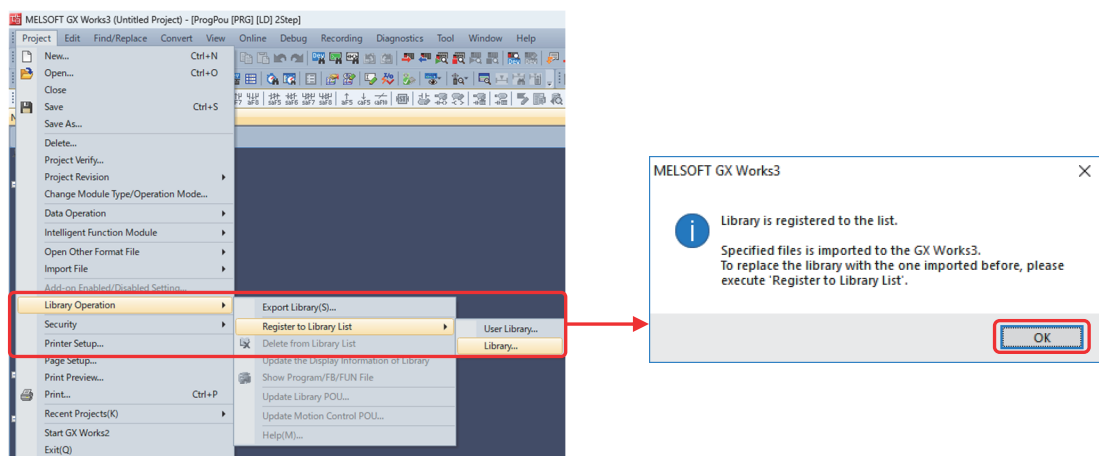

3) On the "Register Library to Library List" screen, select [MotionControl_****.mslm], and click the [Open] button.


Make sure that the Motion module FB is registered in the [Library] tab of the element selection window.

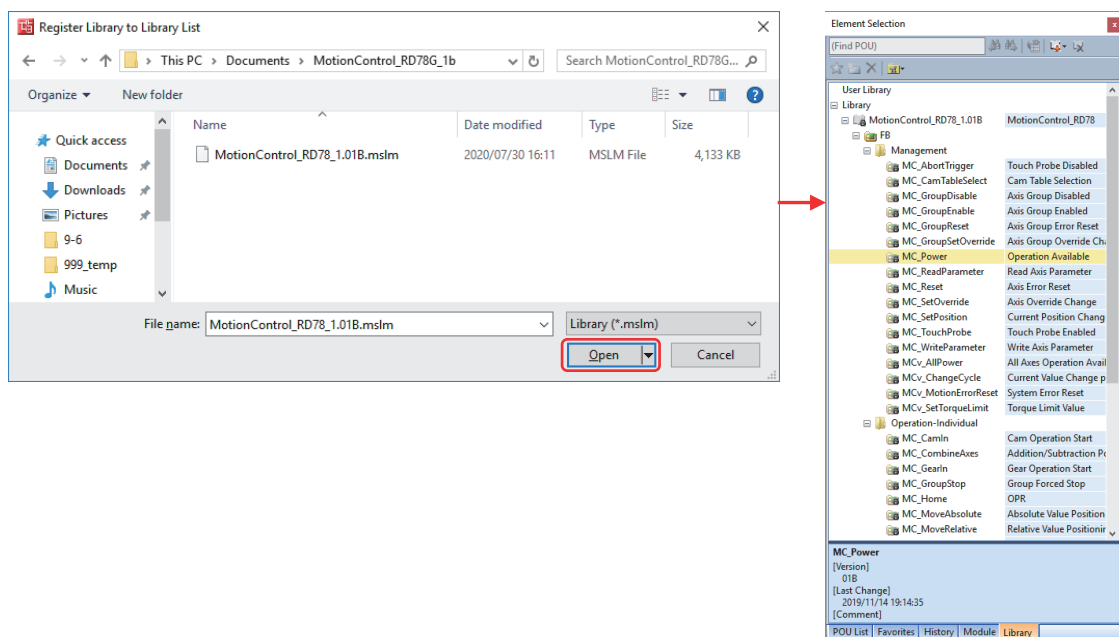

2.5 Module Installation

(1) Installing a battery

The Q6BAT installed in the PLC CPU module is shipped with the connector disconnected. Connect the connector with the following procedure.

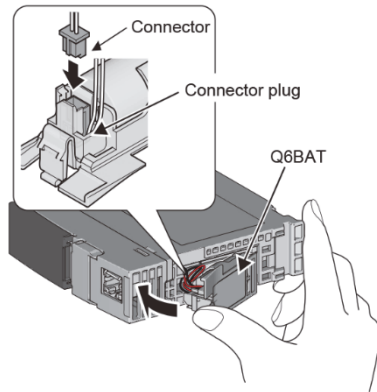

- 1) Open the battery cover located on the bottom of the PLC CPU module.
- 2) Check that the Q6BAT is correctly installed.
- 3) Check the direction of the connector attached to the Q6BAT, and insert it into the connector pins on the cover. Firmly push the connector all the way.
- 4) Close the bottom cover.

(2) Installing the modules

Install each module to the main base unit.

2.6 Wiring and Cable Connection

The following shows a wiring and cable connection example for the Motion module and the servo amplifier.

The listed wire size is applicable when the MR-J5-10G servo amplifier is used.

If the servo amplifiers with other capacities are used, refer to the relevant user's manual.

(1) Wiring the power supply module

The following shows an applicable size of the power and grounding wires for the power supply module. To reduce noise such as lightning surge, connect an isolation transformer.

Item	Applicable wire size
Power wires	AWG 18 to AWG 14
Grounding wires	AWG 18 to AWG 14

(2) Wiring the power supply of the servo amplifier

Wire the control circuit power supply (L11 and L21) and the main circuit power supply (L1, L2, and L3) of the servo amplifier.

Item	Applicable wire size
Control circuit power supply (L11 and L21)	1.25 mm ² to 2 mm ² (AWG 16 to AWG 14)
Main circuit power supply (L1, L2, and L3)	2 mm ² (AWG 14)
Grounding wires	AWG 18 to AWG 14

(3) Rotary switch setting of the servo amplifier

The settings of the rotary switches (SW1 and SW2) of the servo amplifier correspond to the fourth octet of the IP address in the "CC-Link IE TSN Configuration" window.

Rotary switches of the servo amplifier

"Network basic" screen for the servo amplifier

192.168.3.1 Set the 4th octet by the rotary switches (01 to FE)

Confirm [0: Use rotary switch] is selected.

(4) Connecting the cables

Connect the Ethernet cable and the cable for the rotary servo motor.

Connect the personal computer and the PLC CPU module with a USB cable or an Ethernet cable.

(5) Power-on of the system

- 1) Check the wiring of the power supply module.
- 2) Make sure that the PLC CPU module is in the STOP status.
- 3) Turn ON the power supply.



Confirm that the LEDs of the modules are ON.

- Power supply module: LED (green) ON
- PLC CPU module: READY LED (green) ON

The ERROR LED flashes red when parameters and programs are not written to the CPU module, but no immediate error is occurring.

After the parameters and programs are written and the power supply is cycled, the ERROR LED turns OFF.

- Motion module: RUN LED (green) ON


When the communication with the remote station is performed normally after the parameters and programs are written and the power supply is cycled, the ERR LED turns off.

(6) Power-on of the servo amplifier


Check the wiring of the servo amplifier, and turn ON the control circuit power supply of the servo amplifier.

The communication status of the servo amplifier and the Motion module can be checked on the servo amplifier display.


(a) The 7-segment LED display of the servo amplifier (normal status)

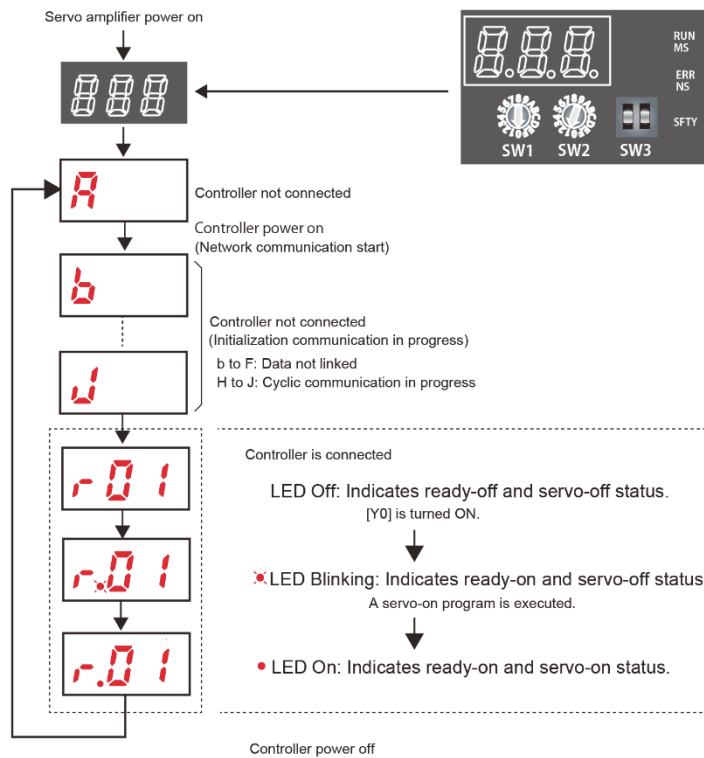


(b) Alarm occurrence of a 1-axis servo amplifier

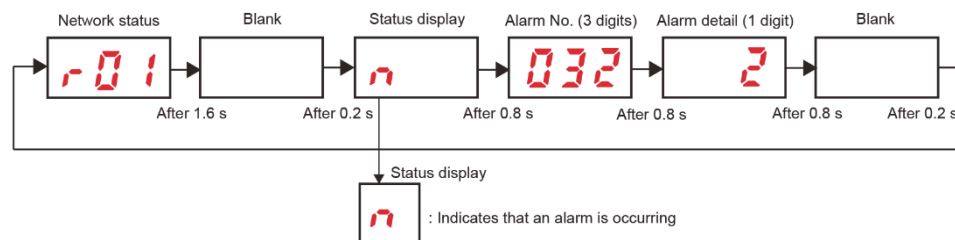

(c) 7-segment LED display during a network connection

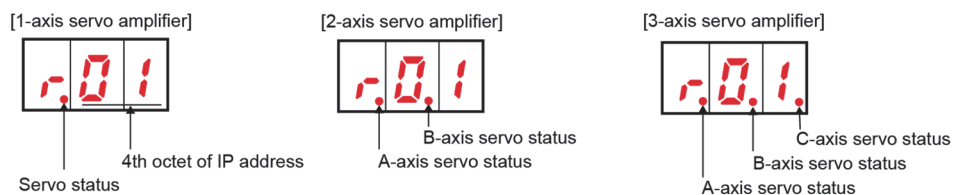

(7) Status LEDs

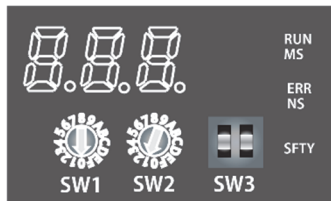


Name	LED color	Description
RUN MS	Green	OFF: Indicates that an alarm is occurring. ON: Indicates that the servo amplifier is ON.
ERR NS	Red	OFF: Indicates that no alarm or warning is occurring. Blinking: Indicates that a warning is occurring. ON: Indicates that an alarm is occurring.
SFTY	Green	OFF: Indicates that the functional safety cannot be activated. ON: Indicates that the functional safety can be activated.

3. PARAMETER SETTING

3.1 Parameter Setting Procedure


The following diagram shows the flow of the parameter setting procedure.

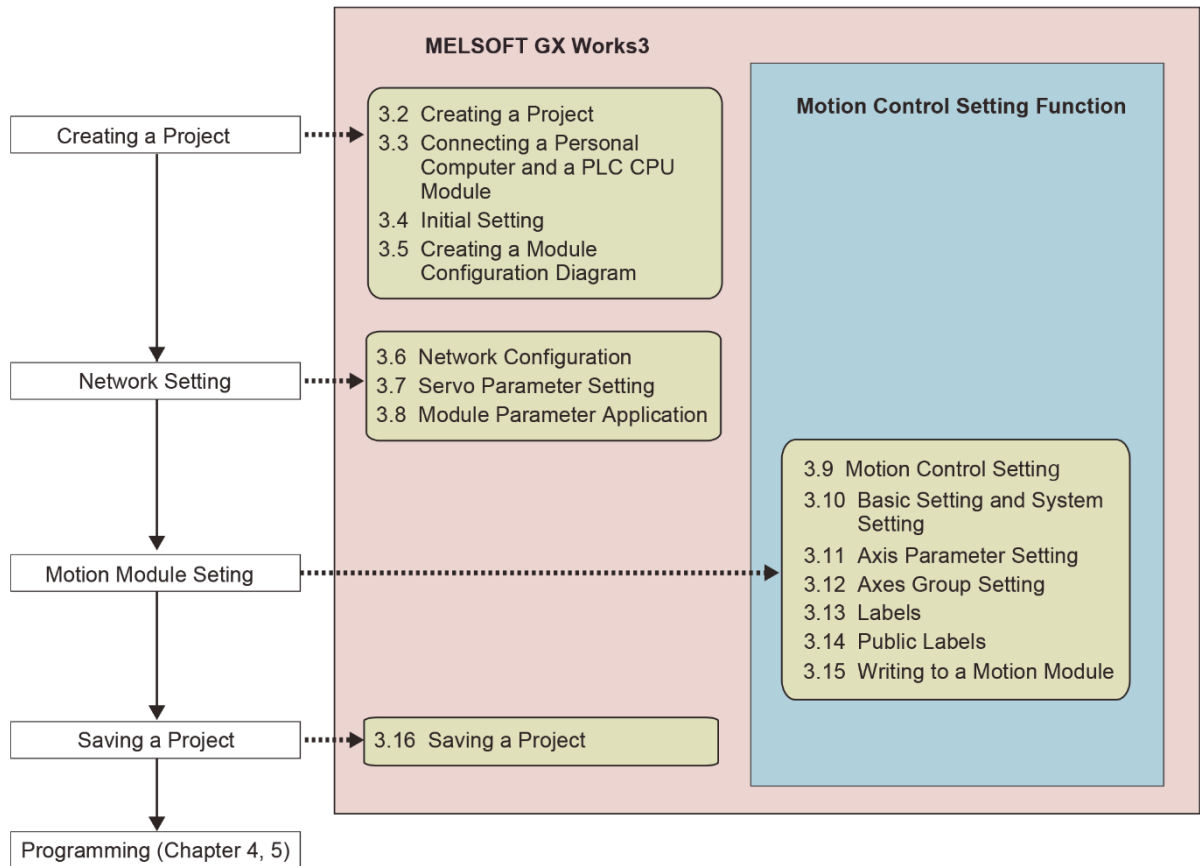


3.2 Creating a Project

Create a new project.

1) Start MELSOFT GX Works3, and select [Project] → [NEW].

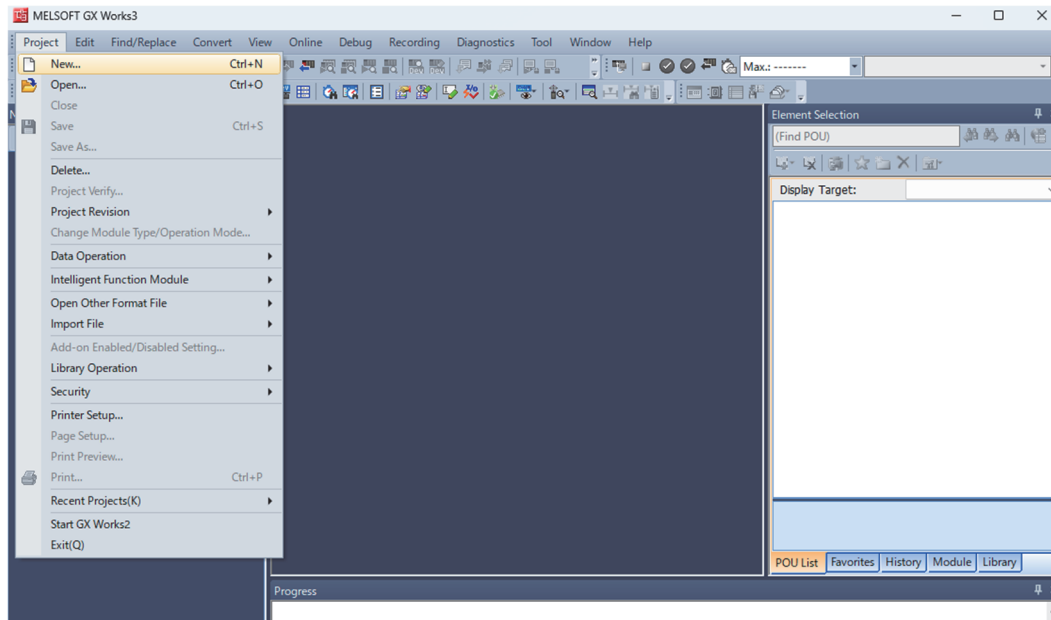

2) Select the series, the type, and the program language, and click the [OK] button.

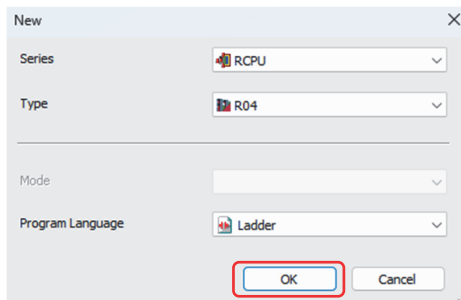


[Setting example]

Series: RCPUC

Type: Select the PLC CPU module to be used

Program language: Select the language to be used

3) Read the displayed message, and click the [OK] button.

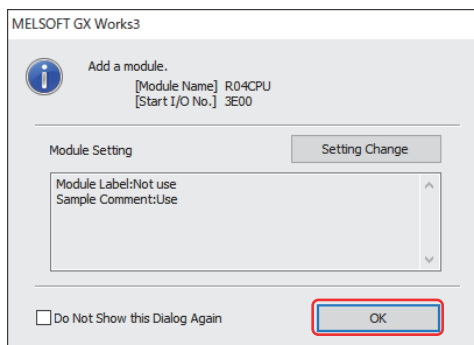

3.3 Connecting a Personal Computer and a PLC CPU Module


Check the connection between a personal computer and a PLC CPU module.

- 1) Connect a personal computer and a PLC CPU module with a USB or Ethernet cable.




- 2) Select [Online] → [Current Connection Destination...] to open the "Specify Connection Destination" screen.

Click the [CPU Module Direct Coupled Setting] button, and set the connection destination for the personal computer.

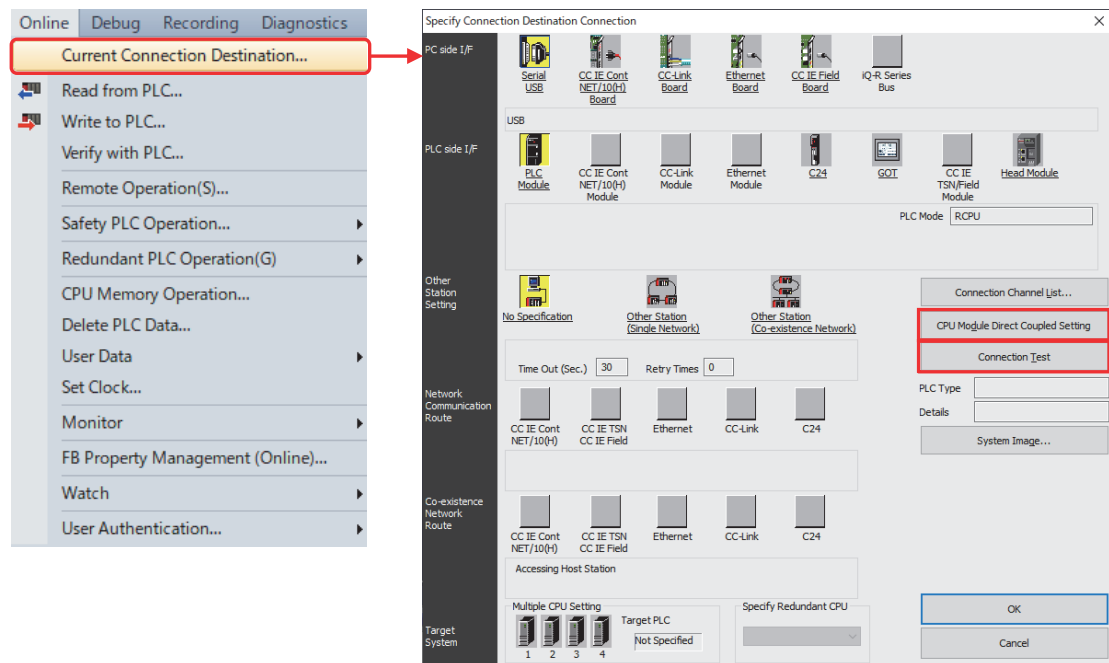


- 3) Select the connection method to be used, and click the [Yes] button to return to the "Specify Connection Destination" screen.

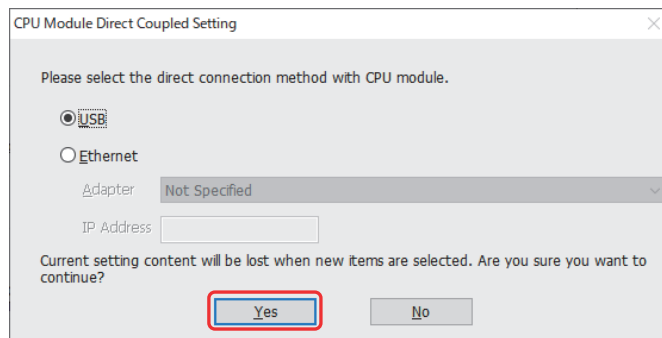

When selecting "Ethernet", specify the adapter.

- 4) Click the [Connection Test] button on the "Specify Connection Destination" screen to perform a connection test with the personal computer.

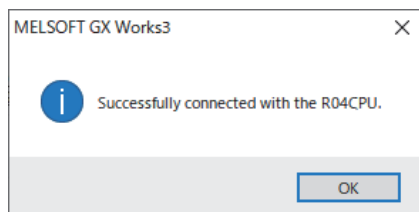


3.4 Initial Setting


3.4.1 Initializing a PLC CPU module

The battery in the PLC CPU module is shipped with the connector disconnected. Therefore, the data in the memory is unstable. Initialize the PLC CPU module to clear the memory.

- 1) Select [Online] → [CPU Memory Operation]. Click the [Initialization] button on the [CPU Memory Operation] screen.

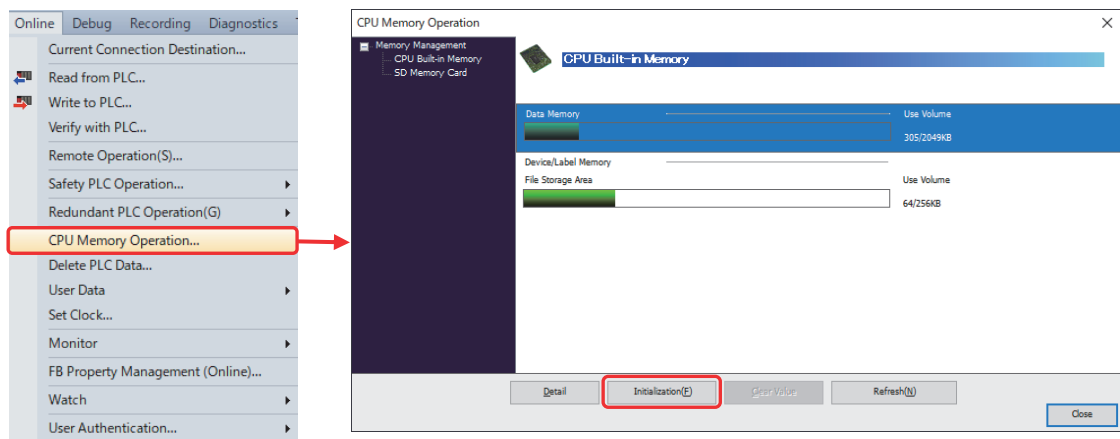


- 2) Click the [Yes] button on the confirmation screen to start initialization.

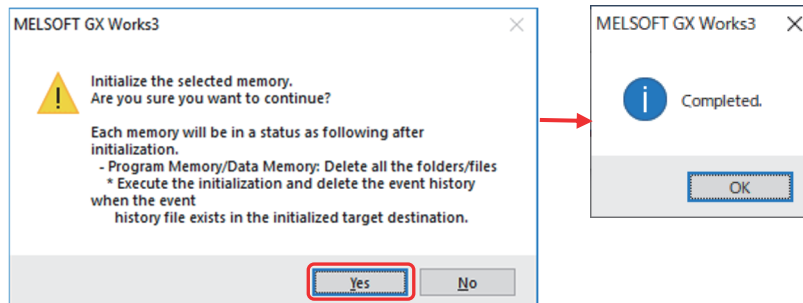

3.4.2 Checking firmware version

Check the firmware version of the PLC CPU module and the Motion module.

- 1) Select [Diagnostics] → [System Monitor] to open the "System Monitor Main Base (R35B)" screen.
Click the [Product Information List] button to open the "Product Information List" screen.

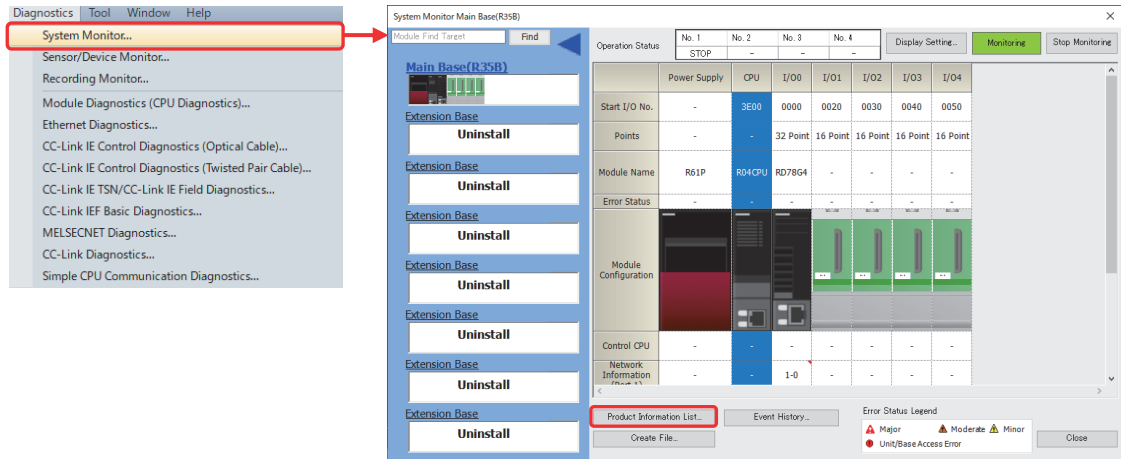


When necessary, update the firmware version of the software. To download the latest firmware version, please contact your local sales office.


3.5 Creating a Module Configuration Diagram

Create a module configuration diagram.


- 1) Double-click "Module Configuration" in the navigation window to open the "Module Configuration" window. Click the [POU List] tab in the element selection window. Select the modules to be used (Main base unit, Power supply module, PLC CPU module, and Motion module) and drag and drop them to the module configuration diagram.

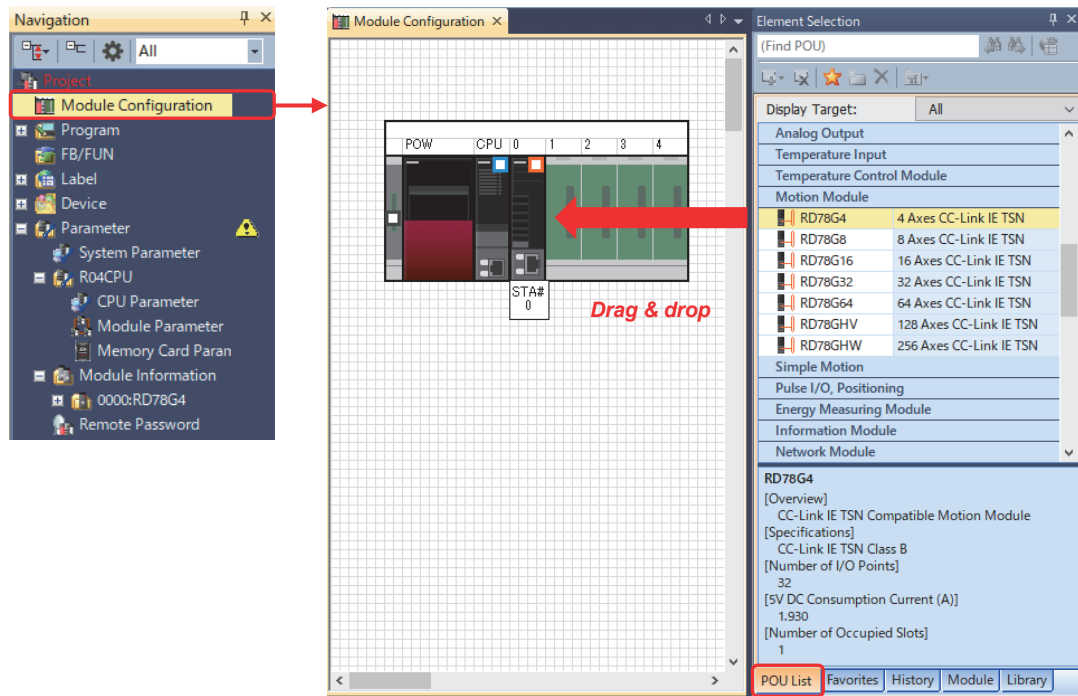

- 2) Select [Edit] → [Parameter] → [Fix], and click the [Yes] button on the confirmation screen.

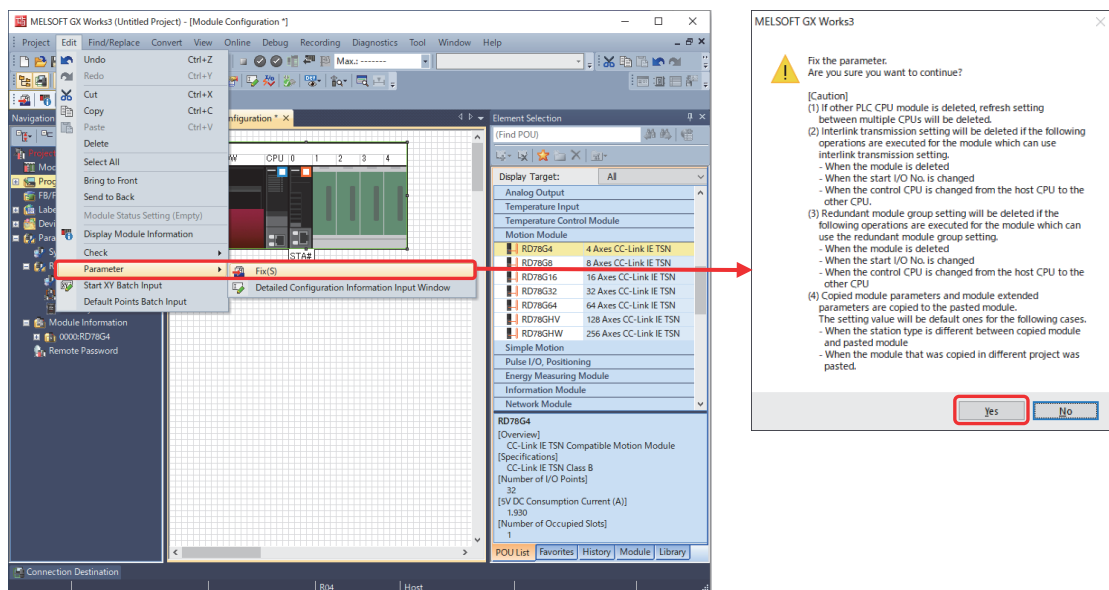


- 3) Click the [Yes] button on the confirmation screen. Read the displayed message, and click the [OK] button to fix the parameters (initial values) for each module.

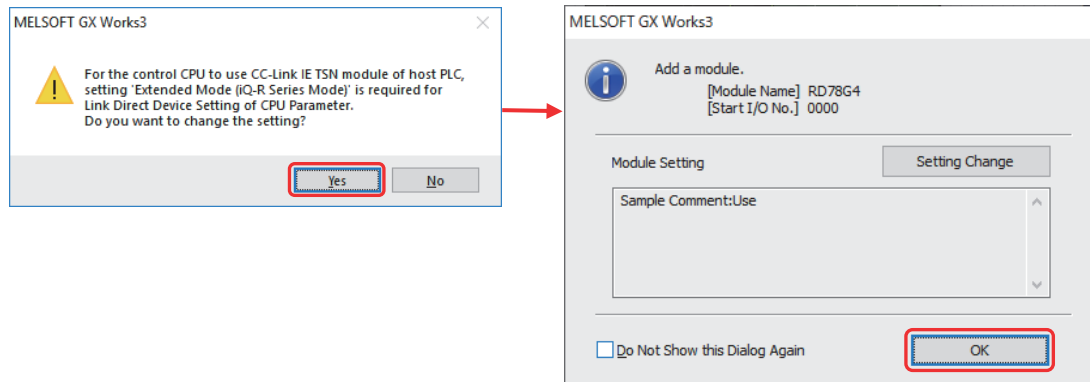

[POINTS]

When using a Motion module, set "Link Direct Device Setting" under "Memory/Device Setting" in Parameter Editor (CPU Parameter) to "Extended Mode (iQ-R Series Mode)". Parameter Editor (CPU Parameter) can be displayed by selecting [Parameter] in the navigation window → [Name of CPU module*1] and double-clicking [CPU Parameter].

*1: The model name of the set CPU module is displayed.

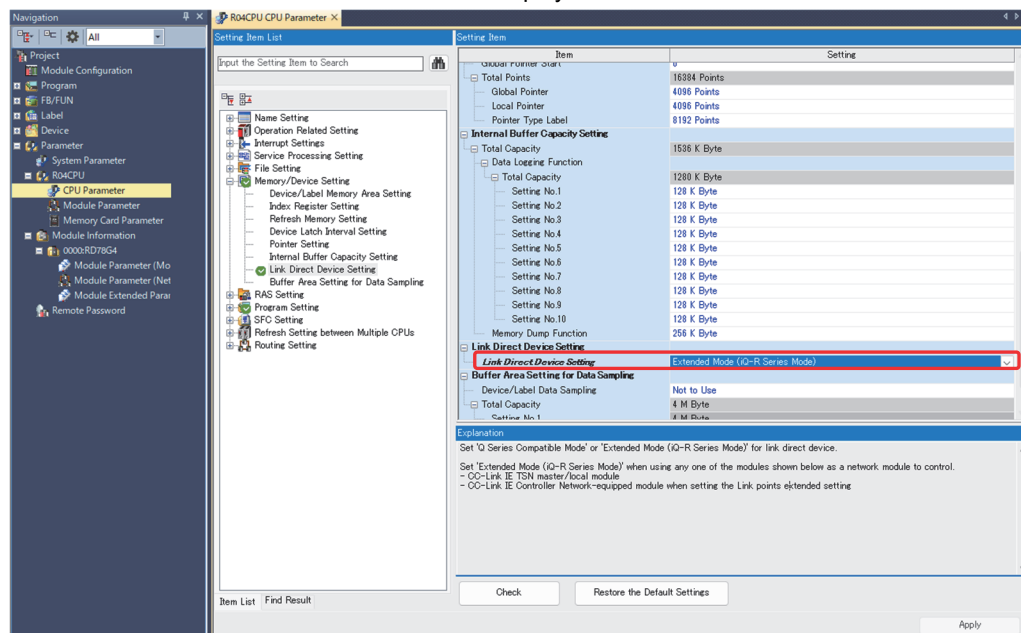


3.6 Network Configuration

Set device stations, such as servo amplifiers, to be connected to CC-Link IE TSN.


3.6.1 Setting a network configuration

- 1) Double-click "Module Parameter (Network)" of the Motion module in the navigation window. Set "Required Settings" → "Network No." and "IP Address" in the parameter editor (Module Parameter).

The example in this document uses the initial value. (Network No.: 1, IP Address: 192.168.3.253)

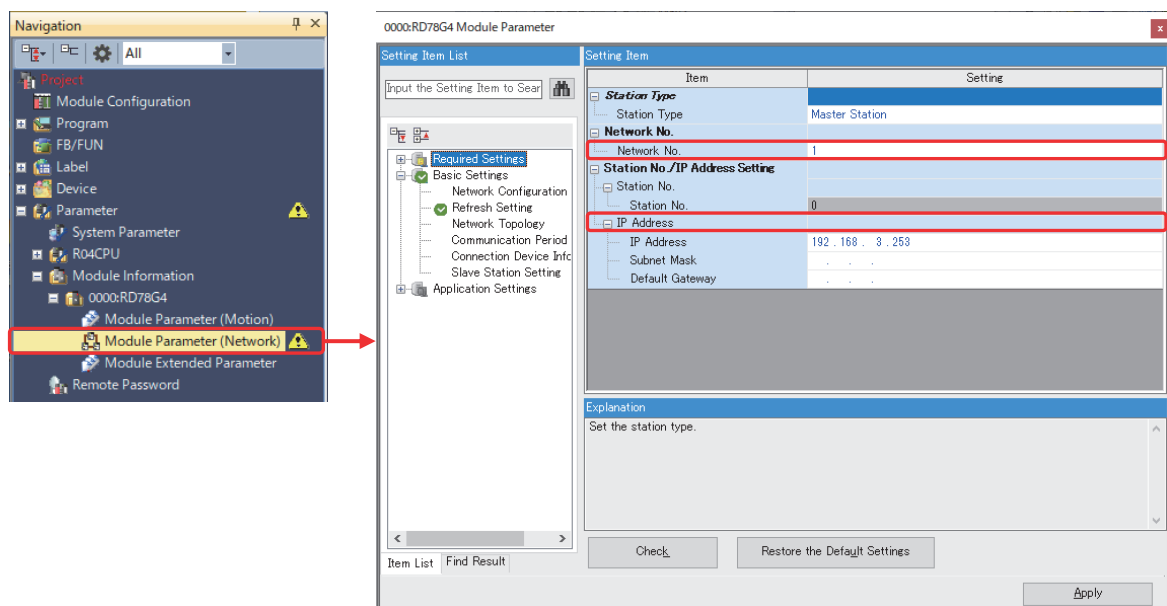


- 2) Double-click "Basic Settings" → "Network Configuration Settings" → "<Detailed Setting>" in the parameter editor (Module Parameter) to open the "CC-Link IE TSN Configuration" window.

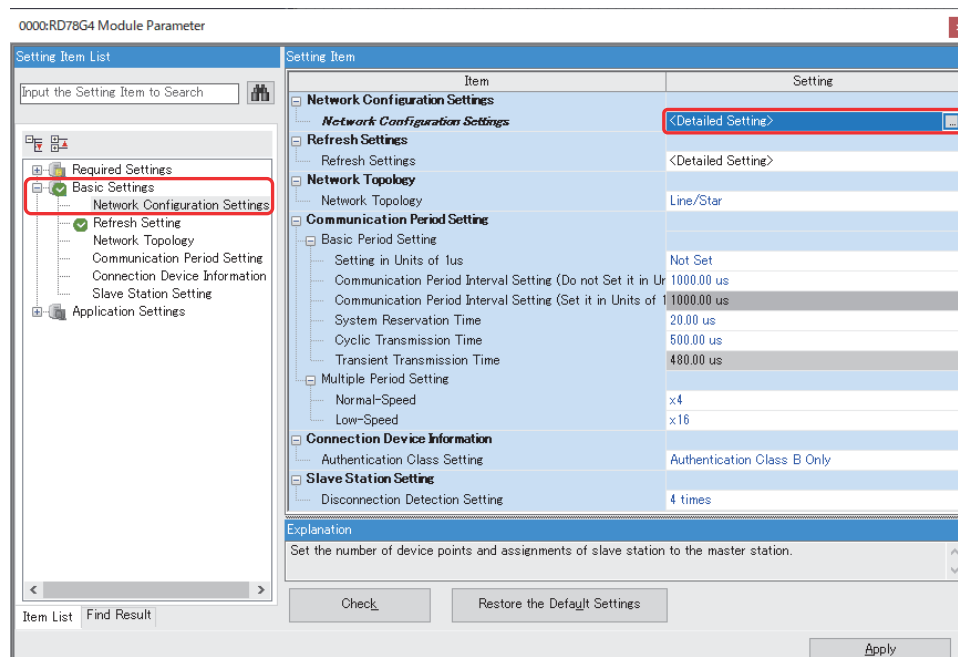

3) Select the devices to be used in the module list, and drag and drop them.


The initial values are displayed in the station No. and the I/O points. The IP address is assigned automatically based on the master station setting, the master station No., and the order the module is dropped.

The setting example in this document uses two units of the servo amplifiers. Drag and drop MR-J5-G twice.

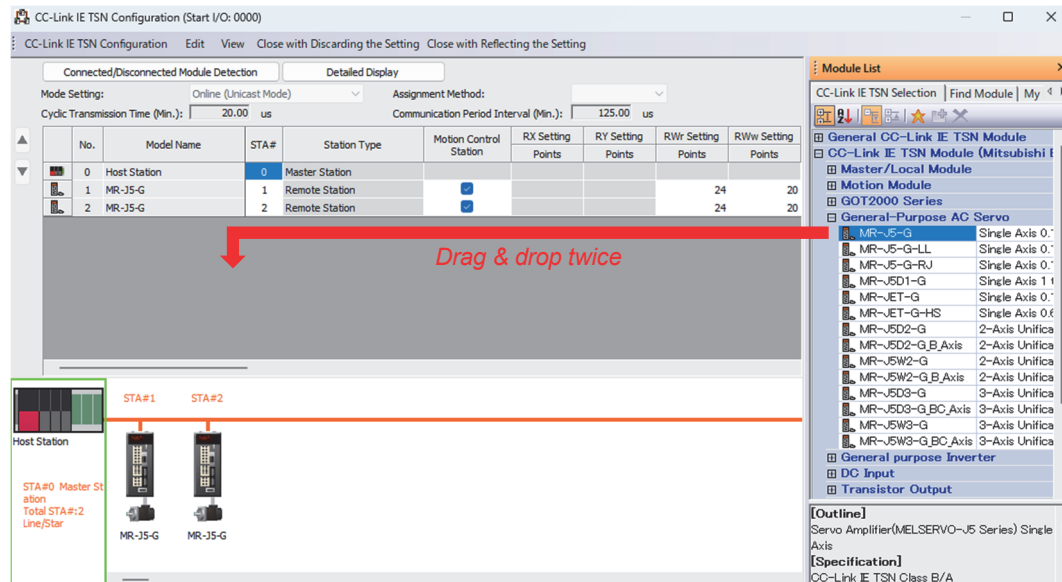

(Note): When adding devices which are not listed in the module list, register the profiles.
(Refer to Section 2.4.3.)

[POINTS]

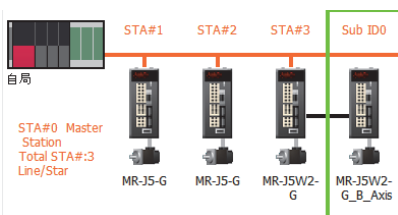


When the user drags and drops a multi-axis servo amplifier (MR-J5W_ -G), the B-axis and C-axis are set together with the A-axis.

3.6.2 PDO mapping

Set default data of the PDO mapping in a batch.

- 1) Select [CC-Link IE TSN Configuration] → [Batch Setting of PDO Mapping]. Click the [Yes] button on the confirmation screen to set the default pattern of the PDO mapping in a batch.

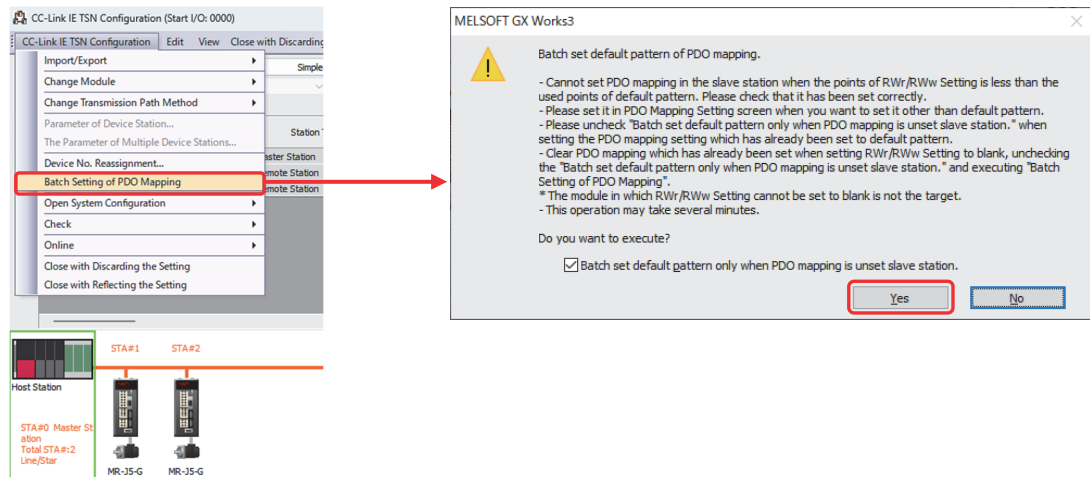**[POINTS]**

PDO is an abbreviation for Process Data Object.

The PDO communication is equivalent to the conventional CC-Link cyclic communication.

The PDO mapping performs mapping (associating) of the data (object) which is sent/received between the master station and the device stations in cyclic communication (PDO communication).

3.6.3 Setting a motion control station

Select the checkboxes of "Motion Control Station" of the modules controlled by the Motion module such as servo amplifiers and I/O modules.

The screenshot displays the 'CC-Link IE TSN Configuration' software. The main window features a table with the following data:

No.	Model Name	STA#	Station Type	Motion Control Station	RX Setting Points	RY Setting Points	RWr Setting Points	RWw Setting Points
0	Host Station	0	Master Station	☐				
1	MR-J5-G	1	Remote Station	☒			24	20
2	MR-J5-G	2	Remote Station	☒			24	20

Below the table is a network diagram showing a 'Host Station' connected to two 'Remote Stations' (STA#1 and STA#2) via a CC-Link IE TSN line. The remote stations are labeled 'MR-J5-G'. A green box highlights the 'Host Station' and its status: 'STA#0 Master Station', 'Total STA#s:2', 'Line/Star'.

The right sidebar contains a 'Module List' with the following categories and modules:

- General CC-Link IE TSN Module
- CC-Link IE TSN Module (Mitsubishi)
- Master/Local Module
- Motion Module
- GOT2000 Series
- General-Purpose AC Servo
 - MR-J5-G Single Axis 0.1
 - MR-J5-G-LL Single Axis 0.1
 - MR-J5-G-RJ Single Axis 0.1
 - MR-J5D1-G Single Axis 1.1
 - MR-JET-G Single Axis 0.1
 - MR-JET-G-HS Single Axis 0.1
 - MR-J5D2-G 2-Axis Unifica
 - MR-J5D2-G_B Axis 2-Axis Unifica
 - MR-J5W2-G 2-Axis Unifica
 - MR-J5W2-G_B Axis 2-Axis Unifica
 - MR-J5D3-G 3-Axis Unifica
 - MR-J5D3-G_BC Axis 3-Axis Unifica
 - MR-J5W3-G 3-Axis Unifica
 - MR-J5W3-G_BC Axis 3-Axis Unifica
- General purpose Inverter
- DC Input
- Transistor Output

The bottom right corner shows the 'Outline' and 'Specification' sections:

[Outline]
Servo Amplifier(MELSERVO-J5 Series) Single Axis

[Specification]
CC-Link IE TSN Class B/A


3.7 Servo Parameter Setting

There are two methods for writing parameters to servo amplifiers.


Writing method	Advantage	Disadvantage
Writing to a PLC CPU module by MELSOFT GX Works3	<ul style="list-style-type: none"> Batch-management of parameters Setting parameters without connecting servo amplifiers 	<ul style="list-style-type: none"> Taking time at the initial communication
Writing to servo amplifiers by MR Configurator2	<ul style="list-style-type: none"> Quick startup of servo amplifiers since transmission of parameters is not necessary at power-on 	<ul style="list-style-type: none"> Necessary to write parameters to each servo amplifier

The following shows the procedure for writing servo parameters to a PLC CPU module by MELSOFT GX Works3.


- 1) Select the checkboxes of "Parameter Automatic Setting" in the "CC-Link IE TSN Configuration" window to write parameters to the device stations from the master station at the initial communication.

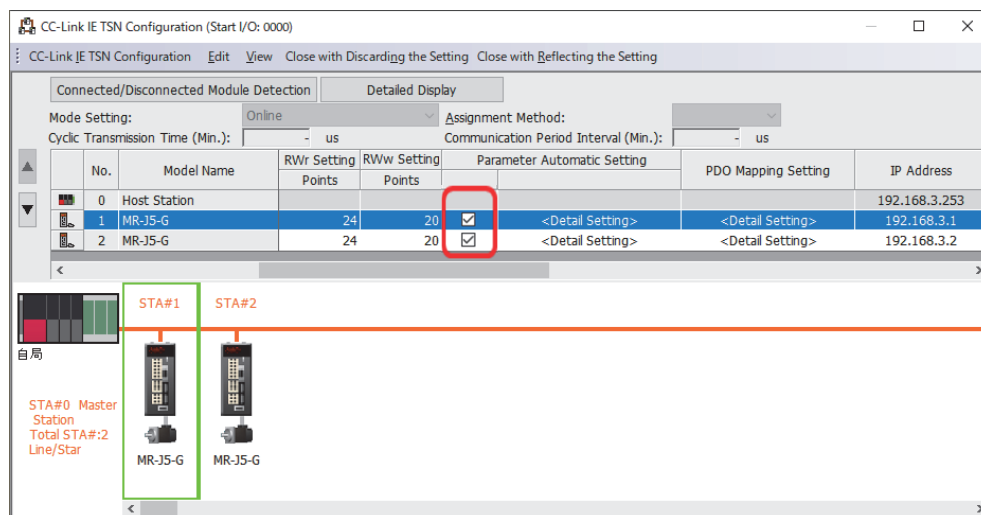

- 2) Double-click the illustration of the servo amplifier to be set, and click the [Yes] button on the confirmation screen.

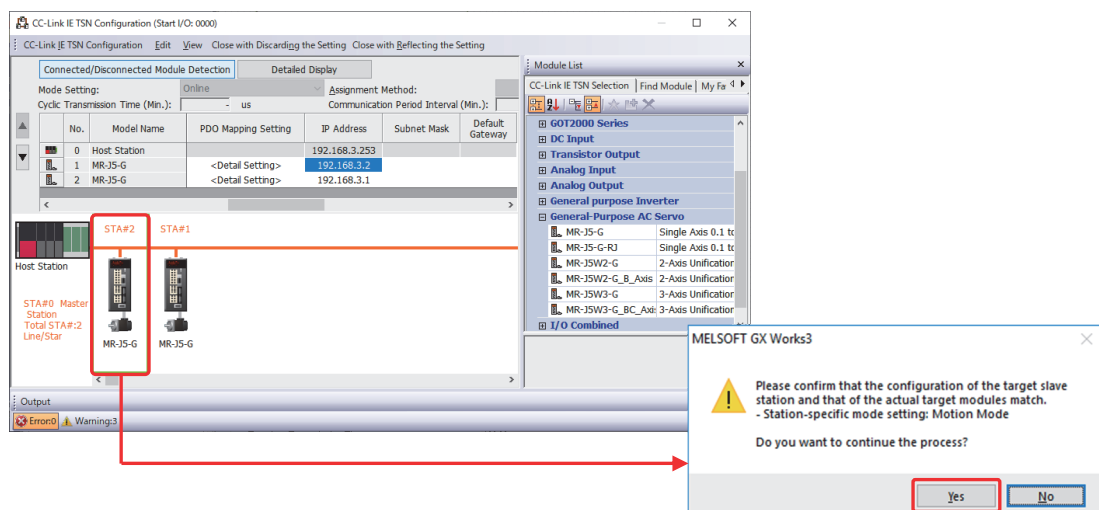

3) Set servo parameters on the "Parameter Setting" screen.

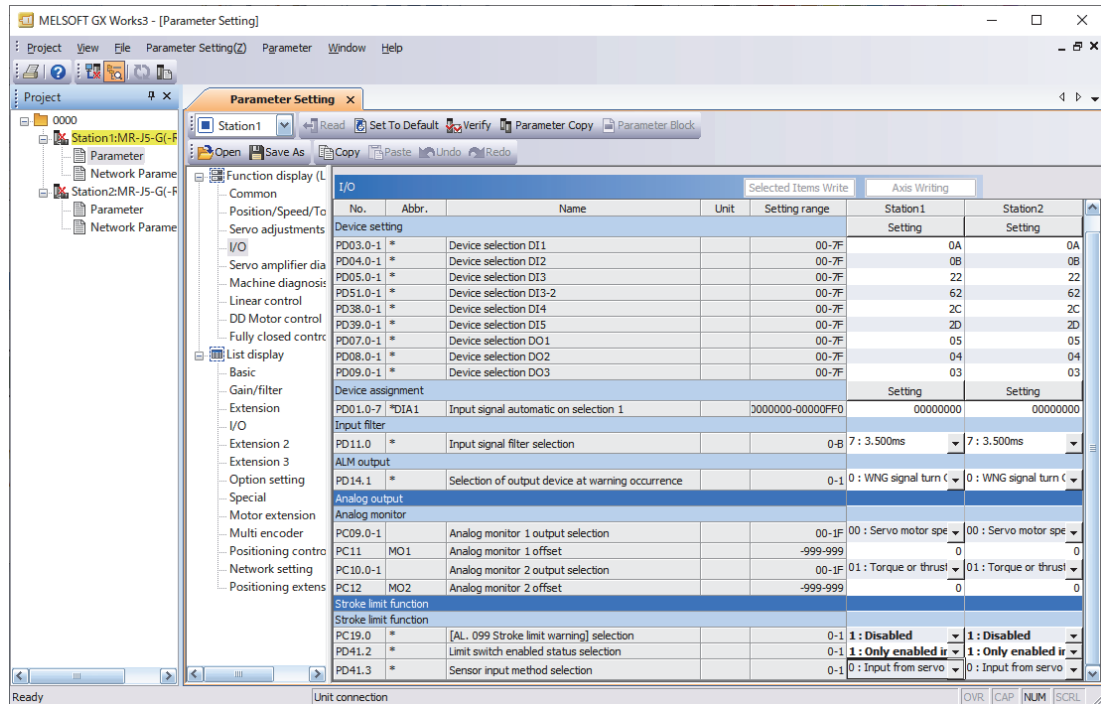


The example in this document changes the following parameters.


Operation	No.	Item	Setting value
[Common] → [Basic] → [Forced stop]	PA04.2	Servo forced stop selection	0: Enabled → 1: Disabled
[I/O] → [Stroke limit function] → [Stroke limit function]	PC19.0	[AL. 099 Stroke limit warning] selection	0: Enabled → 1: Disabled
	PD41.2	Limit switch enabled status selection	0: Always enabled → 1: Only enabled in home position return mode

4) Click the [x] button at the upper right in the window.


Click the [Yes] button on the confirmation screen to update the parameters.

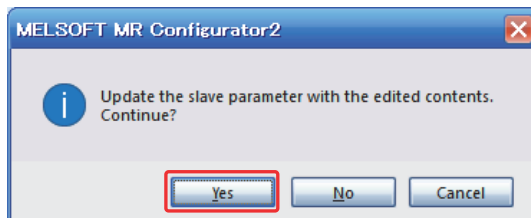

5) Click the [Close with Reflecting the Setting] button to reflect the data.

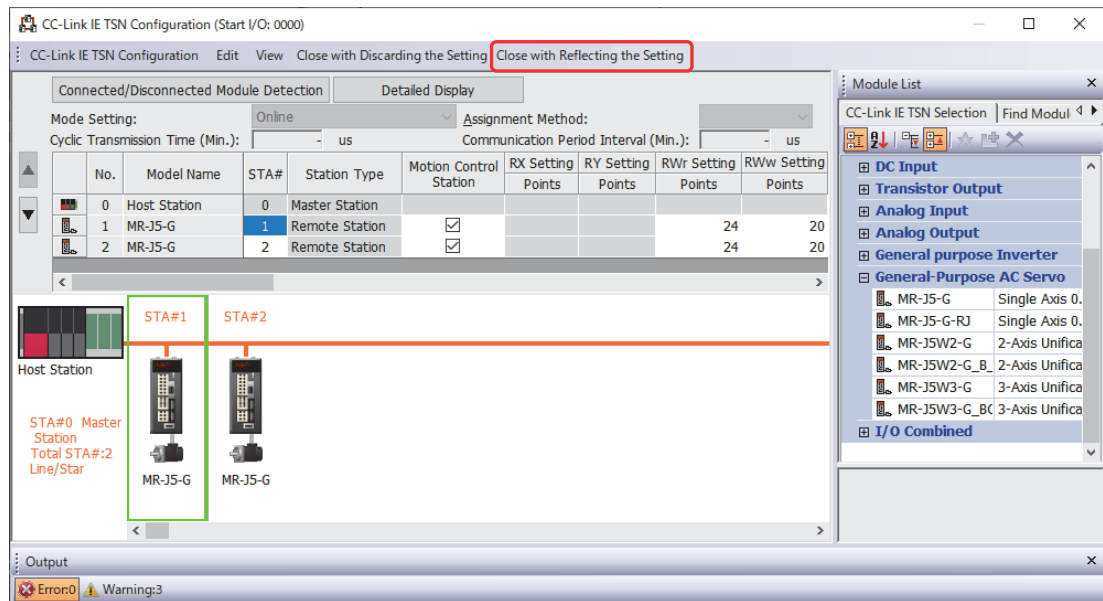


Although the warning window appears depending on the version, click the [Yes] button.

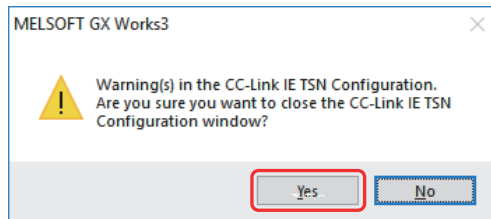

3.8 Module Parameter Application

Click the [Apply] button in the parameter editor (Module Parameter) to reflect the parameters of the Motion module.

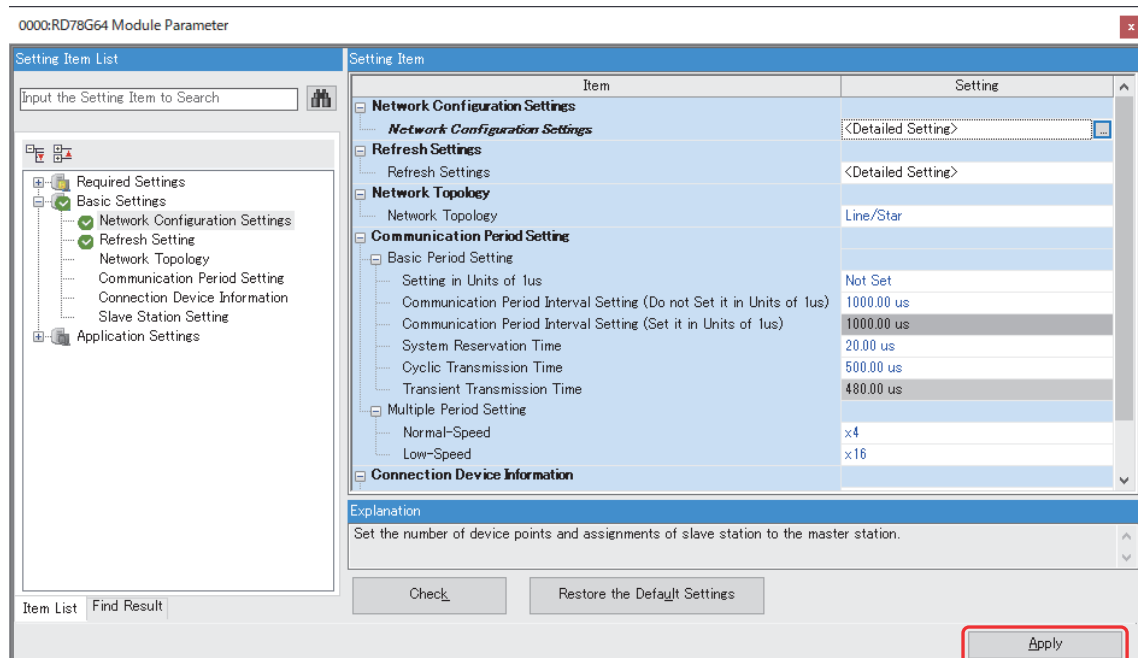**[POINTS]**


Note that changes in the parameters are not reflected unless clicking the [Apply] button.

3.9 Motion Control Setting

Set parameters and create programs for the Motion module on the motion control setting screen.

Double-click "Module Extended Parameter" of the Motion module in the navigation window to open the motion control setting function.


The set items are saved as a project of MELSOFT GX Works3.

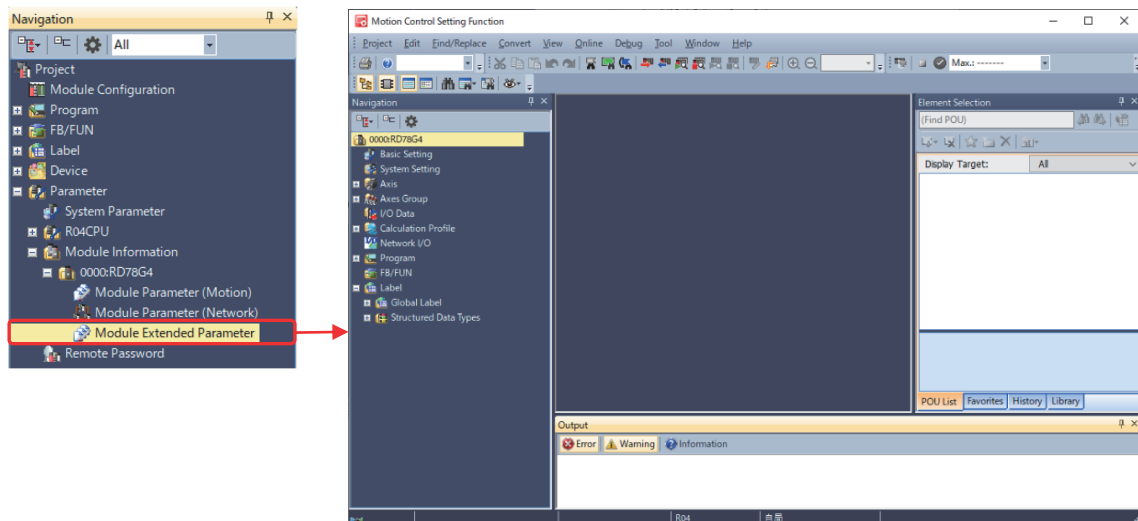

3.10 Basic Setting and System Setting

In the basic setting, set each parameter for the programs. In the system setting, set the all axes forced stop and each parameter for the add-ons.

Change the parameters as necessary. (The example in this document uses the initial values.)

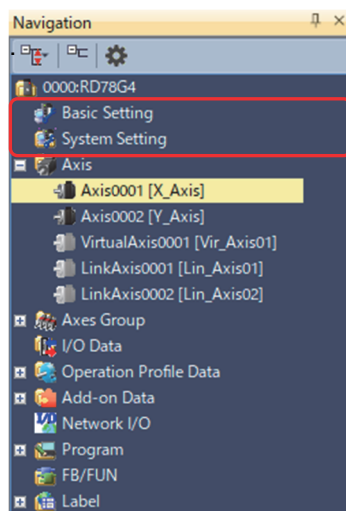

[POINTS]

If the "Motion Control Setting Function" screen does not display even when double-clicking "Module Extended Parameters", it is possible that the motion control setting function may not have been installed. To use this function, install the motion control setting function.

3.11 Axis Parameter Setting

3.11.1 Setting a station address and an axis type

Axes are classified into five types as follows.

- Real drive axis : Outputs commands using a servo amplifier connected to CC-Link IE TSN.
- Real encoder axis : Generates the current position from the output pulses of the synchronous encoder which is connected to a servo amplifier on CC-Link IE TSN.
- Virtual drive axis : Virtually generates commands.
- Virtual encoder axis : Virtually generates the current position from the variables.
- Virtual linked axis : Virtually connects FBs of the single axis synchronous control.


The example in this document registers two real drive axes, one virtual drive axis, and two virtual linked axes.

1) Real drive axis

Set the station address to link the axis information in the axis parameter to the servo amplifier set in the network configuration.

Right-click "Axis" in the navigation window of the motion control setting function, and select [Add New Data].

Enter the data name, the axis No., the station address setting, and the axis type setting as the following table shows, and click the [OK] button.

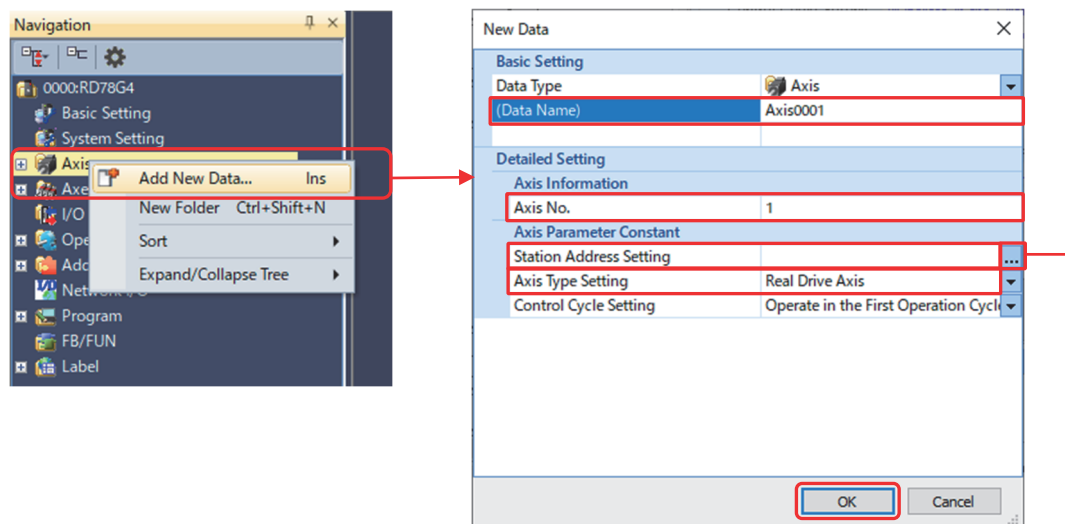

Click the [] button to open the "Station Address Setting" screen, and set the station address.

IP Address	Model Name	Alias
192.168.3.1	MR-J5-G	
192.168.3.2	MR-J5-G	

Setting item	First axis	Second axis
Data Name	Axis0001	Axis0002
Axis No.	1	2
Station Address Setting	192.168.3.1	192.168.3.2
Axis Type Setting	Real Drive Axis	Real Drive Axis

[POINTS]

For the station address setting, use the IP address set in the CC-Link IE TSN configuration window.
A multi-drop No. is shown when a station address of the second or the third axis of a multi-axis servo amplifier is specified.

Example: For B-axis of MR-J5-W3 with an IP address of 192.168.3.1

192.168.3.1#1
 └───┬─── Multidrop No. (#0: A-axis, #1: B-axis, #2: C-axis)
 └─── IP address

2) Virtual drive axis

Right-click "Axis" in the navigation window of the motion control setting function, and select [Add New Data].

Enter the data name, the axis No., and the axis type setting as the following table shows, and click the [OK] button.

New Data

Basic Setting

Data Type: Axis

(Data Name): VirtualAxis0001

Detailed Setting

Axis Information

Axis No.: 301

Axis Parameter Constant

Axis Type Setting: Virtual Drive Axis

Control Cycle Setting: Operate in the First Operation Cycle

OK Cancel

Setting item	First axis
Date Name	VirtualAxis0001
Axis No.	301
Axis Type Setting	Virtual Drive Axis

3) Virtual linked axis

Right-click "Axis" in the navigation window of the motion control setting function, and select [Add New Data].

Enter the data name, the axis No., and the axis type setting as the following table shows, and click the [OK] button.

The screenshot shows the 'New Data' dialog box with the following settings:

- Basic Setting**
 - Data Type: Axis
 - (Data Name): LinkAxis0001
- Detailed Setting**
 - Axis Information
 - Axis No.: 401
 - Axis Parameter Constant
 - Axis Type Setting: Virtual Link Axis
 - Control Cycle Setting: Operate in the First Operation Cycle


The 'OK' button is highlighted with a red box.

Setting item	First axis	Second axis
Data Name	LinkAxis0001	LinkAxis0002
Axis No.	401	402
Axis Type Setting	Virtual Link Axis	Virtual Link Axis

3.11.2 Setting each item

1) Real drive axis

Double-click "Axis" → "Axis0001" in the navigation window to open the "Axis Parameter Setting" window.

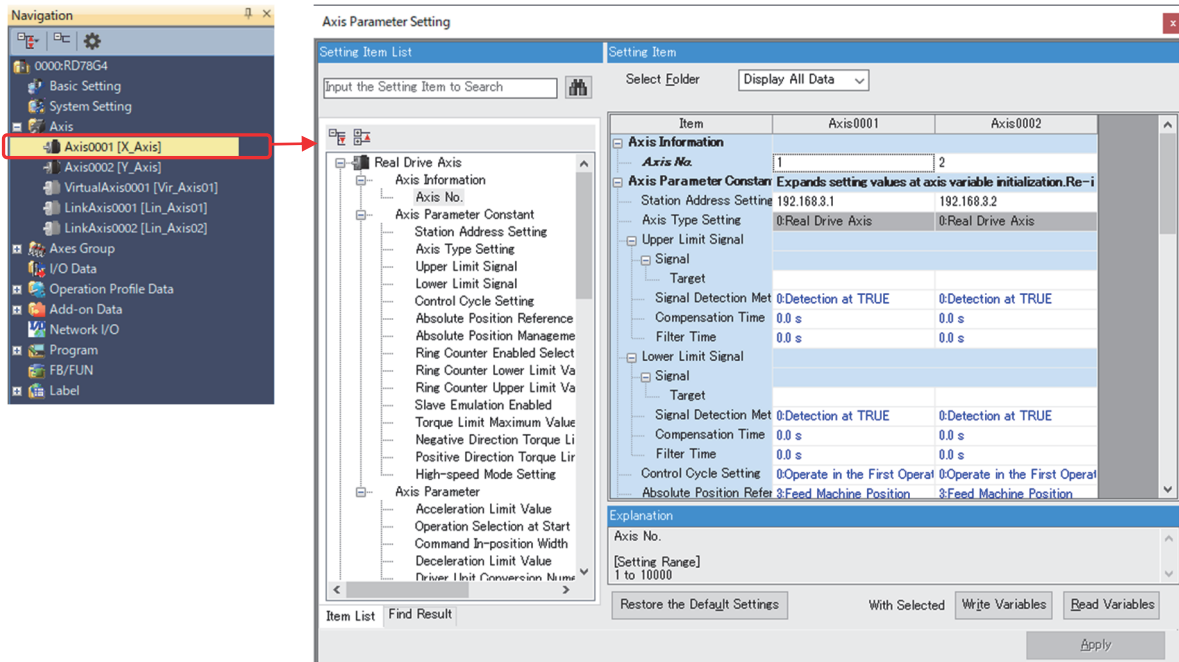

The setting example in this document is shown below.


Item		Description	Axis0001 setting value	Axis0002 setting value
Axis Parameter Constant	Station Address Setting	Set the IP address of the driver.	192.168.3.1	192.168.3.2
	Upper Limit Signal Lower Limit Signal	Set the hardware stroke limit switches at the upper/lower limit of the movable range by assigning external signals.	Initial value (Refer to Appendix 2.)	
Axis Parameter	Driver Unit Conversion Numerator	Convert units of the target position and the feedback position between the controller and the driver. (Refer to Section 3.11.3 for the setting methods.)	67108864	
	Driver Unit Conversion Denominator		5000	
	Stop Signal → Signal → Target	Set the stop signal.	[VAR]G_bStopSignalX (Note-1)	[VAR]G_bStopSignalX (Note-1)
	Forced Stop Signal, Stop Signal	Set the forced stop signal and the stop signal.	Initial value	
	Start Permission at Home Position Return Uncompleted	Set whether axis start is allowed or not for when the homing request is true.	0: Not allowed	
	Software Stroke Limit Upper Limit Value/Lower Limit Value/Target	Set the range and the target of the software stroke limit	Initial value	
	Position Command Unit	Set the position command unit and the speed command unit used for the motion control.	um ^(Note-2)	
	Speed Command Unit	The units used in this document are as follows: [um] for the position command unit and [um/s] for the speed command unit.	U/s	

(Note-1): The stop signal is registered as a global label. Refer to Section 4.3.2 or Section 5.3.2 for setting the global labels.

(Note-2): "um" indicates micrometer.

2) Virtual drive axis

Double-click "Axis" → "VirtualAxis0001" in the navigation window to open the "Axis Parameter Setting" window.

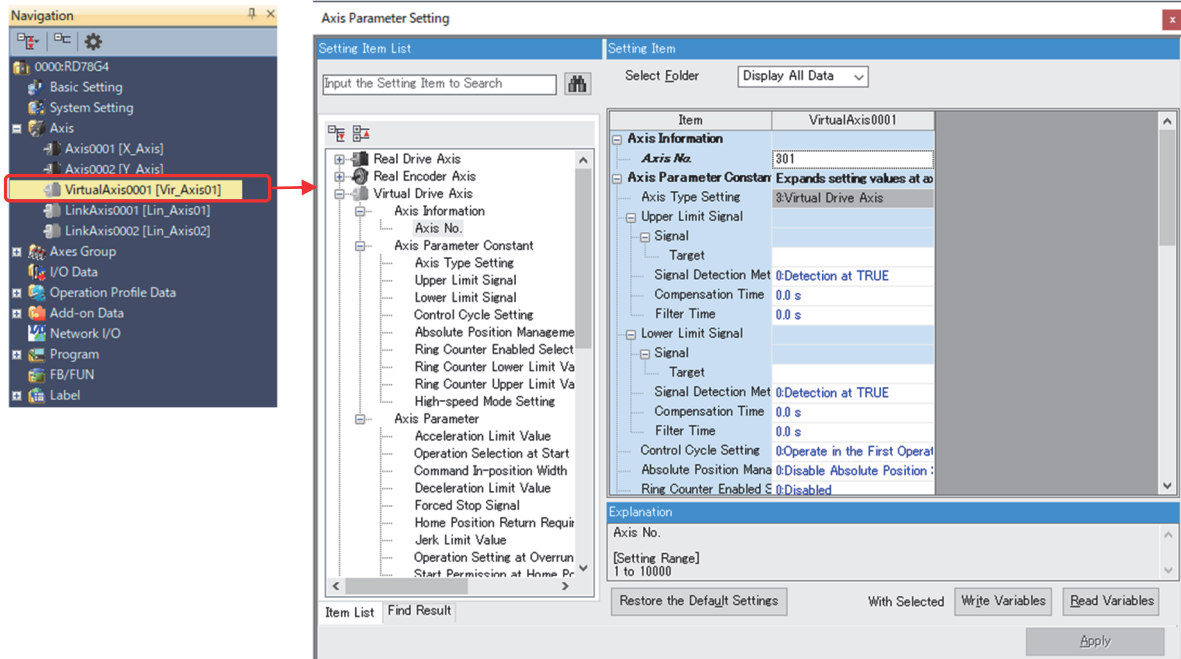


The setting example in this document is shown below.

Item		Description	Setting value
Axis Parameter	Position Command Unit	Set the position command unit and the speed command unit used for the motion control. In this example, the same unit as that of the real drive axis is set for the virtual drive axis ([um] for the position command unit and [um/s] for the speed command unit).	um
	Speed Command Unit		U/s

3) Virtual linked axis

Double-click "Axis" → "LinkAxis0001" in the navigation window to open the "Axis Parameter Setting" window.

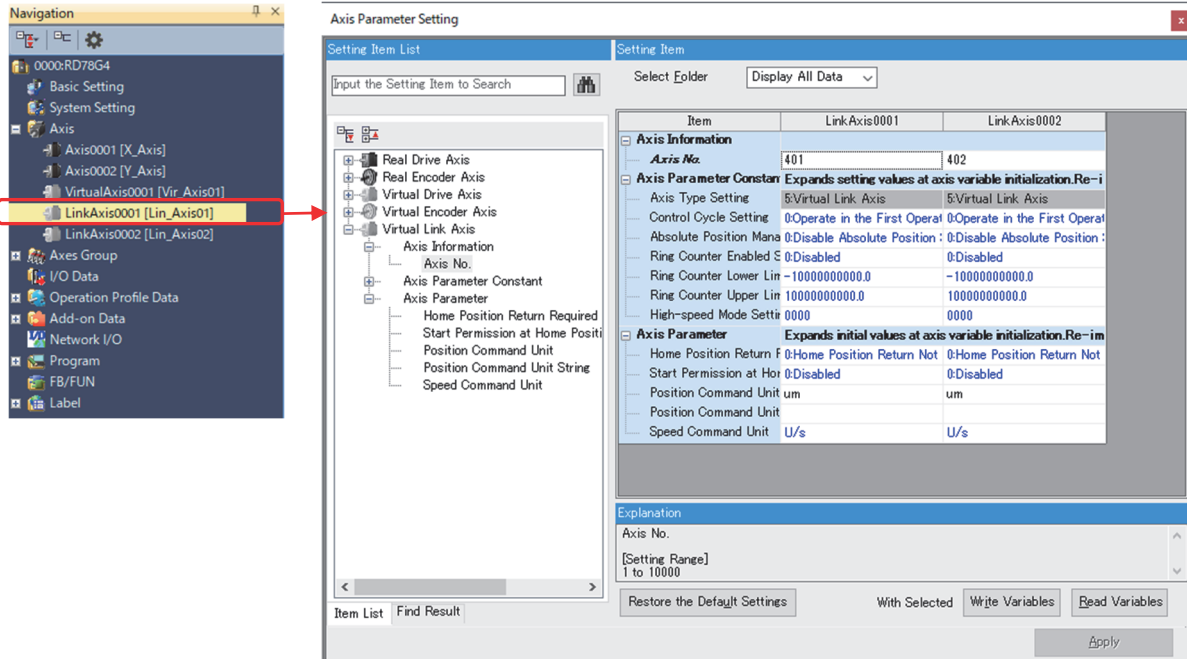

The setting example in this document is shown below.


Item		Description	Setting value
Axis Parameter	Position Command Unit	Set the position command unit and the speed command unit used for the motion control. In this example, the same unit as that of the real drive axis is set for the virtual linked axes ([um] for the position command unit and [um/s] for the speed command unit).	um
	Speed Command Unit		U/s

3.11.3 Driver unit conversion (electronic gear)

A setting example of driver unit conversion numerator/driver unit conversion denominator is shown below.

(1) About an electronic gear

[Ball screw]

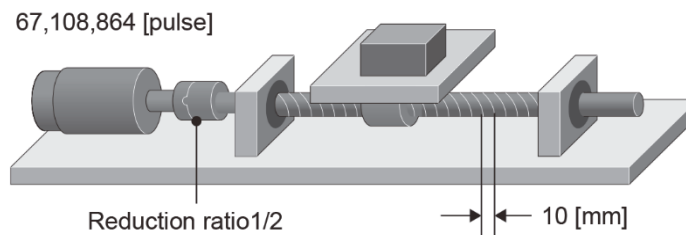

Servo motor encoder resolution: 67,108,864 [pulse] (26 bits)

Lead of the ball screw: 10000 [um]

Reduction ratio: 1/2 (Load side [NL]/Motor side [NM])

When the servo motor rotates twice, the ball screw of the load side rotates once.

$$\begin{aligned} \frac{\text{Driver unit conversion numerator}}{\text{Driver unit conversion denominator}} &= \frac{\text{Number of encoder pulses}}{\text{Movement amount} \times \text{Reduction ratio}} \\ &= \frac{67108864}{10000 \times 1/2} = \frac{67108864}{5000} \end{aligned}$$


Driver unit conversion numerator = Number of pulses per rotation 67,108,864

Driver unit conversion denominator = Movement amount per rotation 5000

(2) Electronic gear setting

The procedure of the electronic gear setting is shown below.


- 1) Click the  button in the "Axis Parameter" → "Driver Unit Conversion Numerator" or "Driver Unit Conversion Denominator" to open the "Electronic Gear Setting" screen.

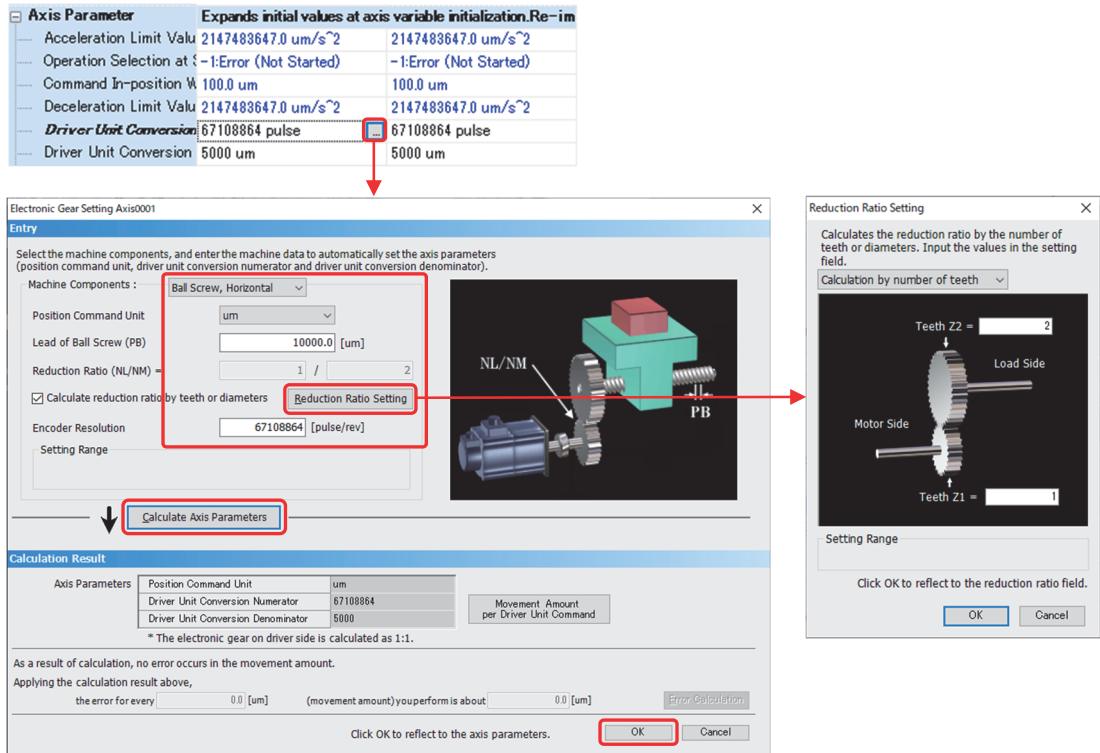

- 2) Enter data of the machine components. Click the [Reduction Ratio Setting] button to open the "Reduction Ratio Setting" screen.
- 3) Click the [Calculate Axis Parameters] button.
- 4) Click the [OK] button to reflect the calculation results to the axis parameter.

3.11.4 Reflecting axis parameters


After setting each item, click the [Apply] button to fix the parameters.

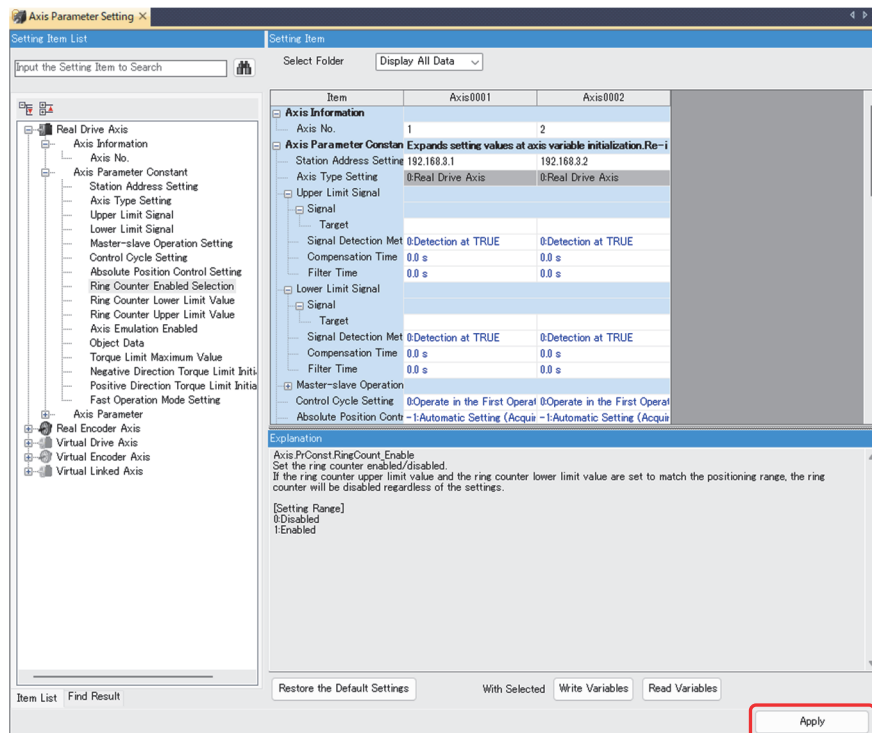


3.12 Axes Group Setting

An axes group is used for multiple axes control such as linear interpolation and circular interpolation. An axes group is not used for synchronous control.

Right-click "Axes Group" in the navigation window of the motion control setting function, and select [Add New Data]. Set the data name and the axes group No., and click the [OK] button.

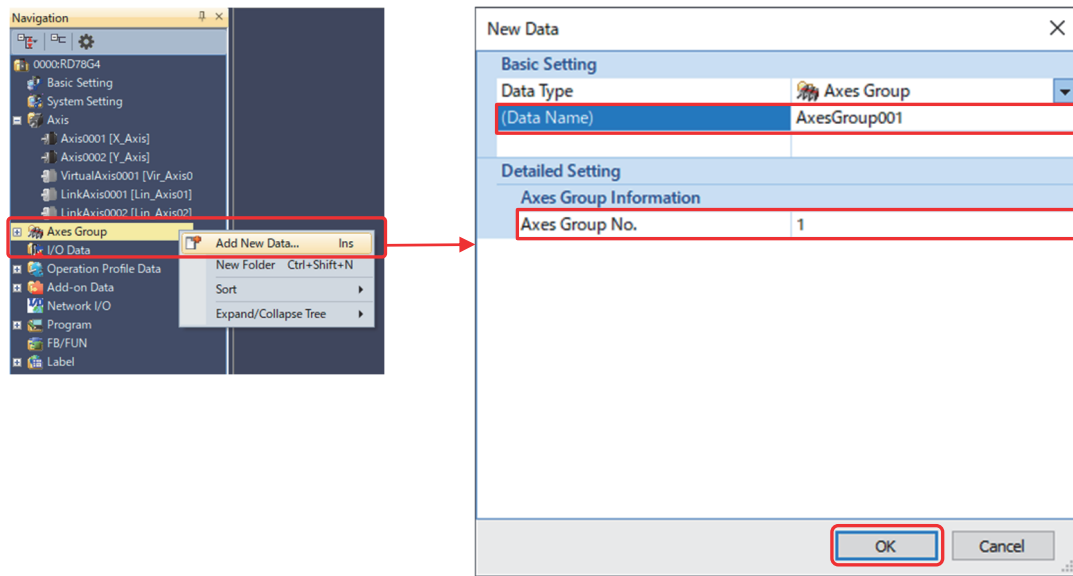


The X axis (Axis0001) and Y axis (Axis0002) of the following two-axis machine example (refer to Section 2.1) are registered in an axes group.

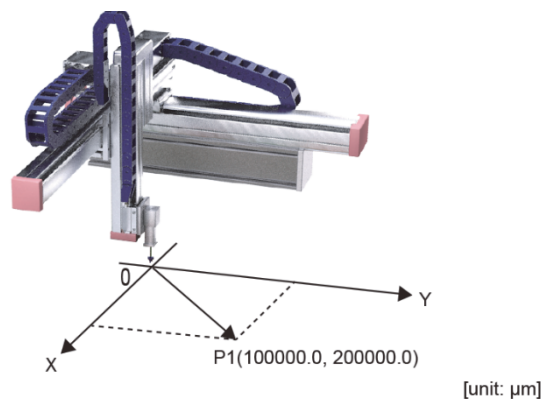


The setting example of the axes group is shown below.

[Setting example of axes group structuring axes]

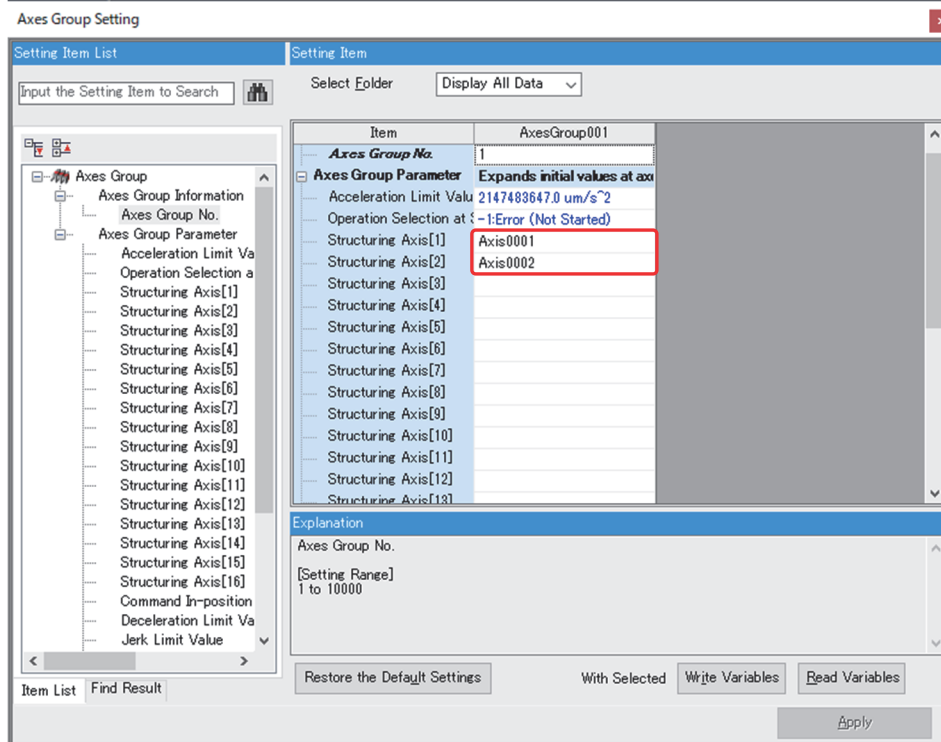

[Setting example of axes group units] (Position command unit: [um], Speed command unit: [U/s])

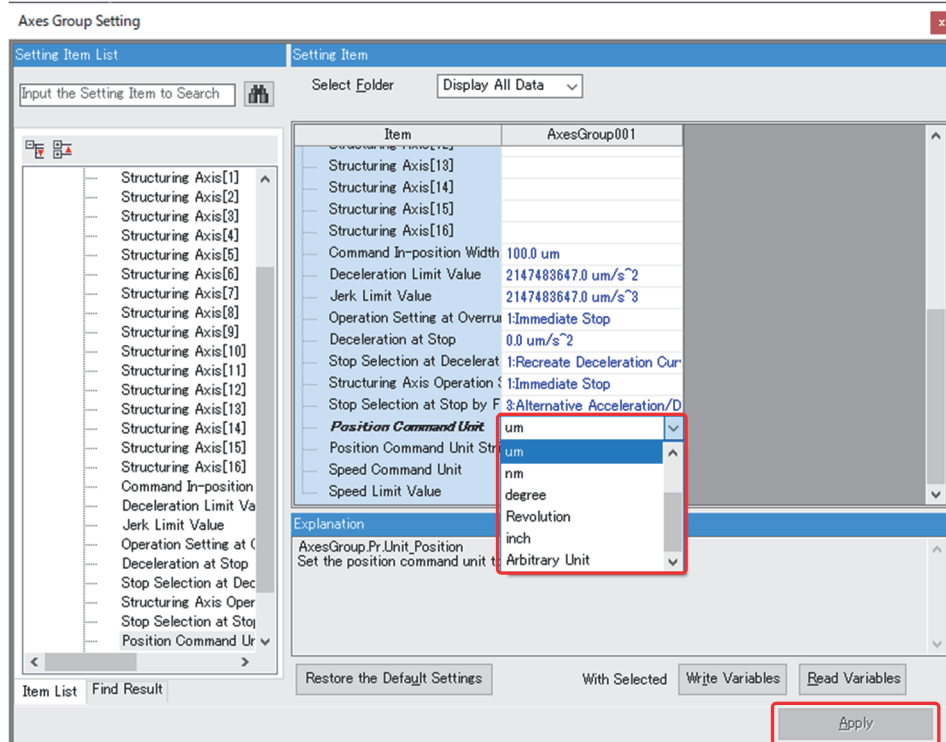

After setting each item, click the [Apply] button to fix the axes group setting.

3.13 Labels

Labels are classified into local labels and global labels.

Select whether the label is registered as a local label or a global label according to your application.


Label	Description
Local label	<ul style="list-style-type: none"> Labels that can be used in only one program
Global label	<ul style="list-style-type: none"> Labels that can be used in all programs Labels that can be set to public labels (Refer to Section 3.14.)

3.13.1 Creating a label

This section describes how to create a label in the motion control setting function.

Refer to Section 4.3.2 or Section 5.3.2 for registration examples of labels.

- 1) Double-click "Label" → "Global Label" → "Global" in the navigation window of the motion control setting function to open the "Global [Global Label Setting]" window.

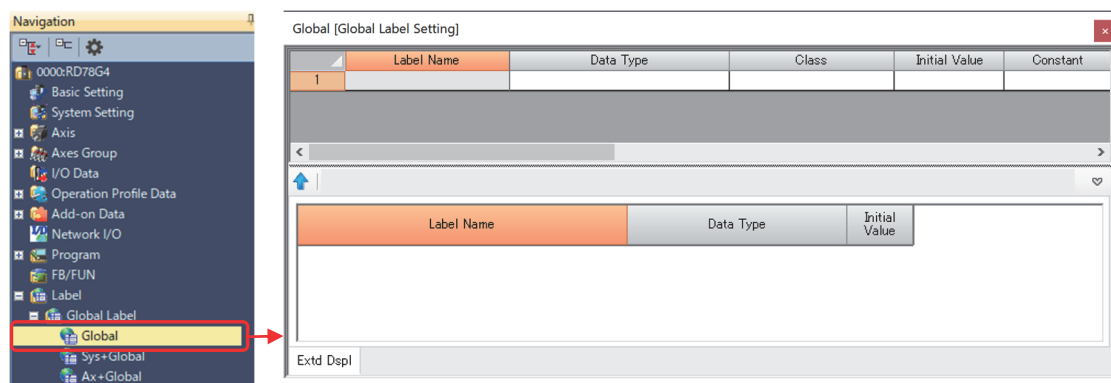


- 2) Set a global label.


(a) Enter the label name. (Setting example: G_bSRVONCMD)

(b) Select the data type. (Click the [] button to open the "Data Type Selection" window.)

Select "Simple Types" in the type category, and select the data type.

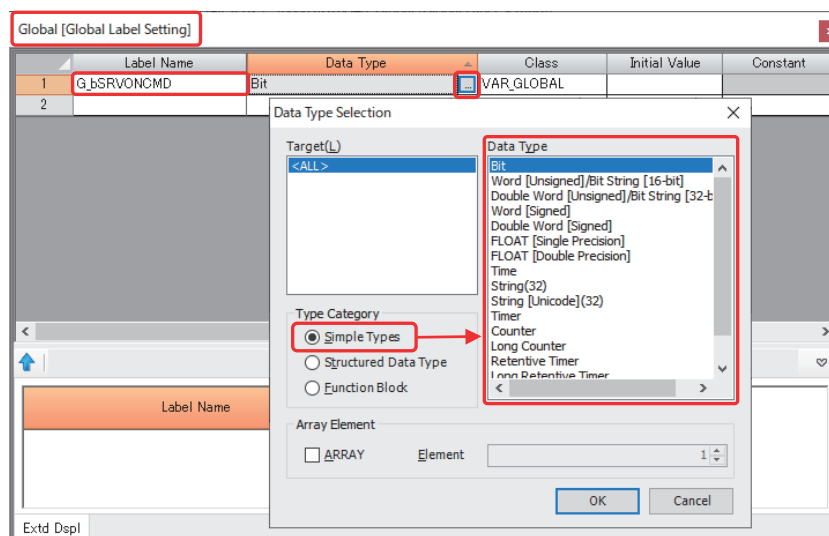

Set the structured data type variables and the array variables in the same manner as Simple Types, and click the [OK] button.

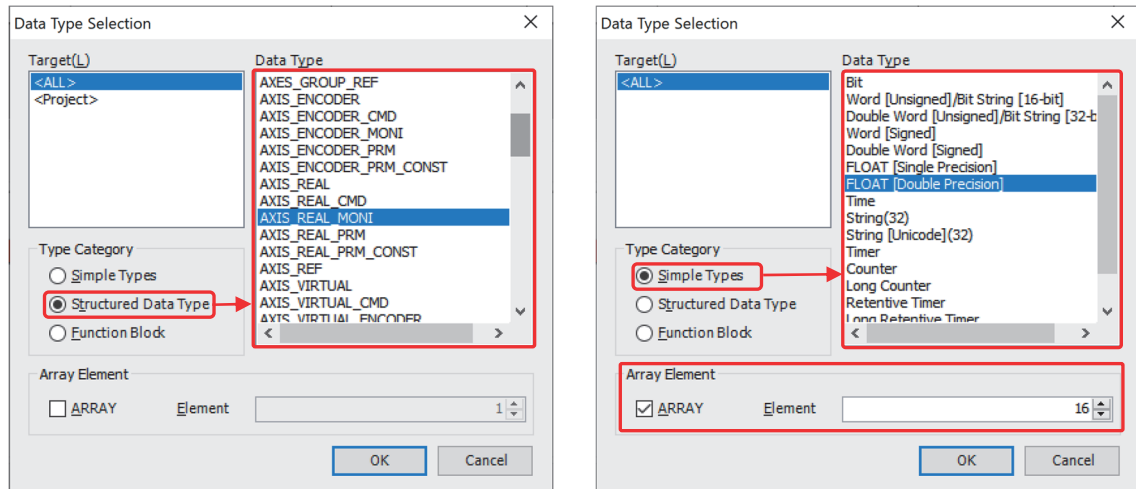

[Registration example of global labels]

Global labels for the programs used in Chapter 5 are shown below. (Refer to Chapter 5 for details.)

	Label Name	Data Type	Class	Initial	Constant	Comment	Remark	Public Label	Motion Control Attribute
1	G_bSRVONCMD	Bit	VAR_GLOBAL			サーボオン / Servo ON/OFF		Enable	WRITE (=> Motion)
2	G_bHoming1CMD	Bit	VAR_GLOBAL			原点復帰指令 Axis0001 / Homing command Axis0001		Enable	WRITE (=> Motion)
3	G_bHoming2CMD	Bit	VAR_GLOBAL			原点復帰指令 Axis0002 / Homing command Axis0002		Enable	WRITE (=> Motion)
4	G_bHoming3CMD	Bit	VAR_GLOBAL			原点復帰指令 VirtualAxis0001 / Homing command VirtualAxis0001		Enable	WRITE (=> Motion)
5	G_bPosCMD	Bit	VAR_GLOBAL			単軸位置決め始動 / Single axis positioning start		Enable	WRITE (=> Motion)
6	G_bContPosCMD	Bit	VAR_GLOBAL			単軸連続位置決め始動 / Single axis continuous positioning start		Enable	WRITE (=> Motion)
7	G_bInterpolationCMD	Bit	VAR_GLOBAL			2軸直線補間制御始動 / 2-axis linear interpolation control start		Enable	WRITE (=> Motion)
8	G_bSyncCMD	Bit	VAR_GLOBAL			同期制御始動 / Synchronous control start		Enable	WRITE (=> Motion)
9	G_bResetCMD	Bit	VAR_GLOBAL			エラーリセット / Error reset		Enable	WRITE (=> Motion)
10	G_bMotionResetCMD	Bit	VAR_GLOBAL			システムエラーリセット / System error reset		Enable	WRITE (=> Motion)
11	G_bJogF1CMD	Bit	VAR_GLOBAL			JOG正転指令 Axis0001 / JOG Positive rotation command Axis0001		Enable	WRITE (=> Motion)
12	G_bJogR1CMD	Bit	VAR_GLOBAL			JOG逆転指令 Axis0001 / JOG Reverse rotation command Axis0001		Enable	WRITE (=> Motion)
13	G_bJogF2CMD	Bit	VAR_GLOBAL			JOG正転指令 Axis0002 / JOG Positive rotation command Axis0002		Enable	WRITE (=> Motion)
14	G_bJogR2CMD	Bit	VAR_GLOBAL			JOG逆転指令 Axis0002 / JOG Reverse rotation command Axis0002		Enable	WRITE (=> Motion)
15	G_bJogVelocity	FLOAT [Double Precision]	VAR_GLOBAL			JOG速度 / JOG Velocity		Enable	WRITE (=> Motion)
16	G_bHoming1Done	Bit	VAR_GLOBAL			原点復帰完了 Axis0001 / Homing complete Axis0001		Enable	READ (Motion =>)
17	G_bHoming2Done	Bit	VAR_GLOBAL			原点復帰完了 Axis0002 / Homing complete Axis0002		Enable	READ (Motion =>)
18	G_bHoming3Done	Bit	VAR_GLOBAL			原点復帰完了 VirtualAxis0001 / Homing complete VirtualAxis0001		Enable	READ (Motion =>)
19	G_bPosDone	Bit	VAR_GLOBAL			単軸位置決め完了 / Single axis positioning complete		Enable	READ (Motion =>)
20	G_bContPosDone	Bit	VAR_GLOBAL			単軸連続位置決め完了 / Single axis continuous positioning complete		Enable	READ (Motion =>)
21	G_bInterpolationDone	Bit	VAR_GLOBAL			2軸直線補間制御完了 / 2-axis linear interpolation control complete		Enable	READ (Motion =>)
22	G_bSyncDone	Bit	VAR_GLOBAL			同期制御完了 / Synchronous control complete		Enable	READ (Motion =>)
23	G_bJog1Busy	Bit	VAR_GLOBAL			JOG運転中 Axis0001 / JOG operation in progress Axis0001		Enable	READ (Motion =>)
24	G_bJog2Busy	Bit	VAR_GLOBAL			JOG運転中 Axis0002 / JOG operation in progress Axis0002		Enable	READ (Motion =>)
25	G_bStopSignalX	Bit	VAR_GLOBAL			停止指令 Axis0001 / Stop command Axis0001		Enable	READ (Motion =>)
26	G_bStopSignalY	Bit	VAR_GLOBAL			停止指令 Axis0002 / Stop command Axis0002		Enable	READ (Motion =>)
27									

(Note): Refer to Section 3.14 for details of public labels.

3.14 Public Labels

A PLC CPU module can read and write global labels and structure members in the Motion modules by setting them as public labels.

Data such as monitor data of position and speed is defined as a variable with a specified name (label) in the Motion module. The data can be used from the PLC CPU module by setting the labels as public labels.


This section describes how to register a public label. Refer to Section 4.3.2 or Section 5.3.2 for registration examples of public labels.

3.14.1 Public label registration

The following shows how to register the axis information (AxisRef), the axis status (AxisStatus), and the command in-position (CmdInPos) of the real drive axis as a public label.


[Registering Motion module structures as a public label]

- 1) Double-click "Label" → "Global Label" → "Ax+Global" in the navigation window of the motion control setting function, and set the "Public Label" column of the target labels to "Enable".
- 2) Double-click "Structured Data Types" → "AXIS_REAL", and set the "Public Label" column of the AxisRef (axis information) and the Md (axis monitor data) to "Enable".
- 3) Double-click "Structured Data Types" → "AXIS_REAL_MONI", and set the "Public Label" column of the AxisStatus (axis status) and the CmdInPos (command in-position) to "Enable".

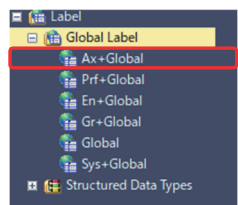

Label Name	Data Type	Class	Initial	Constant	Japanese/日本語(Display Target)	Remark	Public Label	Motion Control
1 Axis0001	AXIS_REAL	VAR_GLOBAL	<Detailed>		[X.Axis]		Enabled	
2 Axis0002	AXIS_REAL	VAR_GLOBAL	<Detailed>		[Y.Axis]		Enabled	
4 LinkAxis0001	AXIS_VIRTUAL_LINK	VAR_GLOBAL	<Detailed>		[Lin.Axis01]		Enabled	
5 LinkAxis0002	AXIS_VIRTUAL_LINK	VAR_GLOBAL	<Detailed>		[Lin.Axis02]		Enabled	
3 VirtualAxis0001	AXIS_VIRTUAL	VAR_GLOBAL	<Detailed>		[Vir.Axis01]		Enabled	

(Note): The virtual drive axis and the virtual linked axis are set as public labels.

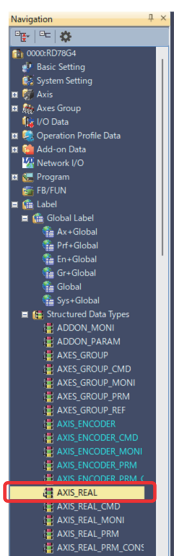

Label Name	Data Type	Class	Initial	Constant	English	Public Label	Motion Control
1 AxisRef	AXIS_REAL_REF				Axis Information	Enabled	READ (Motion ...)
2 PrConst	AXIS_REAL_PRM_CONST				Axis Parameter Constant	Disabled	WRITE (=> Moti...)
3 Pr	AXIS_REAL_PRM				Axis Parameter	Disabled	WRITE (=> Moti...)
4 Md	AXIS_REAL_MONI				Axis Monitor Data	Enabled	READ (Motion ...)
5 Cd	AXIS_REAL_CMD				Axis Control Data	Disabled	WRITE (=> Moti...)

Label Name	Data Type	Initial	Public Label
Md	AXIS_REAL_MONI		Enabled
AccelerationLimit	FLOAT [Double]		Disabled
AccelerationOverride	FLOAT [Double]		Disabled
AccelerationZeroBehavior	Word [Signed]		Disabled
ActualPosition	FLOAT [Double]		Disabled
ActualVelocity	FLOAT [Double]		Disabled
Analyzing	Bit		Disabled
AutoDeceleration	Bit		Disabled
AxisName	String [Unicode]		Disabled
AxisStatus	Word [Signed]		Enabled
BufferingFBs	Word [Signed]		Disabled
CmdInPos	Bit		Enabled
CmdInPos_Width	FLOAT [Double]		Disabled
CommandedAcceleration	FLOAT [Double]		Disabled

[Setting user-created global labels as public labels]

A PLC CPU module can read and write user-created global labels in the Motion module by setting them as public labels.

The motion control attribute is required to be set for the user-created global labels.

	Label Name	Data Type	Class	Initial	Constant	Comment	Remark	Public Label	Motion Control Attribute
8	G_bSyncCMD	Bit	VAR_GLOBAL			同期制御始動 / Synchronous control start		Enable	WRITE (⇒ Motion)
9	G_bResetCMD	Bit	VAR_GLOBAL			エラーリセット / Error reset		Enable	WRITE (⇒ Motion)
10	G_bMotionResetCMD	Bit	VAR_GLOBAL			システムエラーリセット / System error reset		Enable	WRITE (⇒ Motion)
11	G_bJogF1CMD	Bit	VAR_GLOBAL			JOG正転指令 Axis0001 / JOG Positive rotation command Axis0001		Enable	WRITE (⇒ Motion)
12	G_bJogR1CMD	Bit	VAR_GLOBAL			JOG逆転指令 Axis0001 / JOG Reverse rotation command Axis0001		Enable	WRITE (⇒ Motion)
13	G_bJogF2CMD	Bit	VAR_GLOBAL			JOG正転指令 Axis0002 / JOG Positive rotation command Axis0002		Enable	WRITE (⇒ Motion)
14	G_bJogR2CMD	Bit	VAR_GLOBAL			JOG逆転指令 Axis0002 / JOG Reverse rotation command Axis0002		Enable	WRITE (⇒ Motion)
15	G_bJogVelocity	FLOAT [Double Precision]	VAR_GLOBAL			JOG速度 / JOG Velocity		Enable	WRITE (⇒ Motion)
16	G_bHoming1Done	Bit	VAR_GLOBAL			原点復帰完了 Axis0001 / Homing complete Axis0001		Enable	READ (Motion ⇒)
17	G_bHoming2Done	Bit	VAR_GLOBAL			原点復帰完了 Axis0002 / Homing complete Axis0002		Enable	READ (Motion ⇒)
18	G_bHoming3Done	Bit	VAR_GLOBAL			原点復帰完了 VirtualAxis0001 / Homing complete VirtualAxis0001		Enable	READ (Motion ⇒)
19	G_bJPosDone	Bit	VAR_GLOBAL			単軸位置決め完了 / Single axis positioning complete		Enable	READ (Motion ⇒)
20	G_bContPosDone	Bit	VAR_GLOBAL			単軸連続位置決め完了 / Single axis continuous positioning complete		Enable	READ (Motion ⇒)
21	G_bInterpolationDone	Bit	VAR_GLOBAL			2軸直線補間制御完了 / 2-axis linear interpolation control complete		Enable	READ (Motion ⇒)
22	G_bSyncDone	Bit	VAR_GLOBAL			同期制御完了 / Synchronous control complete		Enable	READ (Motion ⇒)
23	G_bJog1Busy	Bit	VAR_GLOBAL			JOG運転中 Axis0001 / JOG operation in progress Axis0001		Enable	READ (Motion ⇒)


Reading label data in the Motion module: READ (Motion →)
Writing data to labels in the Motion module: WRITE (← Motion)

3.14.2 Public label reflection

Reflect the registered public labels.


After the labels are reflected, the PLC CPU modules can use the members registered as public labels.

- 1) In the motion control setting function, select [Convert] → [Rebuild All] to convert all public labels.
- 2) Select [Convert] → [Reflect Public Labels], and click the [Yes] button on the confirmation screen.

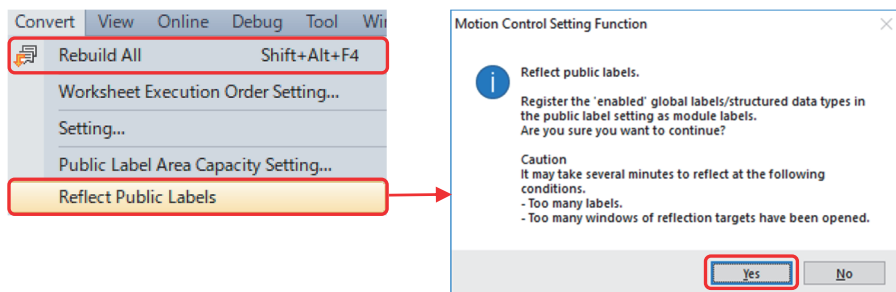

- 3) Convert all the program in MELSOFT GX Works3 for the PLC CPU modules to use the public labels.


The reflected public labels are registered in the element selection window of MELSOFT GX Works3.

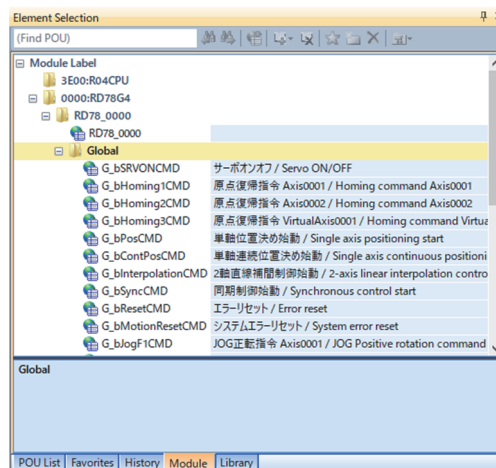

3.14.3 A program example using public labels

A program example using public labels is shown below.

- 1) Double-click "Module Label" on the [Module] tab in the element selection window to open the public labels. Drag and drop the public labels.

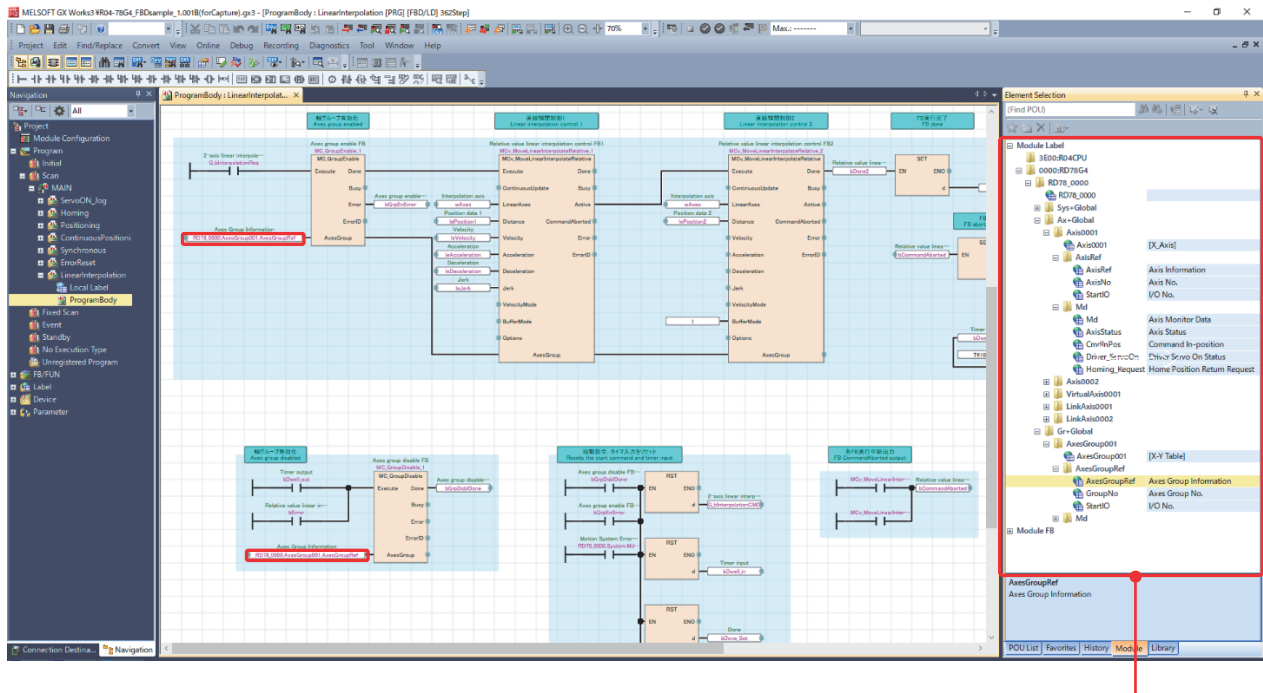

Registered public label name

[POINTS]

When a public label of a Motion module is used from a PLC CPU module, "Module + Module No." is added at the head of the name.

RD78_0000.Axis0001.AxisRef


Member
Axis label name
Module + Module No.

3.15 Writing to a Motion Module


After writing the module parameters to the PLC CPU module, reset the PLC CPU module, and turn the PLC CPU power ON again to communicate with the Motion module. Then, write the items set in the motion control setting to the Motion module.

- 1) In MELSOFT GX Works3, select [Online] → [Write to Module] to open the "Online Data Operation" screen.

Check the items to be written on the screen, and click the [Execute] button.

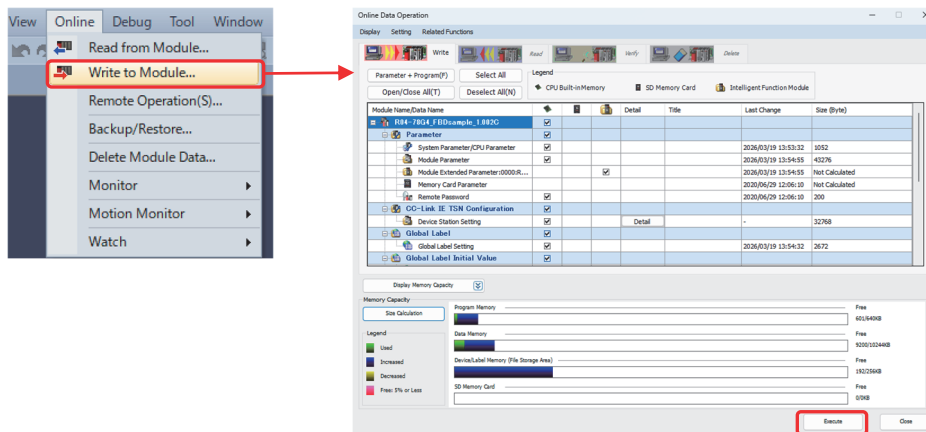

- 2) Write the parameters to the Motion module.

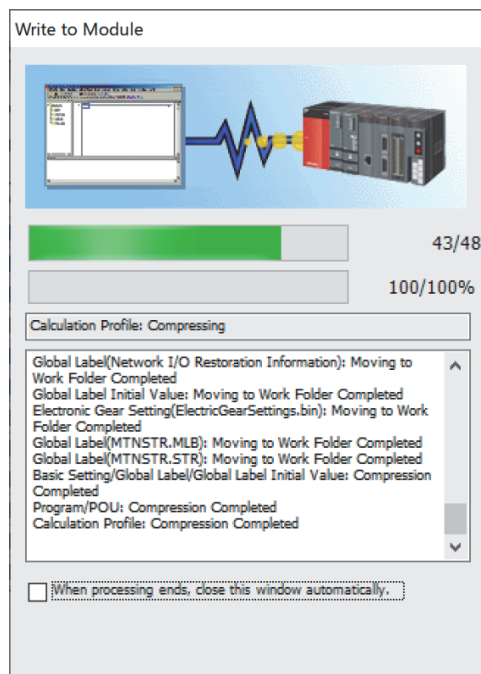


- 3) Turn the PLC CPU module power OFF to ON again, and check that no error occurs. The error status can be checked with the LED display of the PLC CPU module and the Motion module, or the system monitor of MELSOFT GX Works3.

3.16 Saving a Project

Save the created project.

The following procedure shows how to save a project with 1 file format.

- 1) Select [Project] → [Save As] on MELSOFT GX Works3 to open the "Save As" screen.
Enter a file name, and click the [Save] button.

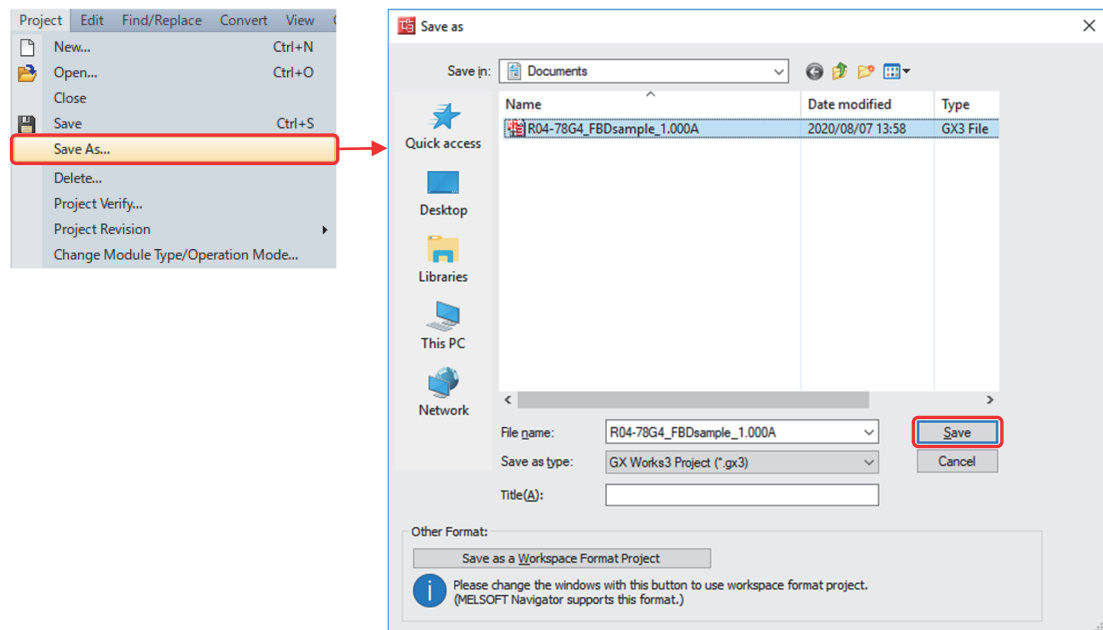

3.17 Parameter List

The following shows a list of the parameters which are set in this chapter.
Refer to Chapter 4 and Chapter 5 for the public label setting.

[Axis parameter setting]

1) Real Drive Axis

Item	Axis0001	Axis0002
Axis Information		
Axis No.	1	2
Axis Parameter Constant	Expands setting values at axis variable initialization. Re-i	
Station Address Setting	192.168.3.1	192.168.3.2
Axis Type Setting	0:Real Drive Axis	0:Real Drive Axis
Upper Limit Signal		
Signal		
Target		
Signal Detection Met	0:Detection at TRUE	0:Detection at TRUE
Compensation Time	0.0 s	0.0 s
Filter Time	0.0 s	0.0 s
Lower Limit Signal		
Signal		
Target		
Signal Detection Met	0:Detection at TRUE	0:Detection at TRUE
Compensation Time	0.0 s	0.0 s
Filter Time	0.0 s	0.0 s
Master-slave Operation		
Control Cycle Setting	0:Operate in the First Operat	0:Operate in the First Operat
Absolute Position Contr	-1:Automatic Setting (Acquir	-1:Automatic Setting (Acquir
Ring Counter Enabled S	0:Disabled	0:Disabled
Ring Counter Lower Lin	-10000000000.0 um	-10000000000.0 um
Ring Counter Upper Lin	10000000000.0 um	10000000000.0 um
Axis Emulation Enabled	0:Disabled	0:Disabled
Object Data		
Torque Limit Maximum	1000.0 %	1000.0 %
Negative Direction Torc	300.0 %	300.0 %
Positive Direction Torq	300.0 %	300.0 %
Fast Operation Mode Se	0000	0000
Axis Parameter	Expands initial values at axis variable i	
Acceleration Limit Valu	2147483647.0 um/s ²	21474836
Operation Selection at	-1:Error (Not Started)	-1:Error (Not Started)
Command In-position W	100.0 um	100.0 um
Deceleration Limit Valu	2147483647.0 um/s ²	21474836
Driver Unit Conversion	67108864	67108864
Driver Unit Conversion	5000 um	5000 um
Forced Stop Signal		
Signal		
Target		
Signal Detection Met	0:Detection at TRUE	0:Detection at TRUE
Compensation Time	0.0 s	0.0 s
Filter Time	0.0 s	0.0 s
Homing Required or No	1:Homing Required	1:Homing Required
Jerk Limit Value	2147483647.0 um/s ³	2147483647.0 um/s ³
Operation Setting at Ov	1:Immediate Stop	1:Immediate Stop
Start Permission at Hor	0:Disabled	0:Disabled
Deceleration at Stop	0.0 um/s ²	0.0 um/s ²
Stop Selection at Decel	1:Recreate Deceleration Cur	1:Recreate Deceleration Cur
Stop Selection at Stop	3:Alternative Acceleration/D	3:Alternative Acceleration/D
Stop Selection at H/W	1:Immediate Stop	1:Immediate Stop
Process Selection at Se	0:Ignore	0:Ignore
Stop Selection at S/W	1:Immediate Stop	1:Immediate Stop
Driver Command Discar	1:Detection Enabled	1:Detection Enabled
Stop Signal		
Signal		
Target	[VAR]G_bStopSignalX	[VAR]G_bStopSignalY
Signal Detection Met	0:Detection at TRUE	0:Detection at TRUE
Compensation Time	0.0 s	0.0 s
Filter Time	0.0 s	0.0 s
Software Stroke Limit L	-10000000000.0 um	-10000000000.0 um
Software Stroke Limit T	-1:Invalid	-1:Invalid
Software Stroke Limit L	10000000000.0 um	10000000000.0 um
Position Command Unit	um	um
Position Command Unit		
Velocity Command Unit	U/s	U/s
Velocity Bias Value	0.0 um/s	0.0 um/s
Negative Direction Velc	2500000000.0 um/s	2500000000.0 um/s
Operation Setting at Ve	0:Ignore	0:Ignore
Positive Direction Veloc	2500000000.0 um/s	2500000000.0 um/s

2) Virtual Drive Axis

Stop Signal	
Signal	
Target	
Signal Detection Method	0:Detection at TRUE
Compensation Time	0.0 s
Filter Time	0.0 s
Software Stroke Limit Lower Value	-10000000000.0 um
Software Stroke Limit Target	-1:Invalid
Software Stroke Limit Upper Value	10000000000.0 um
Position Command Unit	um
Position Command Unit String	
Speed Command Unit	U/s
Negative Direction Speed Limit Value	2500000000.0
Operation Setting at Speed Limit Value	0:Ignore
Positive Direction Speed Limit Value	2500000000.0

Item	VirtualAxis0001
Axis Information	
Axis No.	301
Axis Parameter Constant	Expands setting values at axis variable
Axis Type Setting	3:Virtual Drive Axis
Upper Limit Signal	
Signal	
Target	
Signal Detection Method	0:Detection at TRUE
Compensation Time	0.0 s
Filter Time	0.0 s
Lower Limit Signal	
Signal	
Target	
Signal Detection Method	0:Detection at TRUE
Compensation Time	0.0 s
Filter Time	0.0 s
Control Cycle Setting	0:Operate in the First Operation Cycle
Absolute Position Management Setting	0:Disable Absolute Position System
Ring Counter Enabled Selection	0:Disabled
Ring Counter Lower Limit Value	-10000000000.0
Ring Counter Upper Limit Value	10000000000.0
High-speed Mode Setting	0000
Axis Parameter	Expands initial values at axis variable
Acceleration Limit Value	2147483647.0 um/s ²
Operation Selection at Start Acceleration	-1>Error (Not Started)
Command In-position Width	100.0 um
Deceleration Limit Value	2147483647.0 um/s ²
Forced Stop Signal	
Signal	
Target	
Signal Detection Method	0:Detection at TRUE
Compensation Time	0.0 s
Filter Time	0.0 s
Home Position Return Required or Not	1:Home Position Return Required
Jerk Limit Value	2147483647.0 um/s ³
Operation Setting at Overrun	1:Immediate Stop
Start Permission at Home Position Return	0:Disabled
Deceleration at Stop	0.0 um/s ²
Stop Selection at Deceleration to Stop	1:Recreate Deceleration Curve
Stop Selection at Stop by Factors	3:Alternative Acceleration/Deceleration
Stop Selection at H/W Stroke Limit Error	1:Immediate Stop
Process Selection at Servo OFF Command	0:Ignore
Stop Selection at S/W Stroke Limit Error	1:Immediate Stop

3) Virtual Linked Axis

Item	LinkAxis0001	LinkAxis0002
Axis Information		
Axis No.	401	402
Axis Parameter Constant	Expands setting values at axis variable initialization. Re-i	
Axis Type Setting	5:Virtual Link Axis	5:Virtual Link Axis
Control Cycle Setting	0:Operate in the First Operati	0:Operate in the First Operati
Absolute Position Manag	0:Disable Absolute Position S	0:Disable Absolute Position S
Ring Counter Enabled S	0:Disabled	0:Disabled
Ring Counter Lower Lim	-10000000000.0	-10000000000.0
Ring Counter Upper Lim	10000000000.0	10000000000.0
High-speed Mode Setting	0000	0000
Axis Parameter	Expands initial values at axis variable initialization. Re-i	
Home Position Return R	0:Home Position Return Not F	0:Home Position Return Not F
Start Permission at Hom	0:Disabled	0:Disabled
Position Command Unit	um	um
Position Command Unit		
Speed Command Unit	U/s	U/s

[Axes group setting]


Item	AxesGroup001
Axis Group Information	
Axis Group No.	1
Axis Group Parameter	Expands initial values at a
Acceleration Limit Value	2147483647.0 um/s ²
Operation Selection at S	-1:Error (Not Started)
Structuring Axis[1]	Axis0001
Structuring Axis[2]	Axis0002
Structuring Axis[3]	
Structuring Axis[4]	
Structuring Axis[5]	
Structuring Axis[6]	
Structuring Axis[7]	
Structuring Axis[8]	
Structuring Axis[9]	
Structuring Axis[10]	
Structuring Axis[11]	
Structuring Axis[12]	
Structuring Axis[13]	
Structuring Axis[14]	
Structuring Axis[15]	
Structuring Axis[16]	
Command In-position W	100.0 um
Deceleration Limit Value	2147483647.0 um/s ²
Jerk Limit Value	2147483647.0 um/s ³
Operation Setting at Ove	1:Immediate Stop
Deceleration at Stop	0.0 um/s ²
Stop Selection at Decele	1:Recreate Deceleration Curv
Structuring Axis Operati	1:Immediate Stop
Stop Selection at Stop by	3:Alternative Acceleration/De
Position Command Unit	um
Position Command Unit	
Speed Command Unit	U/s
Speed Limit Value	2500000000.0 um/s

4. PROGRAMMING BY A PLC CPU MODULE ONLY

A PLC CPU module is programmed by any of the following languages: FBD/LD, ladder, or ST language. This chapter explains programming with FBD/LD that enables users to easily understand the relationship between FBs.

To obtain the sample program used in this chapter, contact your local sales office.

- File name: **R04-78G4_FBDsample_*****.gx3** (**** indicates the version)

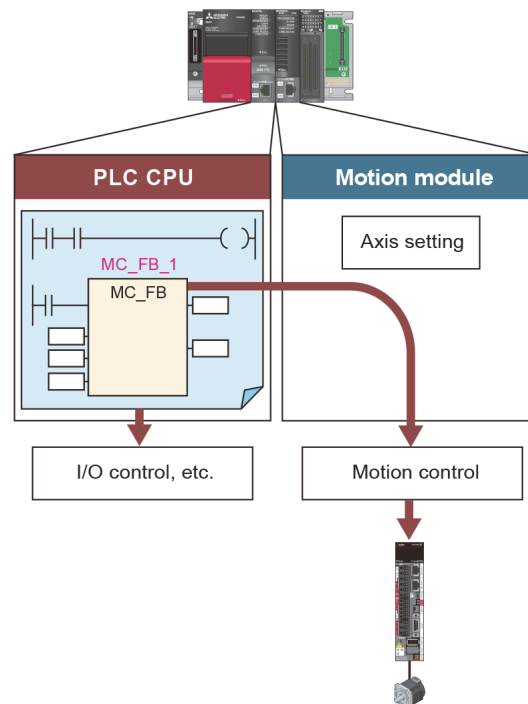**[POINTS]**

When applying the sample program to an actual system, ensure the applicability and confirm that it will not cause system control problems.


Consider and add interlock conditions according to the user's system.

4.1 Programming Procedure for PLC CPU modules


MELSOFT GX Works3 is used to create a program for PLC CPU modules.

4.1.1 Creating a program block

- 1) In the navigation window of MELSOFT GX Works3, right-click an execution type ("Scan" in this example) under "Program", and click "Add New Data".
- 2) On the "New Data" screen, set the data name, the program language, and the program file for add destination. Only alphanumeric characters can be used to for the data name.

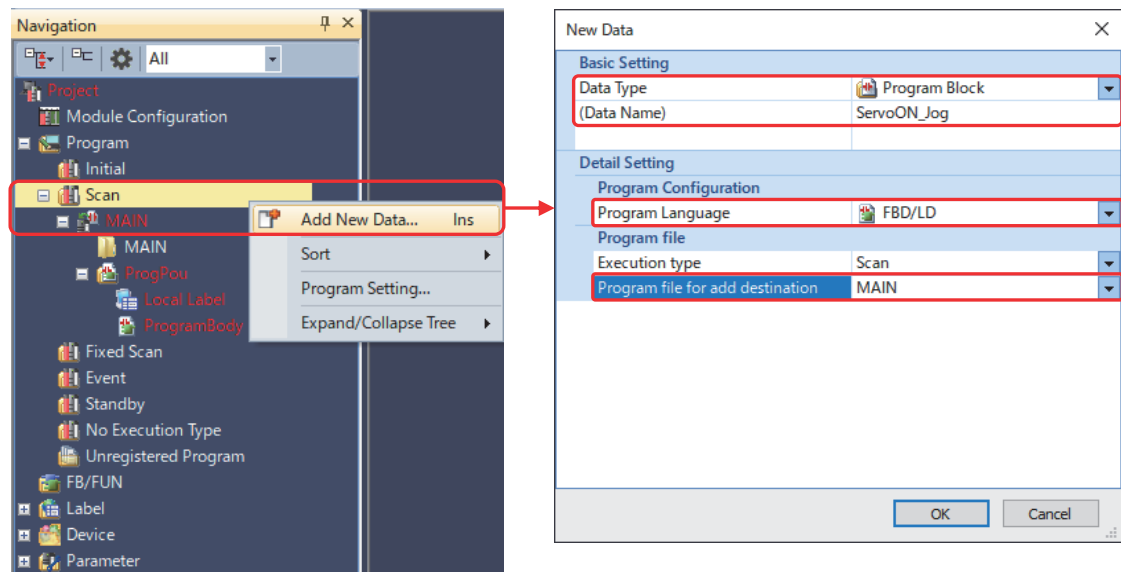

- 3) A program block is added to the navigation window.

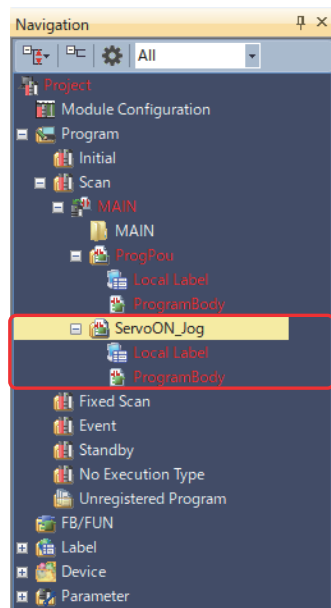

4.1.2 Program execution type

There are following five execution types.


Execution type	Description
Initial	This type of program is executed only once when the CPU module has been powered OFF and ON, or switched from the STOP state to the RUN state.
Scan	This type of program is executed only once per scan. The execution starts from the next scan right after the initial execution type program is executed.
Fixed scan	This is an interrupt program which is executed at a specified time interval. Differently from the normal interrupt program, this type of program does not require the interrupt pointer (I) and the IRET instruction and is executed for each program file unit.
Event	This type of program starts execution when triggered by a specified event.
Standby	This type of program is executed only when its execution is requested.

To set the execution type, right-click on a target program in the navigation window, and select [Register Program] from the shortcut menu, or drag and drop the program onto the target execution type.

The set execution type will be applied to "Program Setting" of "CPU Parameter".

4.1.3 Inputting a FB

Register the Motion module FBs on MELSOFT GX Works3. (Refer to Section 2.4.4.)
 This section explains the procedure for setting the following JOG operation FB (MCv_Jog).
 The sample program adds some interlock conditions to this program.

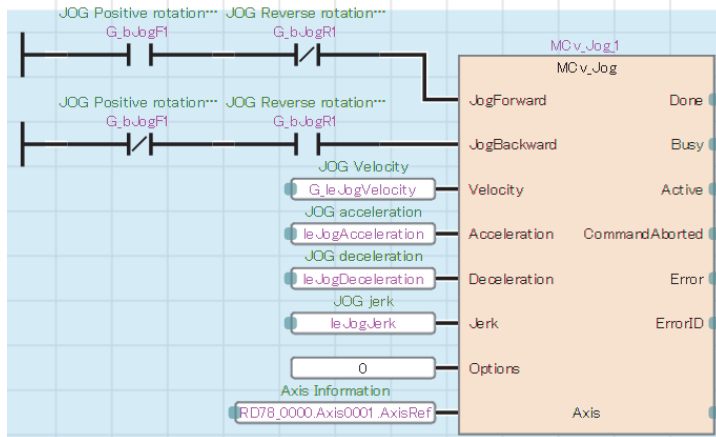

(1) Preparing labels

Prepare labels for input/output signals of the FB. This example uses labels for the Velocity, Acceleration, Deceleration, and Jerk inputs of MCv_Jog. When registering a new label, consider whether the label is registered as a global or a local label.

In this example, the labels for JOG command and JOG velocity are registered as a global label, considering the JOG velocity is operated from an external device, such as GOT (HMI). The labels for JOG acceleration, JOG deceleration, and JOG jerk are as local labels of ServoON_Jog (refer to Section 4.1.1) since these labels are used only within the program. Refer to Section 4.2 for naming rules of labels.

[Global label]

Global [Global Label Setting]							
<Filter>							
	Label Name	Data Type	Class	Assign (Device/Label)	Initial Value	Constant	English
1	G_bSRVOff	Bit	VAR_GLOBAL				Servo OFF
2	G_bJogF1	Bit	VAR_GLOBAL				JOG Positive rotation command Axis0001
3	G_bJogR1	Bit	VAR_GLOBAL				JOG Reverse rotation command Axis0001


[Local label]

ServoON_Jog [PRG] [Local Label Setting]							
<Filter>							
	Label Name	Data Type	Class	Initial Value	Constant		English
1	MCv_AllPower_1	MCv_AllPower	VAR				All axes servo ON FB
2	MCv_Jog_1	MCv_Jog	VAR				JOG operation FB Axis0001
3	MCv_Jog_2	MCv_Jog	VAR				JOG operation FB Axis0002
4	leJogAcceleration	FLOAT [Double Precision]	VAR				JOG acceleration
5	leJogDeceleration	FLOAT [Double Precision]	VAR				JOG deceleration
6	leJogJerk	FLOAT [Double Precision]	VAR				JOG jerk

(2) Inputting a FB

Select "library" → "MotionControl_RD78G_****" → "FB" on the [Library] tab in the element selection window, and you will find the Motion module FB library is registered.

Drag and drop a desired FB to the program editor.

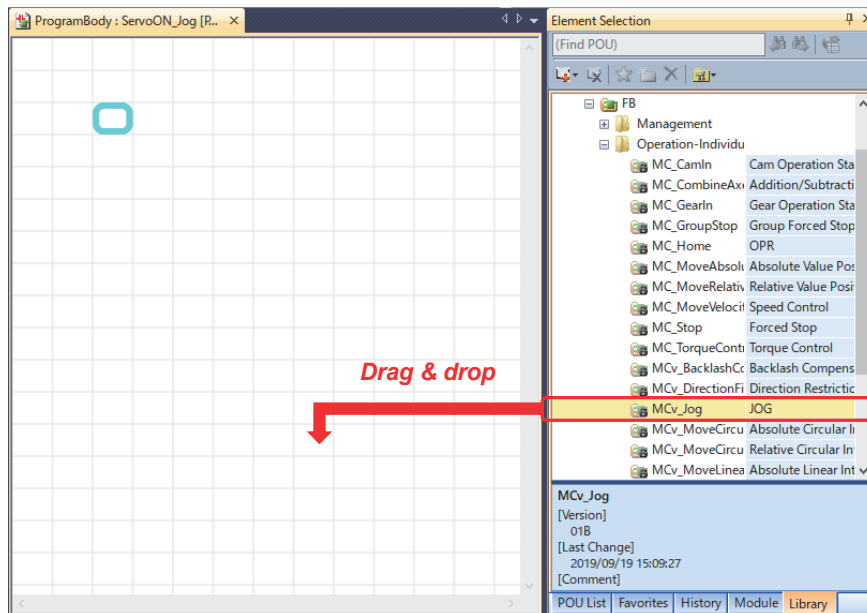


Motion module FBs are categorized in the following three groups.

Group	Description
Management (administrative FB)	A motion control FB that takes an axis or an axes group for the argument and does not change the axis status or the axes group status by execution
Operation-Individual (motion FB)	A motion control FB that takes an axis or an axes group for the argument and changes the axis status or the axes status by execution
StandardFB (general FB)	A motion control FB that does not take an axis or an axes group for the argument


The FB for JOG operation (MCv_Jog) is under the "Operation-Individual" tree.

Drag and drop MCv_Jog to the editor. When an undefined label is entered, the "Undefined Label Registration" screen appears. Enter the label name, the registered destination, and, if necessary, the comment. This example uses the initial settings.

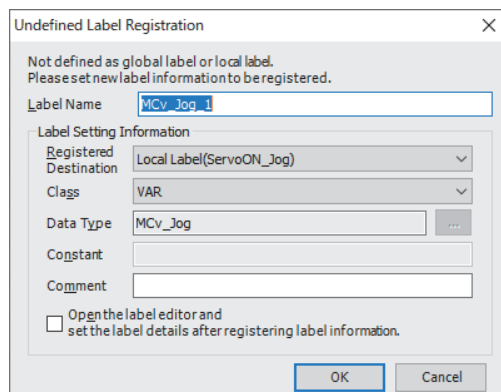

When the setting is completed, click the [OK] button.

The selected FB (MCv_Jog) is displayed on the program editor.

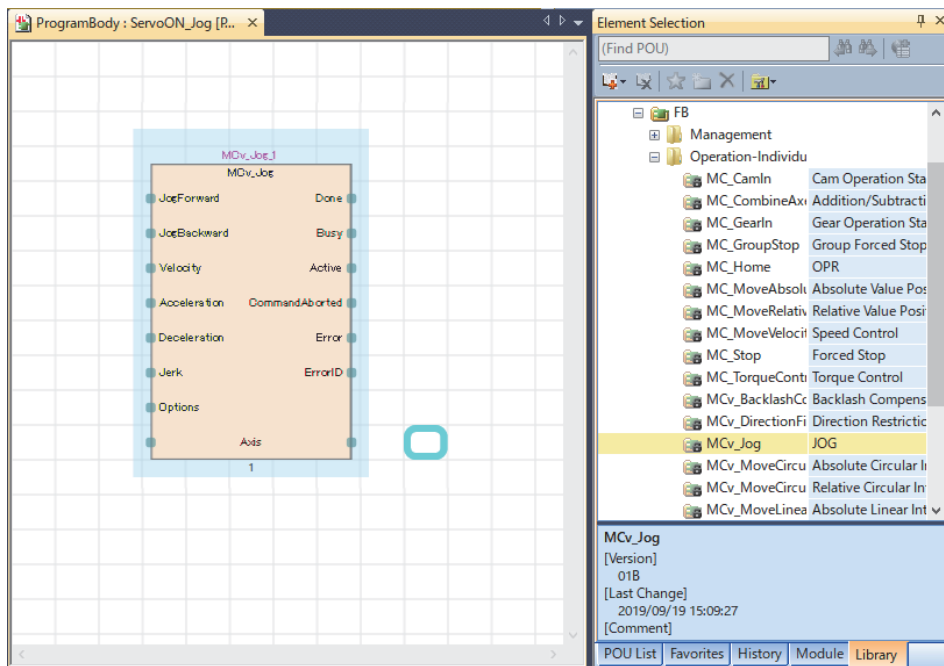

(3) Connecting I/O signals


Connect FBD and LD elements to a target input connection point of the FB.

Place an element on the editor, and move it through drag and drop.


(a) LD element

Click where an element is to be placed on the program editor, and then click the element icon on the tool bar to place the element.

When a contact element is placed, it shows "???". Double-click the element, and enter a bit type label or a bit device number. For the label name, the registered global labels are displayed as a suggestion. Connect the LD elements to the input connection point of the FB.

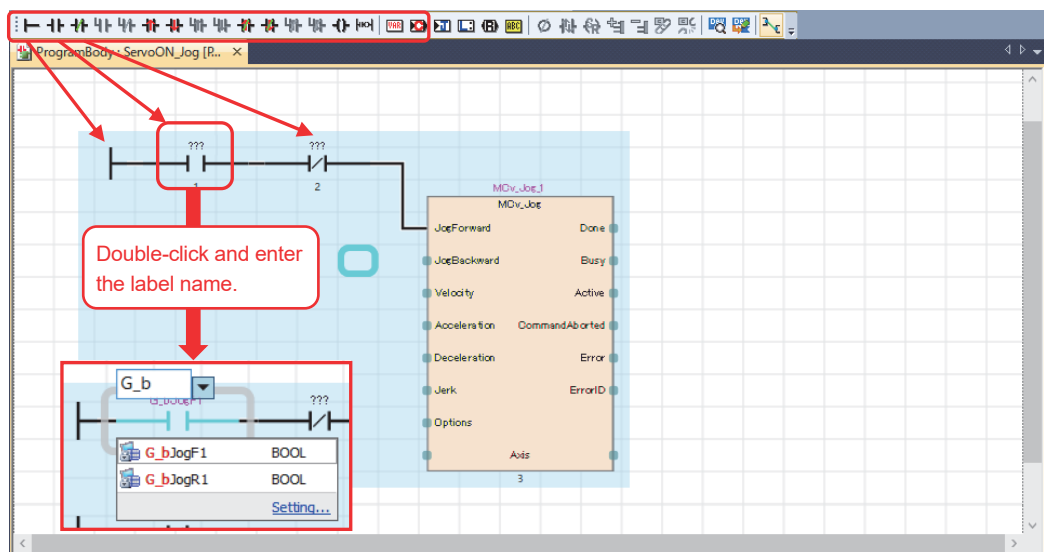


The following shows the diagram that connects the LD elements to the JogForward and JogBackward input connection points.

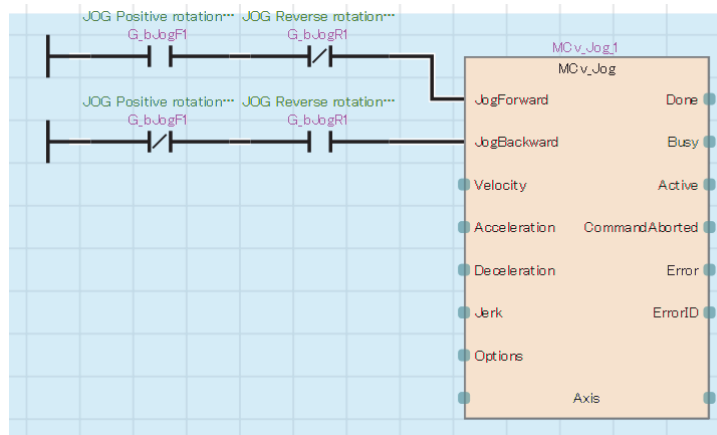

(b) FBD elements

Click where the FBD element is to be placed, and then directly enter the device No. or label name there.

When entering "G_leJogVelocity" that is registered as a global label in (1), click the left side of the Velocity input of MCv_Jog and enter "G_leJogVelocity". The registered global labels are displayed as a suggestion. Connect the FBD element to the input connection point of the FB.

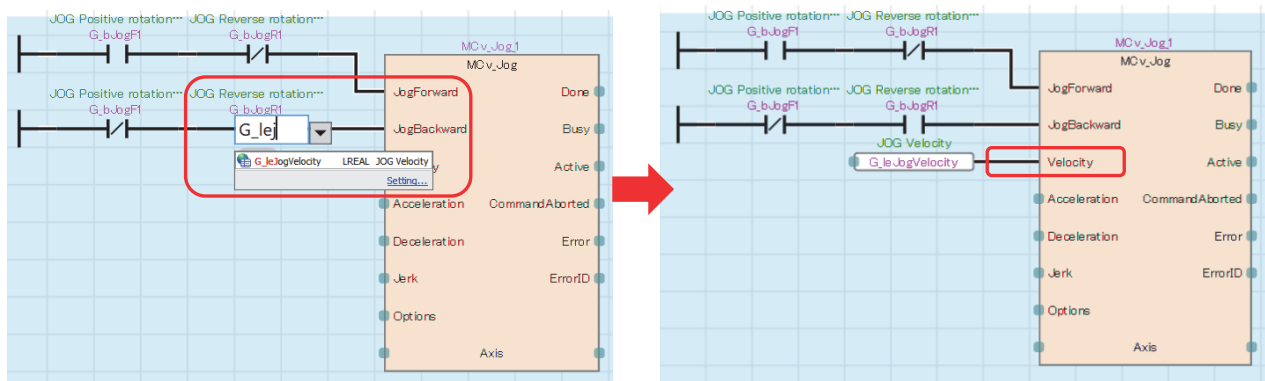


When an undefined label is entered, the "Undefined Label Registration" screen appears. Enter the data type and the registered destination.

Connect the local labels (leJogAcceleration, leJogDeceleration, and leJogJerk) registered in (1) to the corresponding input connection point (Acceleration, Deceleration, and Jerk inputs) of MCv_Jog. For the Options input, connect the constant value of "0".

[NOTES]


Note that values need to be stored to G_leJogVelocity, leJogAcceleration, leJogDeceleration, and leJogJerk by another program (using EDMOVP instruction, etc.)
(For a setting example, refer to Section 4.6.)

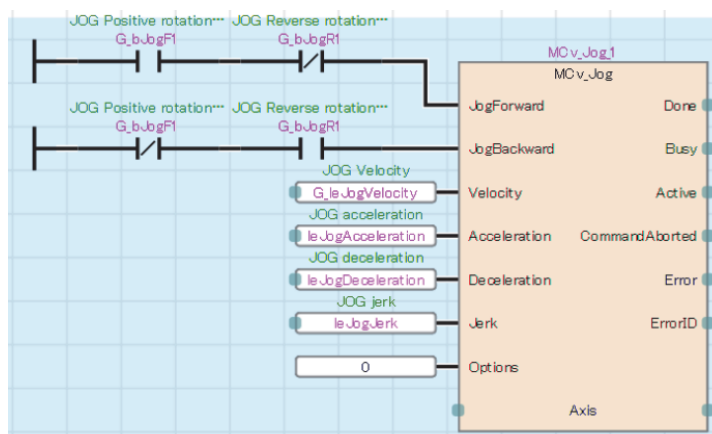

(c) Axis input (public label)

Connect the AxisRef structure registered as a public label to the Axis input connection point.
(Refer to Section 3.14.1.)

Click [Module] tab in the element selection window. Select "Module label" → "0000:RD78G4" → "RD78_0000" → "Ax+Global" → "Axis0001" → "AxisRef", and then drag and drop the AxisRef (axis information) to the program editor.

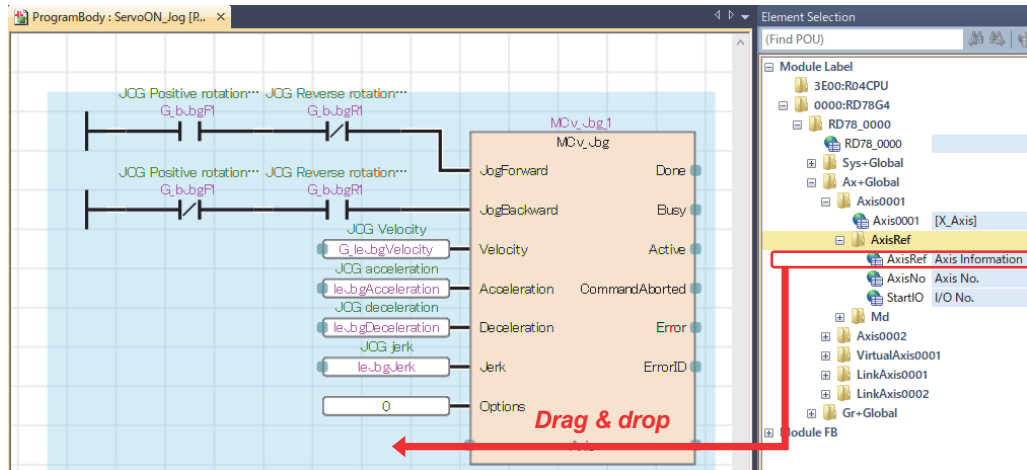

When "RD78G_0000.Axis0001.AxisRef" appears on the editor, connect it to the Axis input connection point of the FB.

[POINTS]

 

The name of public label "RD78_0000.Axis0001.AxisRef" can be directly entered on the editor.

When you enter "RD78", "RD78_0000" is displayed as a suggestion.

When you select "RD78_0000" and enter ".", the axis label name, such as "Axis0001", will be displayed.

When you select "Axis0001" and enter ".", the structure member, such as "AxisRef", will be displayed.

Select "AxisRef", and the input is completed.

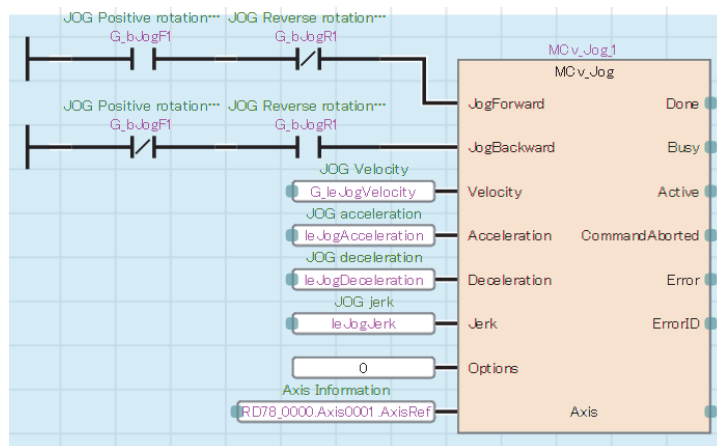

The program is completed.

[POINTS]

When using an initial value for FB input signals, the setting can be omitted.

The Options input in this example can be omitted since it sets the initial value of "0".

4.2 Naming Rules of Labels

This document uses the following prefix rules for labels to distinguish their data type.

Data type		Value range	Prefix	
			Local	Global
Bit	BOOL	FALSE(0), TRUE(1)	b	G_b
Word [unsigned] /bit string [16 bits]	WORD	0 to 65535	u	G_u
Double word [unsigned]/ bit string [32 bits]	DWORD	0 to 4294967295	ud	G_ud
Word [signed]	INT	-32768 to 32767	w	G_w
Double word [signed]	DINT	-2147483648 to 2147483647	d	G_d
Single-precision real number	REAL	-2^{128} to -2^{-126} , 0, 2^{-126} to 2^{128}	e	G_e
Double-precision real number	LREAL	-2^{1024} to -2^{-1022} , 0, 2^{-1022} to 2^{1024}	le	G_le
Time	TIME	T#-24d20h31m23s648ms to T#24d20h31m23s647ms	tm	G_tm
Timer	TIMER	TIMER structure S: contact C: coil N: current value	td	G_td

[Examples of local labels]

Bit: bMoveCMD

Double-precision real number: lePosition

Arrays: wAxes[16]

Timer: tdTimer1

[Examples of global labels]


Bit: G_bJogF1

Double-precision real number: G_leVelocity

4.3 Projects

4.3.1 Program names

The following shows the program examples explained in this chapter.

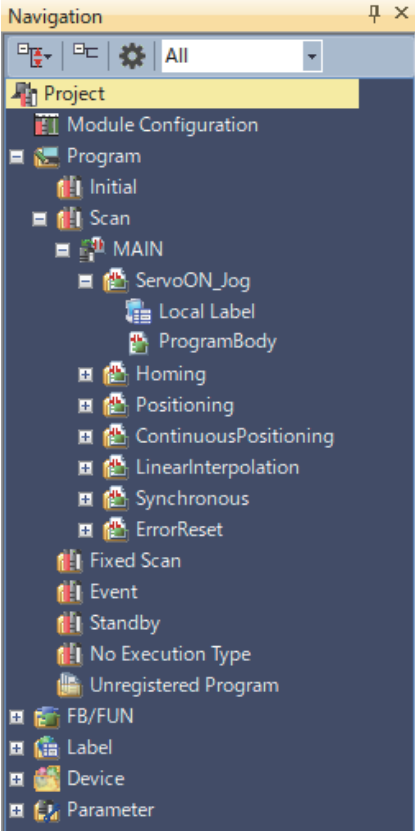	<p>"Scan"→ under "MAIN"</p> <p>Program name: ServoON_Jog (PLC READY, all axes servo ON, JOG operation)</p> <p>Program name: Homing</p> <p>Program name: Positioning (single axis positioning)</p> <p>Program name: ContinuousPositioning (single axis continuous positioning)</p> <p>Program name: LinearInterpolation (two-axis linear interpolation control)</p> <p>Program name: Synchronous (synchronous control)</p> <p>Program name: ErrorReset (error reset)</p>
--	---

4.3.2 Settings for global and public labels

The following shows the setting examples of the global labels in the sample program.
For the local label, refer to each program.

(1) PLC CPU module

	Label Name	Data Type	Class	Assign (Device/Label)	Initial Value	Constant	English(Display Target)
1	G.bSRVOFF	Bit	VAR GLOBAL				Servo OFF
2	G.bJogF1	Bit	VAR GLOBAL				JOG Positive rotation command Axis0001
3	G.bJogR1	Bit	VAR GLOBAL				JOG Reverse rotation command Axis0001
4	G.bJogF2	Bit	VAR GLOBAL				JOG Positive rotation command Axis0002
5	G.bJogR2	Bit	VAR GLOBAL				JOG Reverse rotation command Axis0002
6	G.bHoming1CMD	Bit	VAR GLOBAL				Homing command Axis0001
7	G.bHoming2CMD	Bit	VAR GLOBAL				Homing command Axis0002
8	G.bHoming3CMD	Bit	VAR GLOBAL				Homing command VirtualAxis0001
9	G.bPosCMD	Bit	VAR GLOBAL				Single axis positioning start
10	G.bContPosCMD	Bit	VAR GLOBAL				Single axis continuous positioning start
11	G.bInterpolationCMD	Bit	VAR GLOBAL				2-axis linear interpolation control start
12	G.bSyncCMD	Bit	VAR GLOBAL				Synchronous control start
13	G.bErrorReset	Bit	VAR GLOBAL				Error reset
14	G.bSysErrorReset	Bit	VAR GLOBAL				System error reset
15	G.leJogVelocity	FLOAT (Double Precision)	VAR GLOBAL				JOG Velocity
16	G.bHoming1Req	Bit	VAR GLOBAL				Homing start request Axis0001
17	G.bHoming2Req	Bit	VAR GLOBAL				Homing start request Axis0002
18	G.bHoming3Req	Bit	VAR GLOBAL				Homing start request VirtualAxis0001
19	G.bPosReq	Bit	VAR GLOBAL				Single axis positioning start request
20	G.bContPosReq	Bit	VAR GLOBAL				Single axis continuous positioning start request
21	G.bInterpolationReq	Bit	VAR GLOBAL				2-axis linear interpolation control start request
22	G.bSyncReq	Bit	VAR GLOBAL				Synchronous control start request
23	G.bJog1Busy	Bit	VAR GLOBAL				JOG operation in progress Axis0001
24	G.bJog2Busy	Bit	VAR GLOBAL				JOG operation in progress Axis0002
25							

- 1) These labels are used to execute operation of each program.
- 2) This double-precision real number label stores the JOG velocity.
By registering this label as a global label, the JOG velocity can be changed from a GOT (HMI) or other programs.
*When changing the JOG velocity from a GOT, access from external devices must be enabled.
- 3) These labels turn ON while the program is being executed.
They are used as an interlock condition to prevent simultaneous execution of multiple programs.

(2) Motion module

The following shows the global and public label settings of the Motion module.

Set these labels on the motion control setting function of MELSOFT GX Works3. When the settings are finished, reflect the public labels. (Refer to Section 3.14.2.)

[AX+Global]

	Label Name	Data Type	Class	Initial Value	Constant	Comment	Public Label	Motion Control
1	Axis0001	AXIS_REAL	VAR_GLOBAL	<Detailed>...		[X_Axis]	Enable	-
2	Axis0002	AXIS_REAL	VAR_GLOBAL	<Detailed>...		[Y_Axis]	Enable	-
3	VirtualAxis0001	AXIS_VIRTUAL	VAR_GLOBAL	<Detailed>...		[Vir_Axis01]	Enable	-
4	LinkAxis0001	AXIS_VIRTUAL_LINK	VAR_GLOBAL	<Detailed>...		[Lin_Axis01]	Enable	-
5	LinkAxis0002	AXIS_VIRTUAL_LINK	VAR_GLOBAL	<Detailed>...		[Lin_Axis02]	Enable	-
6								

[Gr+Global]

	Label Name	Data Type	Class	Initial Value	Constant	Comment	Remark	Public Label	Motion Control Attribute
1	AxesGroup001	AXES_GROUP	VAR_GLOBAL	<Detailed>...		[X-Y Table]		Enable	-
2									

[Global]

The following are the structures that store data related to the system. Set "Public label" to "Enable".

	Label Name	Data Type	Class	Initial Value	Constant	Comment	Remark	Public Label	Motion Control Attribute
1	G.bStopSignalX	Bit	VAR_GLOBAL			停止指令 Axis0001 / Stop command Axis0001		Enable	WRITE (⇒ Motion)
2	G.bStopSignalY	Bit	VAR_GLOBAL			停止指令 Axis0002 / Stop command Axis0002		Enable	WRITE (⇒ Motion)
3									

[Sys+Global]

The following is the structure that stores data related to the system. Set "Public label" to "Enable".

	Label Name	Data Type	Class	Initial Value	Constant	Comment	Remark	Public Label	Motion Control Attribute
1	System	SYSTEM	VAR_GLOBAL	<Detailed Setti...				Enable	-
2									

[AXIS REAL structure]

AXIS_REAL [Structure Setting]									
	Label Name	Data Type	Class	Initial	Constant	English(Display Target)	Public Label	Motion Control	
1	AxisRef	AXIS_REF				Axis Information	Enabled	READ (Motion =...	
2	PrConst	AXIS_REAL_PRM_CONST				Axis Parameter Constant	Disabled	WRITE (=> Moti...	
3	Pr	AXIS_REAL_PRM				Axis Parameter	Disabled	WRITE (=> Moti...	
4	Md	AXIS_REAL_MONI				Axis Monitor Data	Enabled	READ (Motion =...	
5	Cd	AXIS_REAL_CMD				Axis Control Data	Disabled	WRITE (=> Moti...	
6									

Md					
Label Name	Data Type	Comment	Initial	Public Label	
Md	AXIS_REAL_MONI	Axis Monitor Data		Enabled	
AccelerationLimit	FLOAT [Double]	Acceleration Limit...		Disabled	
AccelerationOverride	FLOAT [Double]	Acceleration Overr...		Disabled	
AccelerationZeroBehavior	Word [Signed]	Operation Selectio...		Disabled	
ActualPosition	FLOAT [Double]	Actual Position		Disabled	
ActualVelocity	FLOAT [Double]	Actual Velocity		Disabled	
Analyzing	Bit	Analyzing		Disabled	
AutoDeceleration	Bit	Automatically Dece...		Disabled	
AxisName	String [Unicode]	Axis Name		Disabled	
AxisStatus	Word [Signed]	Axis Status		Enabled	
BufferingFBs	Word [Signed]	Number of Bufferin...		Disabled	
CmdInPos	Bit	Command In-position		Enabled	
CmdInPos_Width	FLOAT [Double]	Command In-positio...		Disabled	
CommandedAcceleration	FLOAT [Double]	Commanded Accelera...		Disabled	
CommandedDeceleration	FLOAT [Double]	Commanded Decelera...		Disabled	
CommandedJerk	FLOAT [Double]	Commanded Jerk		Disabled	
CommandedPosition	FLOAT [Double]	Commanded Position		Disabled	
CommandedVelocity	FLOAT [Double]	Commanded Velocity		Disabled	
Cspr_ForwardSidePosition	FLOAT [Double]			Disabled	
Cspr_SetPressure	Double Word [Signed]			Disabled	

Driver_ServoOn	Bit	Driver Servo On St...		Enabled
Driver_State	Word [Signed]	Driver Status		Disabled
DriverError	Bit	Drive Unit Error D...		Disabled
DriverErrorID	Word [Unsigned]/Bit	Drive Unit Error C...		Disabled
DriverErrorDetailID	Word [Unsigned]/Bit	Drive Unit Error D...		Disabled
Error	Bit	Axis Error Detection		Disabled
ErrorID	Word [Unsigned]/Bit	Axis Error Code		Disabled
FeedMachinePosition	FLOAT [Double]	Machine Feed Value		Disabled
FollowupDisable	Bit	Follow-up Disabled		Disabled
ForcedStop_Released	Bit	Forced Stop Cancel...		Disabled
ForcedStop_Signal	SIGNAL_SELECT	Forced Stop Signal		Disabled
Homing_Complete	Bit	Homing Completed		Disabled
Homing_Request	Bit	Homing Request		Enabled
Homing_Required	Bit	Homing Required or...		Disabled

[AXES_GROUP structure]

Label Name	Data Type	Class	Initial	Constant	English(Display Target)	Public Label	Motion Control
1 AxesGroupRef	AXES_GROUP_REF				Axes Group Information	Enabled	READ (Motion =...
2 PrConst	AXES_GROUP_PRM_CONST				Axes Group Parameter Constant	Disabled	WRITE (=> Moti...
3 Pr	AXES_GROUP_PRM				Axes Group Parameter	Disabled	WRITE (=> Moti...
4 Md	AXES_GROUP_MONI				Axes Group Monitor Data	Enabled	READ (Motion =...
5 Cd	AXES_GROUP_CMD				Axes Group Control Data	Disabled	WRITE (=> Moti...
6							

Label Name	Data Type	Comment	Initial	Public Label
Md	AXES_GROUP_MONI	Axes Group Monitor...		Enabled
AccelerationLimit	FLOAT [Double]	Acceleration Limit...		Disabled
AccelerationOverride	FLOAT [Double]	Acceleration Overr...		Disabled
AccelerationZeroBehavior	Word [Signed]	Operation Selectio...		Disabled
ActualVelocity	FLOAT [Double]	Actual Velocity		Disabled
Analyzing	Bit	Analyzing		Disabled
AutoDeceleration	Bit	Automatically Dece...		Disabled
Axis	AXIS_REF(1..16)	Configuration Axis		Disabled
BufferingFBs	Word [Signed]	Number of Bufferin...		Disabled
CmdInPos	Bit	Command In-position		Enabled
CmdInPos_Width	FLOAT [Double]	Command In-positio...		Disabled
CommandedAcceleration	FLOAT [Double]	Commanded Decelera...		Disabled
CommandedDeceleration	FLOAT [Double]	Commanded Decelera...		Disabled
CommandedJerk	FLOAT [Double]	Commanded Jerk		Disabled
CommandedVelocity	FLOAT [Double]	Commanded Velocity		Disabled
DecelerationLimit	FLOAT [Double]	Deceleration Limit...		Disabled
Error	Bit	Axes Group Error D...		Disabled
ErrorID	Word [Unsigned]/Bit	Axes Group Error C...		Disabled
GroupName	String [Unicode]	Axes Group Name		Disabled
GroupStatus	Word [Signed]	Axes Group Status		Enabled
InterpolationAxes	Double Word	Interpolation Axes		Disabled

[AXIS_VIRTUAL structure]

Label Name	Data Type	Class	Initial	Constant	English(Display Target)	Public Label	Motion Control
1 AxisRef	AXIS_REF				Axis Information	Enabled	READ (Motion =...
2 PrConst	AXIS_VIRTUAL_PRM_C...				Axis Parameter Constant	Disabled	WRITE (=> Moti...
3 Pr	AXIS_VIRTUAL_PRM				Axis Parameter	Disabled	WRITE (=> Moti...
4 Md	AXIS_VIRTUAL_MONI				Axis Monitor Data	Enabled	READ (Motion =...
5 Cd	AXIS_VIRTUAL_CMD				Axis Control Data	Disabled	WRITE (=> Moti...
6							

Label Name	Data Type	Comment	Initial	Public Label
Md	AXIS_VIRTUAL_MONI	Axis Monitor Data		Enabled
AccelerationLimit	FLOAT [Double]	Acceleration Limit...		Disabled
AccelerationOverride	FLOAT [Double]	Acceleration Overr...		Disabled
AccelerationZeroBehavior	Word [Signed]	Operation Selectio...		Disabled
Analyzing	Bit	Analyzing		Disabled
AutoDeceleration	Bit	Automatically Dece...		Disabled
AxisName	String [Unicode]	Axis Name		Disabled
AxisStatus	Word [Signed]	Axis Status		Enabled
BufferingFBs	Word [Signed]	Number of Bufferin...		Disabled
CmdInPos	Bit	Command In-position		Enabled
CmdInPos_Width	FLOAT [Double]	Command In-positio...		Disabled
Homing_Complete	Bit	Homing Completed		Disabled
Homing_Request	Bit	Homing Request		Enabled
Homing_Required	Bit	Homing Required or...		Disabled

[AXIS_VIRTUAL_LINK structure]

Label Name	Data Type	Class	Initial Value	Constant	Comment	Public Label	Motion Control Attribute
1 AxisRef	AXIS_REF				Axis Information	Enable	READ (Motion =>): Md...
2 PrConst	AXIS_VIRTUAL_LINK_PRM_CONST				Axis Parameter Constant	Disable	WRITE (=> Motion): Pr...
3 Pr	AXIS_VIRTUAL_LINK_PRM				Axis Parameter	Disable	WRITE (=> Motion): Pr...
4 Md	AXIS_VIRTUAL_LINK_MONI				Axis Monitor Data	Enable	READ (Motion =>): Md...
5 Cd	AXIS_VIRTUAL_LINK_CMD				Axis Control Data	Disable	WRITE (=> Motion): Cd...
6							

[SYS_MONI structure]

	Label Name	Data Type	Class	Initial Value	Constant	Comment	Public Label	Motion Control
1	Addon_AbsSystem	ADDON_MONI				Add-on AbsSystem Monitor	Disable	-
2	Addon_Axis	ADDON_MONI				Add-on Axis Monitor	Disable	-
3	Addon_ExternalSignal	ADDON_MONI				Add-on ExternalSignal Monitor	Disable	-
4	Addon_FileTransfer	ADDON_MONI				Add-on FileTransfer Monitor	Disable	-

≈

23	BuffermemoryRefreshCycle	CYCLE_MONI				Buffer Memory Refresh Cycle Moni...	Disable	-
24	Environment_UserRootPath	String(127)				User Root Path	Disable	-
25	Error	Bit		0		Motion System Error Detection	Enable	-
26	ErrorHistory	Word [Unsigned]...		0		Error History Information	Disable	-
27	ErrorHistory_Latest	Word [Signed]		0		Latest Error History Data No.	Disable	-

≈

[SYSTEM structure]

SYSTEM [Structure Setting]								
	Label Name	Data Type	Class	Initial	Constant	English(Display Target)	Public Label	Motion Control
1	PrConst	SYS_PRM_CONST				System Parameter Constant	Disabled	WRITE (=> Moti...
2	Pr	SYS_PRM				System Parameter	Disabled	WRITE (=> Moti...
3	Md	SYS_MONI				System Monitor Data	Enabled	READ (Motion =...
4	Cd	SYS_CMD				System Control Data	Disabled	WRITE (=> Moti...
5	LOGGING_REALT...	LOGGING_REALTIME				Logging Real-time Monitor	Disabled	-
6	LoggingRef	LOGGING_REF(1..10)				Logging	Disabled	-
7	Project	PROJECT				Project	Disabled	-
8								

Md				
Label Name	Data Type	Comment	Initial	Public Label
BuffermemoryRefreshCycle	CYCLE_MONI	Buffer Memory Refr...		Disabled
CoRecordingStatus	Word [Signed]	Co-recording Opera...		Disabled
Error	Bit	Motion Area System...		Enabled
ErrorHistory	Word [Unsigned]/Bit	Error History Info...		Disabled

[POINTS]

By registering the global label Enum_Global_RD78 in the library to the global labels of the project, programming using ENUM numerators becomes available in PLC programs.


4.4 PLC READY (Program Name: ServoON_Jog)

The Motion module uses 32 points each for inputs and outputs to send/receive data to/from a PLC CPU module.

Regardless of the programming language, PLC READY [Y0] needs to be turned ON by a PLC CPU module to start operation of the Motion module.

(1) Program example

PLC READY flag [Y0] is turned ON when the PLC CPU module is powered ON and the synchronization flag [X1] is turned ON.

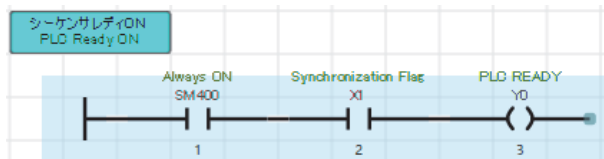

4.5 Servo ON (Program Name: ServoON_Jog)

This program turns ON the real drive axes connected to the servo system.
The following two FBs are used for executing servo ON.

(1) FBs

Type	Command	Description
MCFB (administrative)	MC_Power	Switches a specified axis to the operation possible status.
	MCv_AllPower	Switches all axes to the operation possible status.

(2) Local labels

	Label Name	Data Type	English(Display Target)
1	MCv_AllPower_1	MCv_AllPower	All axes servo ON FB
2	MCv_Jog_1	MCv_Jog	JOG operation FB Axis0001
3	MCv_Jog_2	MCv_Jog	JOG operation FB Axis0002
4	leJogAcceleration	FLOAT	G acceleration
5	leJogDeceleration	FLOAT [Double Precision]	JOG deceleration
6	leJogJerk	FLOAT [Double Precision]	JOG jerk
7			

Drag and drop MCv_AllPower to the program editor. The FB (MCv_AllPower_1) is added as a local label. (Refer to Section 4.1.3.)


(3) Program example

When PLC READY [Y0] is turned ON, Ready [X0] is turned ON.

Turning ON of X0 is used as the condition for executing all axes servo ON.

When executing servo OFF, turn ON G_bSRVOFF.

For MCv_AllPower, connect AxisRef type structure to the Axis input connection point.

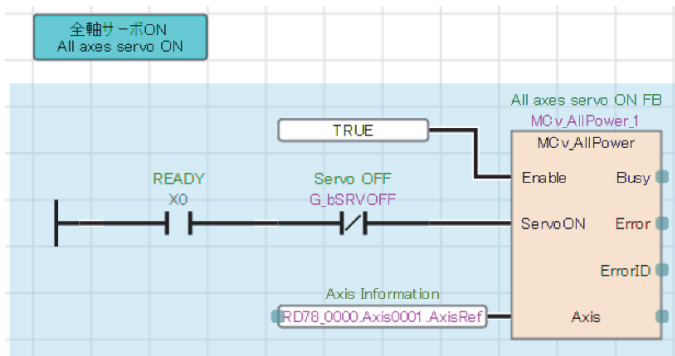

[POINTS]

The I/O No. of the Motion module must be specified in the AxisRef type structure.

When a user specifies the I/O No. in the PLC CPU program, store the numerical value that deletes the lowest digit of the Motion module I/O No. to the AxisRef.StartIO.

For example, when the I/O No. is "0010", store "1" for AxisRef.StartIO.

4.6 JOG Operation (Program Name: ServoON_Jog)

The servo system outputs commands to a target axis and operates the axis in a specified direction while the JOG positive/reverse rotation commands are ON.

(1) FB

Type	Command	Description
MCFB (motion)	MCv_Jog	Executes a JOG operation according to the target velocity.

(2) Acceleration/deceleration processing function

The acceleration/deceleration function is used to adjust the acceleration/deceleration curve of the motion control according to the user's machine.

(a) Overview

Select the acceleration/deceleration methods from the following.

Method	Description
Acceleration/deceleration specification method (Initial)	Accelerates/decelerates the axis by the acceleration, deceleration, and jerk values specified in the FB.
Acceleration/deceleration time-fixed method	Accelerates/decelerates the axis based on the time specified in the FB regardless of speed.

(b) Setting method

The acceleration/deceleration method can be specified by the Options input of motionFBs, such as MCv_Jog.

Bit	Description
0 to 2	Acceleration/deceleration method setting 0: mcAccDec (acceleration/deceleration specification method) 1: mcFixedTime (acceleration/deceleration time-fixed method)
3 to 15	The function varies depending on the FB.
16 to 31	


(c) Acceleration/deceleration specification method

Select "0: mcAccDec" in the Options input (using bit 0 to 2 for acceleration/deceleration method setting) of the FB, and set acceleration, deceleration, and jerk.

1) Trapezoidal acceleration/deceleration

When "0.0" is set for the Jerk input of the FB, the operation is referred to as the trapezoidal acceleration/deceleration.


The velocity creates a trapezoidal shape.

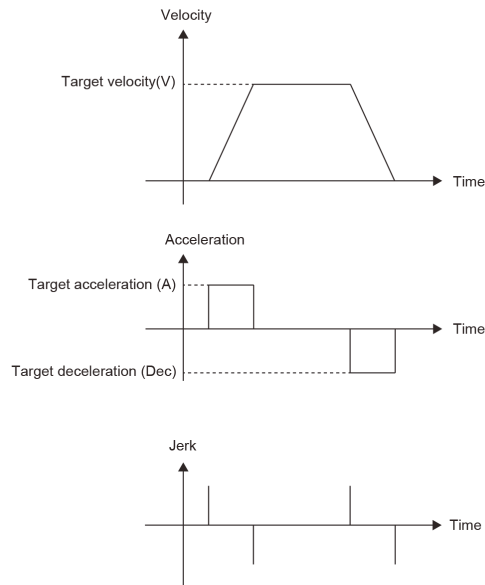

2) Jerk acceleration/deceleration


When values other than "0.0" is set for the Jerk input of the FB, the operation is referred to as the jerk acceleration/deceleration.

The velocity creates an S-curve shape.

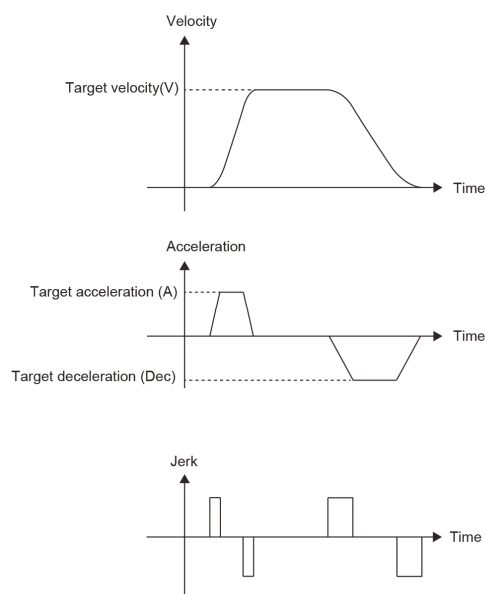

(d) Acceleration/deceleration time-fixed method

Select "1: mcFixedTime" in the Options input (using bit 0 to 2 for acceleration/deceleration method setting) of the FB, and set the acceleration time in the Acceleration input of the FB. The Deceleration and Jerk inputs are not used.

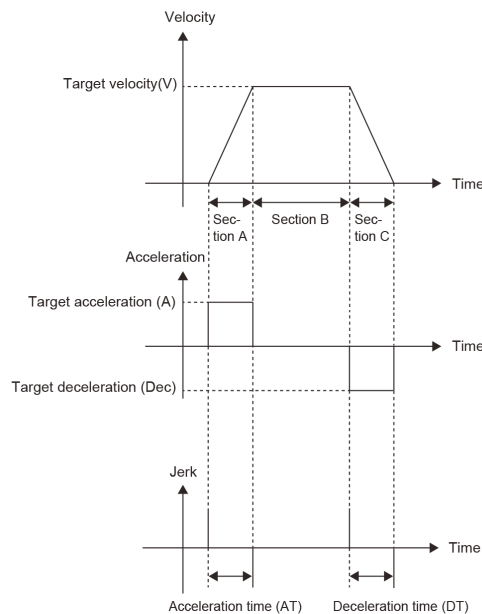

(e) FB input variables

The following table lists the input variables explained in (b) to (d).

Input variable	Name	Details
Velocity	Target velocity	Specify the target velocity.
Acceleration	Acceleration or acceleration/deceleration time	Specify the acceleration or the acceleration/deceleration time. <ul style="list-style-type: none"> • The unit is $[U/s^2]$ when the method is set to "0: mcAccDec". • The unit is [s] when the method is set to "1: mcFixedTime".
Deceleration	Deceleration	Specify the deceleration. <ul style="list-style-type: none"> • The unit is $[U/s^2]$ when the method is set to "0: mcAccDec". • Not used when the method is set to "1: mcFixedTime"
Jerk	Jerk	Specify the jerk. <ul style="list-style-type: none"> • The unit is $[U/s^3]$ when the method is set to "0: mcAccDec". • Not used when the method is set to "1: mcFixedTime".
Options	Options	Specify the acceleration/deceleration method using bit 0 to2. 0: mcAccDec Acceleration/deceleration specification method 1: mcFixedTime Acceleration/deceleration time-fixed method

[POINTS]

When the "Acceleration/deceleration specification method" (Options: 0) is selected, the acceleration/deceleration can be calculated using the acceleration/deceleration time as follows.

[Target velocity: V [U/s], acceleration time [s], deceleration time [s]],

Velocity := (target velocity V);

Acceleration := (target velocity V/acceleration time);

Deceleration := (target velocity V/deceleration time);

Options := (mcAccDec);

(3) Local labels

The label used in the Servo ON program

	Label Name	Data Type	English(Display Target)
1	MCv AllPower 1	MCv AllPower	... All axes servo ON FB
2	MCv_Jog_1	MCv_Jog	... JOG operation FB Axis0001
3	MCv_Jog_2	MCv_Jog	... JOG operation FB Axis0002
4	leJogAcceleration	FLOAT [Double Precision]	... JOG acceleration
5	leJogDeceleration	FLOAT [Double Precision]	... JOG deceleration
6	leJogJerk	FLOAT [Double Precision]	... JOG jerk
7			...

1) These labels are automatically added when the user drags and drops the FB "MCv_Jog" to the program editor.

2) These labels are registered manually.

(4) Program example


The EDMOVP instruction is used to store values to the JOG velocity, acceleration, deceleration, and jerk.

The labels for the JOG positive/reverse rotation commands are connected to the corresponding command inputs (JogForward and JogBackward inputs) of the FB (MCv_Jog).

The interlock conditions are added to prevent execution of the JOG operation while other programs are running.



[Start signal]

	Axis0001	Axis0002
JOG positive rotation command	G_bJogF1	G_bJogF2
JOG reverse rotation command	G_bJogR1	G_bJogR2

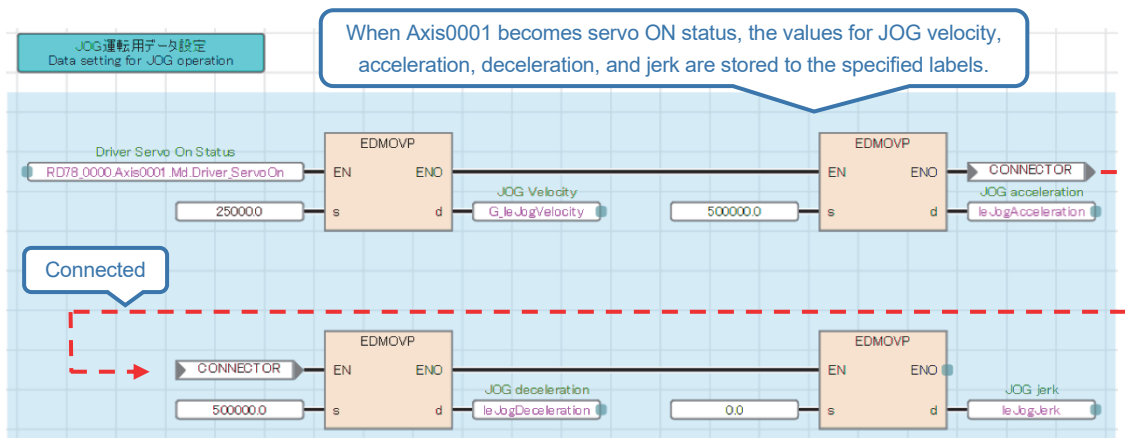

[POINTS]

To enter the EDMOVP instruction, directly enter "EDMOVP" on the editor, or drag and drop "EDMOVP" to the editor (select "APPLICATION INSTRUCTIONS" → "Real number instructions" on the [POU List] tab in the element selection window.)

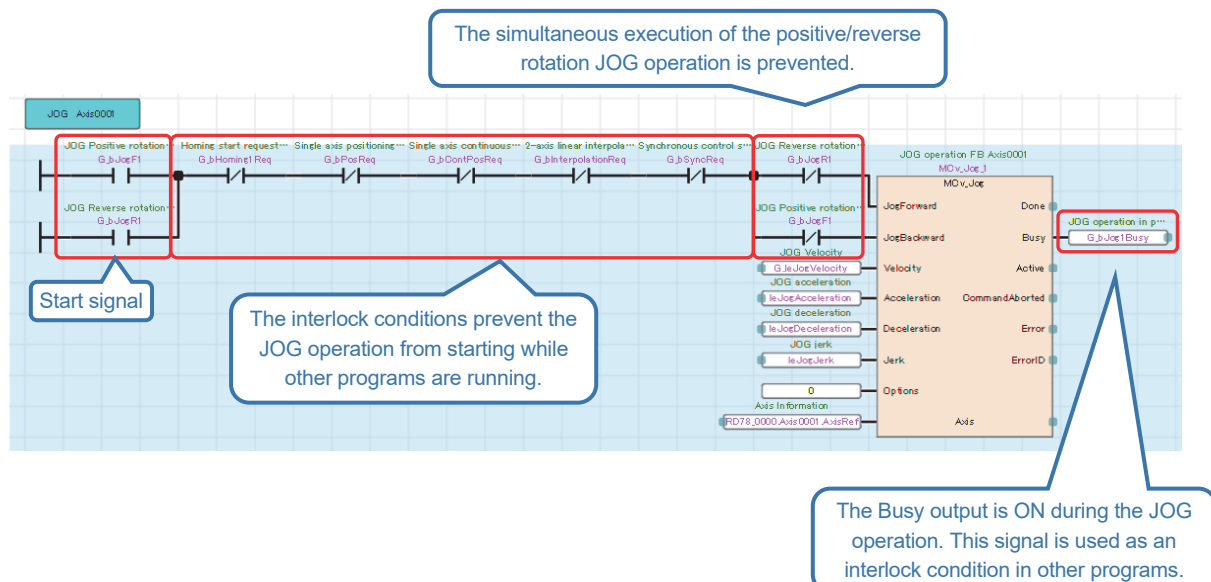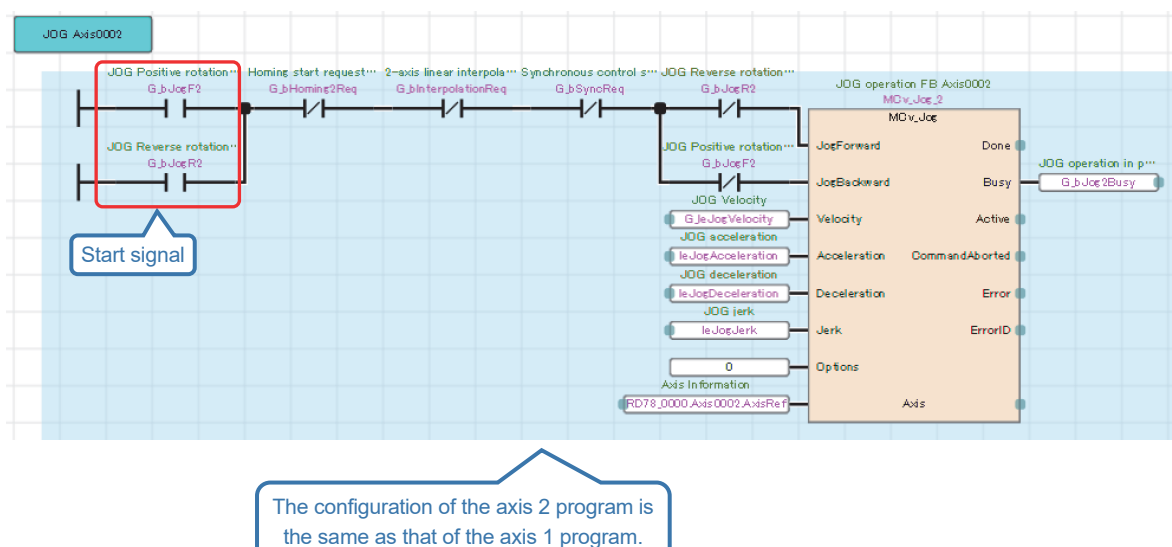

4.7 Homing (Program Name: Homing)

The homing method is set using the servo amplifier parameter [Pr. PT45 (Home position return method)].


This section explains the data set method homing.

For the dog type homing, refer to Appendix.

(1) Overview

The data set type homing sets the current position as the home position.

[Time chart of data set type homing (Method37)]

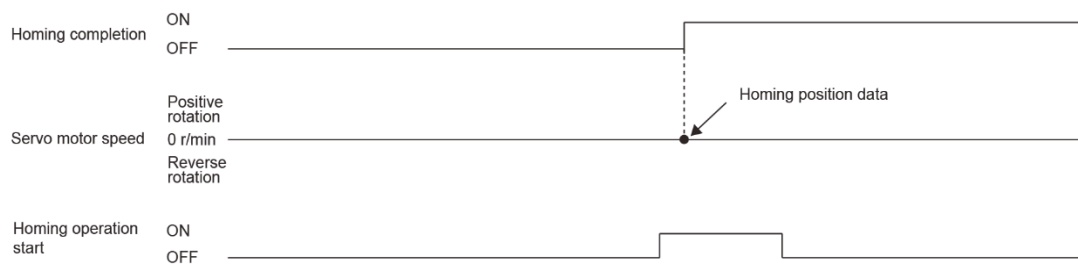

(2) FB

Type	Command	Description
MCFB (motion)	MC_Home	Executes homing of the specified axis.

(3) Local labels


	Label Name	Data Type	English(Display Target)
1) -----	1 MC_Home_1	MC_Home	...
	2 MC_Home_2	MC_Home	...
	3 MC_Home_3	MC_Home	...
	4 bHoming1Done	Bit	...
	5 bHoming1Error	Bit	...
2) -----	6 bHoming2Done	Bit	...
	7 bHoming2Error	Bit	...
	8 bHoming3Done	Bit	...
	9 bHoming3Error	Bit	...
	10		


1) These labels are automatically added when the user drags and drops the FB (MC_Home) to the program editor.

2) These labels are registered manually.

This program executes homing for the axis 1 (Axis0001), the axis 2 (Axis0002), and the virtual drive axis (VirtualAxis0001). The homing request label is kept ON by a self-holding circuit and is connected to the Execute input of MC_Home. The start signal is turned OFF when the completion signal (the Done output of MC_Home) is turned ON or when an error occurs. The interlock conditions are added to prevent execution of the homing while other programs are running or when an error occurs.

	Axis0001	Axis0002	VirtualAxis0001
Homing command	G_bHoming1CMD	G_bHoming2CMD	G_bHoming3CMD

 

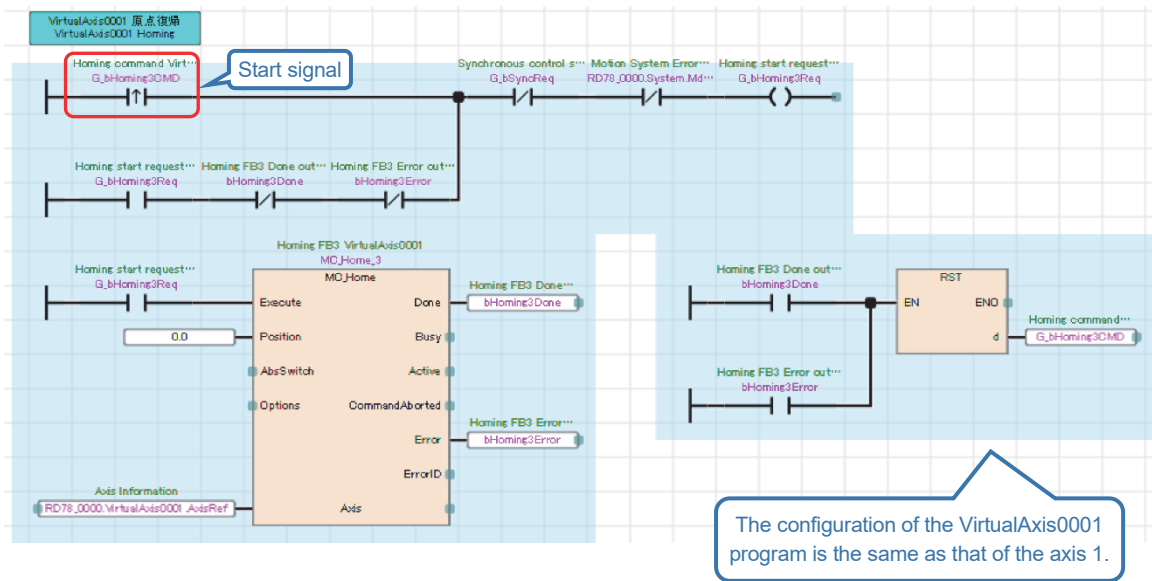

4.8 Single Axis Positioning Control (Program Name: Positioning)

The single axis positioning control executes positioning to a specified position by using the address information.

(1) FBs

Type	Command	Description
MCFB (motion)	MC_MoveAbsolute	Executes positioning using a specified absolute position.
	MC_MoveRelative	Executes positioning using a specified relative distance.

(2) Local labels


	Label Name	Data Type	English(Display Target)
1) ---	MC_MoveRelative_1	MC_MoveRelative	Relative value positioning FB
	leDistance	FLOAT [Double Precision]	Distance
	leVelocity	FLOAT [Double Precision]	Velocity
	leAcceleration	FLOAT [Double Precision]	Acceleration
	leDeceleration	FLOAT [Double Precision]	Deceleration
	leJerk	FLOAT [Double Precision]	Jerk
2) ---	bDone	Bit	Relative value positioning FB Done output
	bError	Bit	Relative value positioning FB Error output
	bValueSet	Bit	Variable set complete
	bCommandAborted	Bit	Relative value positioning FB CommandAborted output

1) This label is automatically added when the user drags and drops the FB (MC_MoveRelative) to the program editor.

2) These labels are registered manually.

(3) Program example


This program executes relative positioning in the following operation pattern.

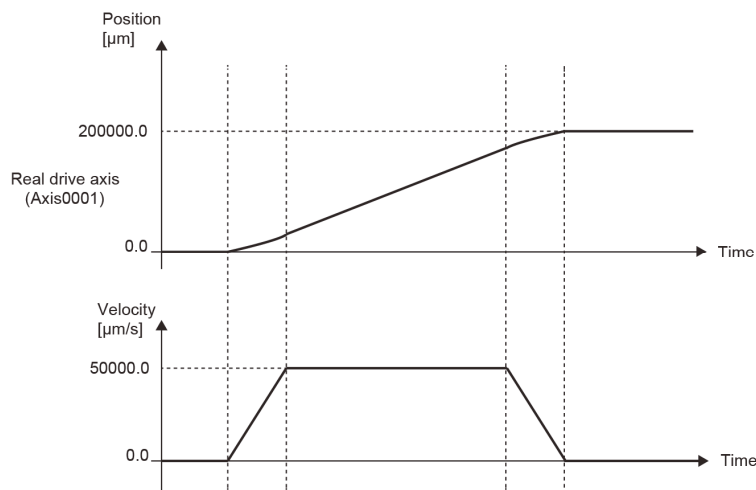

When the single axis positioning command is turned ON, each positioning data is stored to the specified label. When all the data is stored, the execution signal of the relative value positioning FB (MC_MoveRelative) is kept ON by a self-holding circuit. The start signal is turned OFF when any of the following three conditions is satisfied: the positioning is completed (the Done output of MC_MoveRelative and command in-position); an error occurs; or the execution is aborted. The interlock conditions are added to prevent execution of the single axis positioning while other programs are running or when a system error occurs.

[Start signal]

Single axis positioning command	G_bPosCMD
---------------------------------	-----------

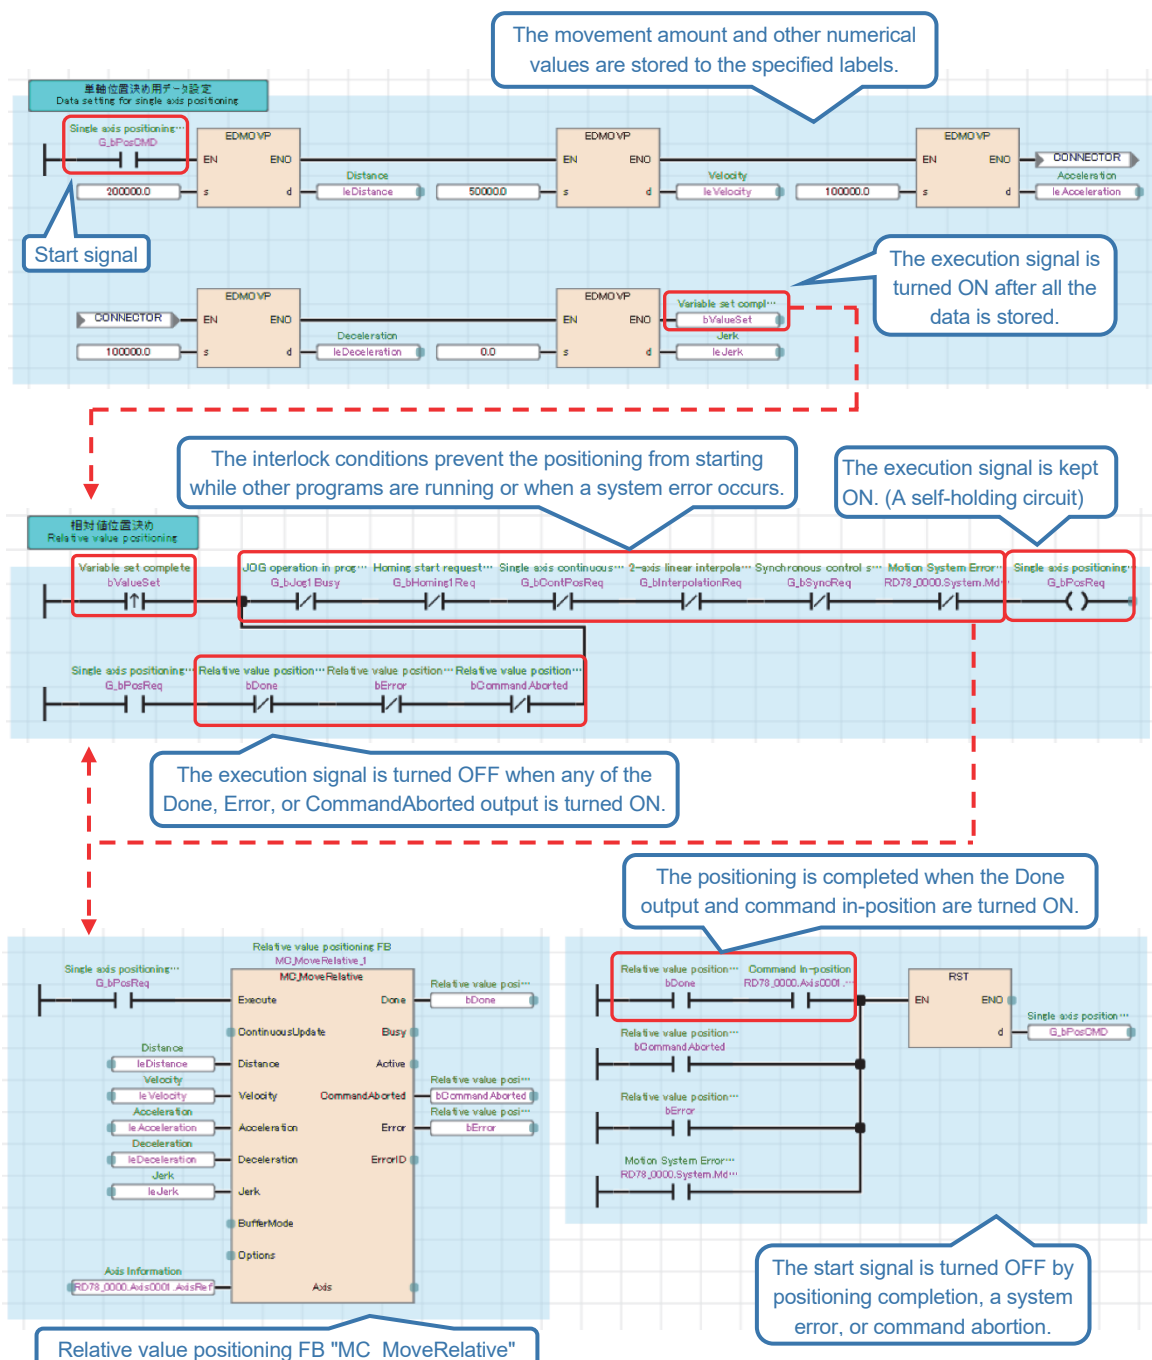

4.9 Single Axis Continuous Positioning (Program Name: ContinuousPositioning)

(1) Overview

An axis can continuously execute multiple motion FBs without stopping by buffering the next motion FB of another instance while executing the first motion FB. Select the buffer mode through the BufferMode input of a motion control FB.

Up to two motion FBs can be buffered on one axis.

(2) Operation pattern of buffer mode

Buffer mode	Operation
0: mcAborting The on-going FB is interrupted (canceled), and the next FB is immediately executed.	<p>Target velocity of FB2 Target velocity of FB1 Accelerates/decelerates to the target velocity of FB2 using acceleration/deceleration of FB2. Target position of FB1 Target position of FB2</p>
1: mcBuffered The next FB is executed after completion of the on-going FB (the axis decelerates to a stop).	<p>Multiple start timing The following FB starts after stopping at the target position. FB being executed Buffering FB</p>
2: mcBlendingLow The lower target velocity of the on-going FB and the next FB is used as the switching speed.	
3: mcBlendingPrevious The next FB is executed after the target position of the on-going FB is reached. The target velocity is that of the next FB.	<p>Multiple start Transfer velocity uses the set velocity of current FB. FB being executed Buffering FB</p>
4: mcBlendingNext The next FB is executed after the target position of the on-going FB is reached. When the target position is reached, the velocity is switched to that of the next FB.	<p>Multiple start Transfer velocity uses the set velocity of buffering FB. FB being executed Buffering FB</p>
5: mcBlendingHigh The higher target velocity of the on-going FB and the next FB is used as the switching speed.	


(3) Local labels

	Label Name	Data Type	English
1)	MC_MoveRelative_1	MC_MoveRelative	Relative value positioning FB1
	MC_MoveRelative_2	MC_MoveRelative	Relative value positioning FB2
	TON_1	TON	On-delay timer FB
	leDistance1	FLOAT [Double Precision]	Distance1
	leVelocity1	FLOAT [Double Precision]	Velocity1
	leDistance2	FLOAT [Double Precision]	Distance2
	leVelocity2	FLOAT [Double Precision]	Velocity2
	leAcceleration1	FLOAT [Double Precision]	Acceleration1
	leDeceleration1	FLOAT [Double Precision]	Deceleration1
2)	leAcceleration2	FLOAT [Double Precision]	Acceleration2
	leDeceleration2	FLOAT [Double Precision]	Deceleration2
	leJerk	FLOAT [Double Precision]	Jerk
	bError	Bit	Relative value positioning FB Error output
	bDwell_out	Bit	Timer output
	bDwell_in	Bit	Timer input
	bValueSet	Bit	Variable set complete
	bCommandAborted	Bit	Relative value positioning FB CommandAborted

- 1) These labels are automatically added when the user drags and drops the FB (MC_MoveRelative and TON) to the program editor.
- 2) These labels are registered manually.

(4) Program example

This program executes relative positioning in the following operation pattern.

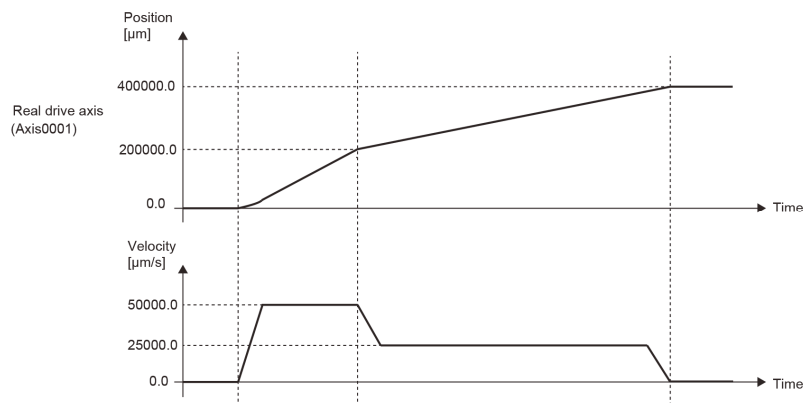

When the single axis positioning command is turned ON, each positioning data is stored to the specified label. When all the data is stored, the execution signal of the FB (MC_MoveRelative_1) is kept ON by a self-holding circuit.



The Active output of the first FB (MC_MoveRelative_1) is connected to the Execute input of the next FB (MC_MoveRelative_2), which enables buffering of the next FB while executing the first FB. When the first FB is finished, the next FB is continuously executed.

To set dwell time, the on-delay timer (100 [ms]) is used. The on-delay timer input and the start signal are reset when any of the following three conditions is satisfied: the dwell time is passed; an error occurs; or the execution is aborted. The interlock conditions are added to prevent execution of the single axis continuous positioning while other programs are running or when a system error occurs.

[Start signal]

Single axis continuous positioning command	G_bContPosCMD
--	---------------

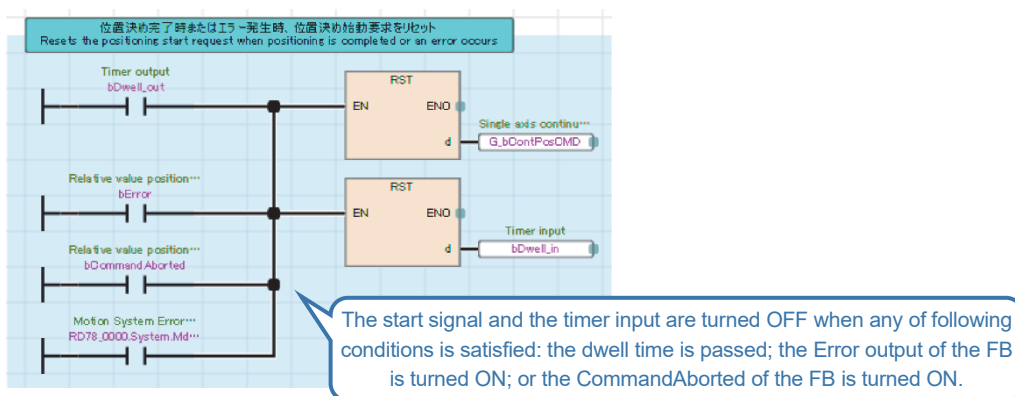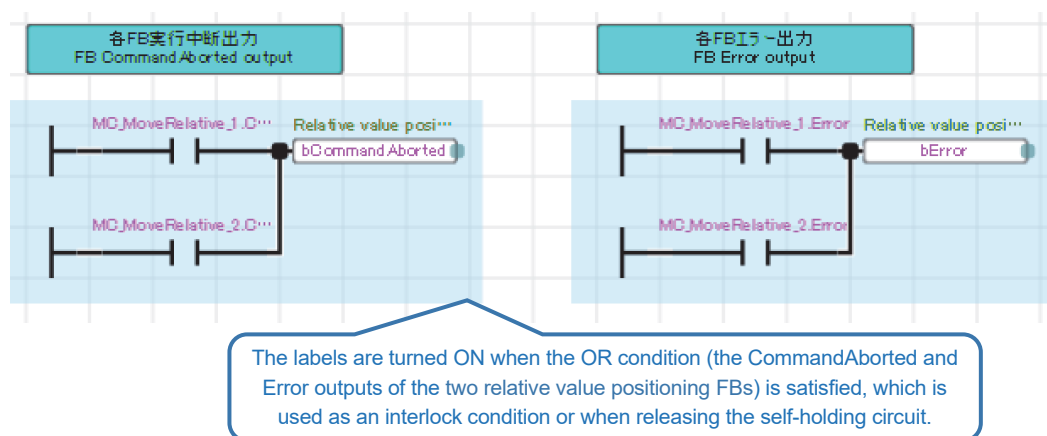


**[POINTS]**

Instead of connecting a label, output signals of a FB can be directly entered by describing "(FB name). (output signal name)" in the editor.

4.10 Interpolation Control (Program Name: LinearInterpolation)

4.10.1 Procedure for interpolation control

The following shows the procedure flow for executing interpolation control of two or more axes.

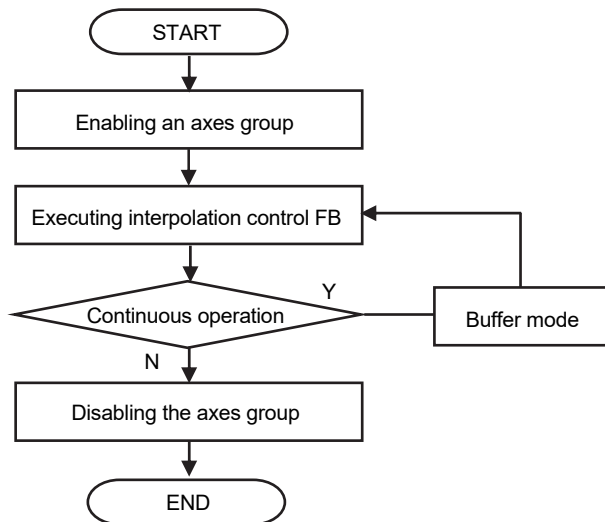

4.10.2 Enabling/disabling an axes group

Refer to Section 3.12 for axes group setting.

To execute interpolation control, set the axes group status to "4: GroupStandby".

(1) FBs

Type	Command	Description
MCFB (administrative)	MC_GroupEnable	Transits the specified axes group status from "0: GroupDisabled" to "4: GroupStandby".
	MC_GroupDisable	Transits the specified axes group status to "0: GroupDisabled".

4.10.3 Interpolation control

The FBs for linear and circular interpolation control are as follows. Execute the FBs after the axes group is enabled.


(1) FBs

Type	Command	Description
MCFB (motion)	MCv_MoveLinearInterpolateAbsolute	Absolute value linear interpolation control
	MCv_MoveLinearInterpolateRelative	Relative value linear interpolation control
	MCv_MoveCircularInterpolateAbsolute	Absolute value circular interpolation control
	MCv_MoveCircularInterpolateRelative	Relative value circular interpolation control

4.10.4 Program example for linear interpolation

(1) Operation pattern

The machine goes back and forth between the origin point (0.0, 0.0) [μm] and P1 (100000.0, 200000.0) [μm].

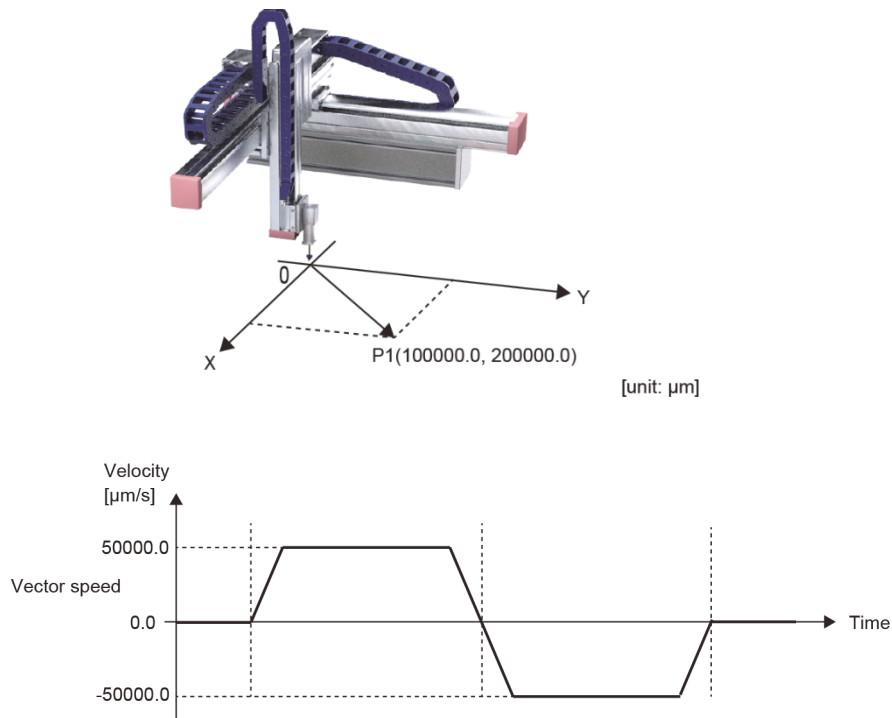

(2) Axis No. and movement amount settings

(a) LinearAxes input of MCv_MoveLinearInterpolateRelative

Use the array of INT (signed word) type with 16 elements.

In the sample program, wAxes[0..15] (label) is used.

The interpolation control axes are selected from the structuring axis [1] to [16] set in the axes group (in Section 3.12). Specify the structuring axis No. to be used for the interpolation control by wAxes. (Note that the wAxes must be set from the index No. [0] in order.)

(b) Distance input

Use the array of LREAL (double-precision real number) type with 16 elements

In the sample program, lePosition[0..15] is used.

Define the movement amount of the structuring axis [1] to [16] in lePosition[0] to lePosition[15].

[POINTS]

Regardless of the number of the interpolation control axes, the number of elements must be 16 for the INT-type array for the LinearAxes input and the LREAL-type array for the Distance input.

[Setting example 1]

- Axes group
Structuring axis [1]: Axis0001, structuring axis [2]: Axis0002,
and structuring axis [3]: Axis0003
- Linear interpolation
Axis0001 and Axis0002

Setting Item	
Select Folder	Display All Data
Item	AxesGroup001
..... Axes Group No.	1
□ Axes Group Parameter	Expands initial values at axis
..... Acceleration Limit Value	2147483647.0 pulse/s ²
..... Operation Selection at Start	-1:Error (Not Started)
..... Structuring Axis[1]	Axis0001
..... Structuring Axis[2]	Axis0002
..... Structuring Axis[3]	Axis0003
..... Structuring Axis[4]	
..... Structuring Axis[5]	
..... Structuring Axis[6]	
..... Structuring Axis[7]	
..... Structuring Axis[8]	
..... Structuring Axis[9]	
..... Structuring Axis[10]	
..... Structuring Axis[11]	
..... Structuring Axis[12]	
..... Structuring Axis[13]	
..... Structuring Axis[14]	
..... Structuring Axis[15]	
..... Structuring Axis[16]	

wAxes[0] := 1; (← structuring axis [1])
wAxes[1] := 2; (← structuring axis [2])

lePosition[0] := (movement amount of structuring axis 1 (=Axis0001));
lePosition[1] := (movement amount of structuring axis 2 (=Axis0002));

[Setting example 2]

- Axes group
Structuring axis [1]: Axis0001, structuring axis [2]: Axis0002,
and structuring axis [3]: Axis0003
- Linear interpolation
Axis0002 and Axis0003

Setting Item	
Select Folder	Display All Data
Item	AxesGroup001
..... Axes Group No.	1
□ Axes Group Parameter	Expands initial values at axis
..... Acceleration Limit Value	2147483647.0 pulse/s ²
..... Operation Selection at Start	-1:Error (Not Started)
..... Structuring Axis[1]	Axis0001
..... Structuring Axis[2]	Axis0002
..... Structuring Axis[3]	Axis0003
..... Structuring Axis[4]	
..... Structuring Axis[5]	
..... Structuring Axis[6]	
..... Structuring Axis[7]	
..... Structuring Axis[8]	
..... Structuring Axis[9]	
..... Structuring Axis[10]	
..... Structuring Axis[11]	
..... Structuring Axis[12]	
..... Structuring Axis[13]	
..... Structuring Axis[14]	
..... Structuring Axis[15]	
..... Structuring Axis[16]	

wAxes[0] := 2; (← structuring axis [2])
wAxes[1] := 3; (← structuring axis [3])

lePosition[0] := 0.0;
lePosition[1] := (movement amount of structuring axis 2 (=Axis0002));
lePosition[2] := (movement amount of structuring axis 3 (=Axis0003));

(3) Local labels

	Label Name	Data Type	English
1) -----	1 MC_GroupEnable_1	MC_GroupEnable	... Aves group enable FB
	2 MCv_MoveLinearInterpolateRelative_1	MCv_MoveLinearInterpolateRelative	... Relative value linear interpolation control FB1
	3 MCv_MoveLinearInterpolateRelative_2	MCv_MoveLinearInterpolateRelative	... Relative value linear interpolation control FB2
	4 MC_GroupDisable_1	MC_GroupDisable	... Aves group disable FB
	5 TON_1	TON	... On-delay timer FB
	6 #Axes	Word [Signed](0.15)	... Interpolation axis
	7 lePosition1	FLOAT [Double Precision](0.15)	... Position data 1
	8 lePosition2	FLOAT [Double Precision](0.15)	... Position data 2
	9 leVelocity	FLOAT [Double Precision]	... Velocity
	10 leAcceleration	FLOAT [Double Precision]	... Acceleration
	11 leDeceleration	FLOAT [Double Precision]	... Deceleration
	12 leJerk	FLOAT [Double Precision]	... Jerk
2) -----	13 bDone2	Bit	... Relative value linear interpolation control FB2 Don
	14 bGrpEnError	Bit	... Aves group enable FB Error output
	15 bError	Bit	... Relative value linear interpolation control FB Error
	16 bGrpDsbDone	Bit	... Aves group disable FB Done output
	17 bDwellIn	Bit	... Timer input
	18 bDwellOut	Bit	... Timer output
	19 bValueSet	Bit	... Variable set complete
	20 bCommandAborted	Bit	... Relative value linear interpolation control FB Com
	21 bDone_Set	Bit	... Done
	22 bCommandAborted_Set	Bit	... FB abortion of execution

1) These labels are automatically added when the user drags and drops the corresponding FB to the program editor.

2) These labels are registered manually.

(4) Program example

When the two-axis interpolation control start is turned ON, each positioning data is stored to the specified label. When all the data is stored, the execution signal of the FB

(MC_GroupEnable_1) is kept ON through a self-holding circuit. After the axes group is enabled by MC_GroupEnable, the two FBs for relative value linear interpolation control (MCv_MoveLinearInterpolateRelative) are started in buffer mode.


The axes group is disabled when any of the following conditions is satisfied: the dwell time is passed after the positioning is completed; an error occurs; or the execution is aborted.

The on-delay timer and the start signal are reset when the group is disabled.



The interlock conditions are added to prevent execution of the two-axis interpolation control while other programs are running or when a system error occurs.

[Start signal]

Two-axis linear interpolation control start	G_bInterpolationCMD
---	---------------------

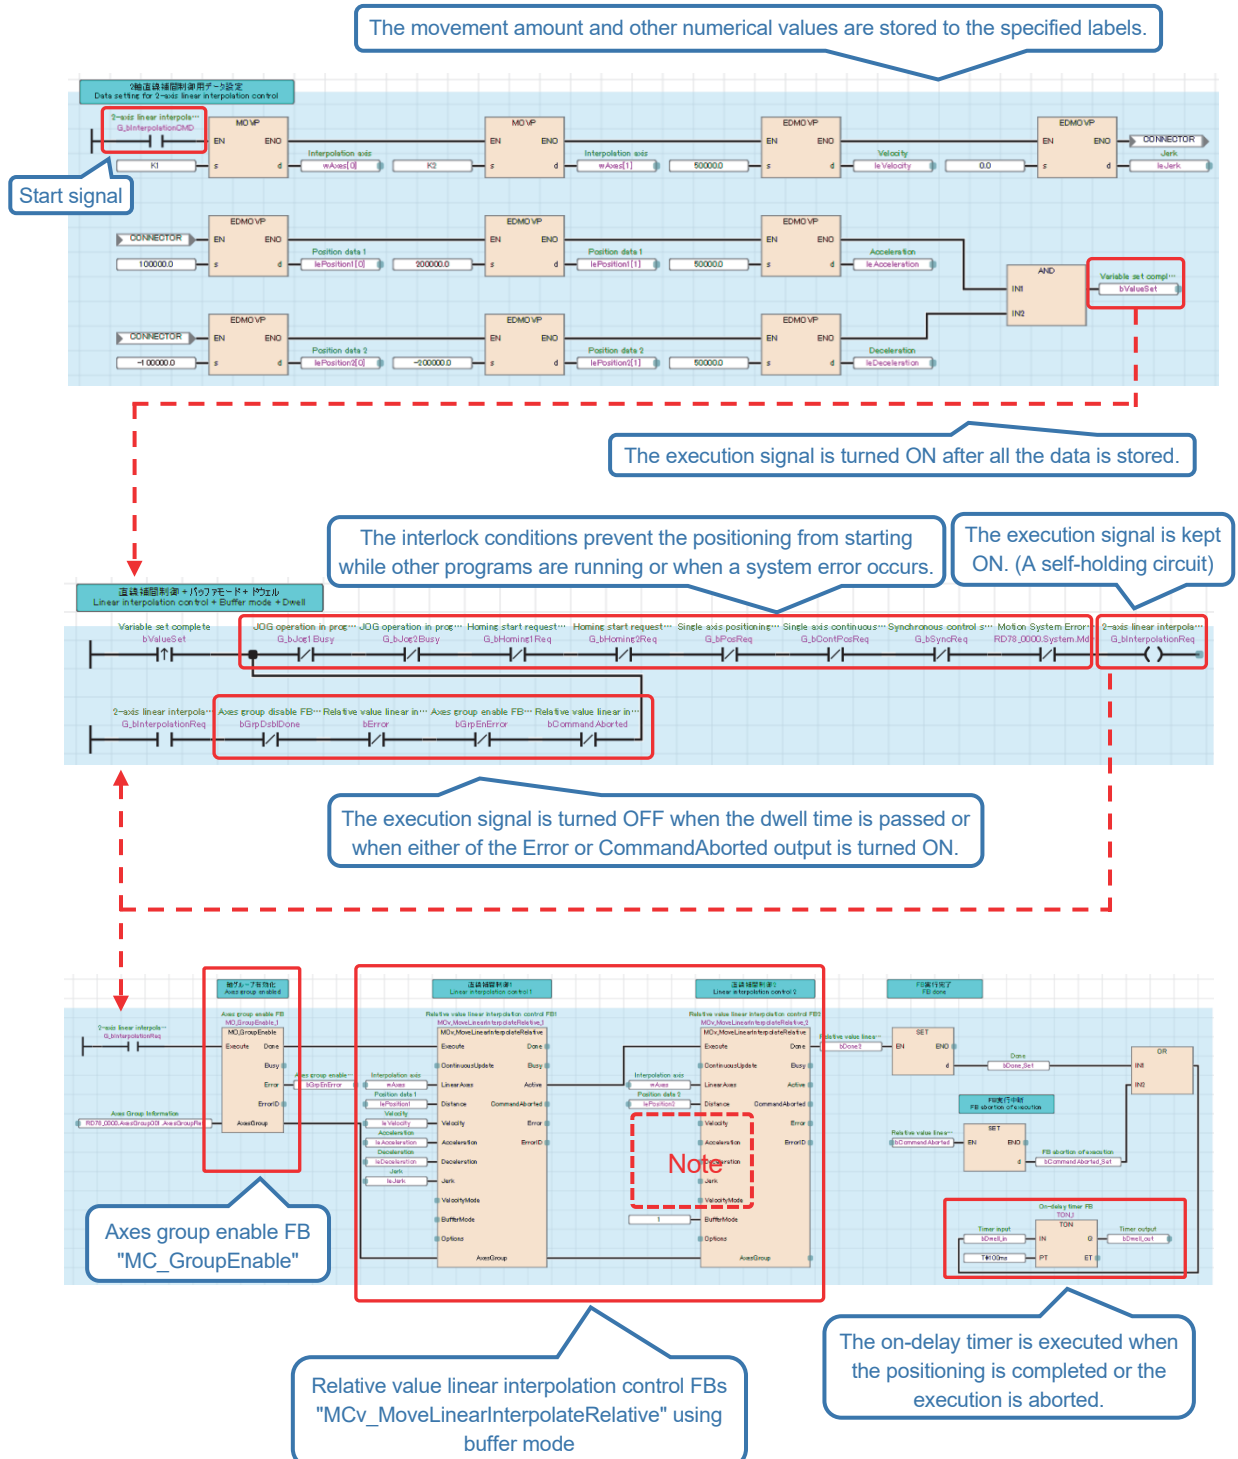

(Note) When the values for the Velocity, Acceleration, and Deceleration inputs are omitted, those of the previous FB are applied.

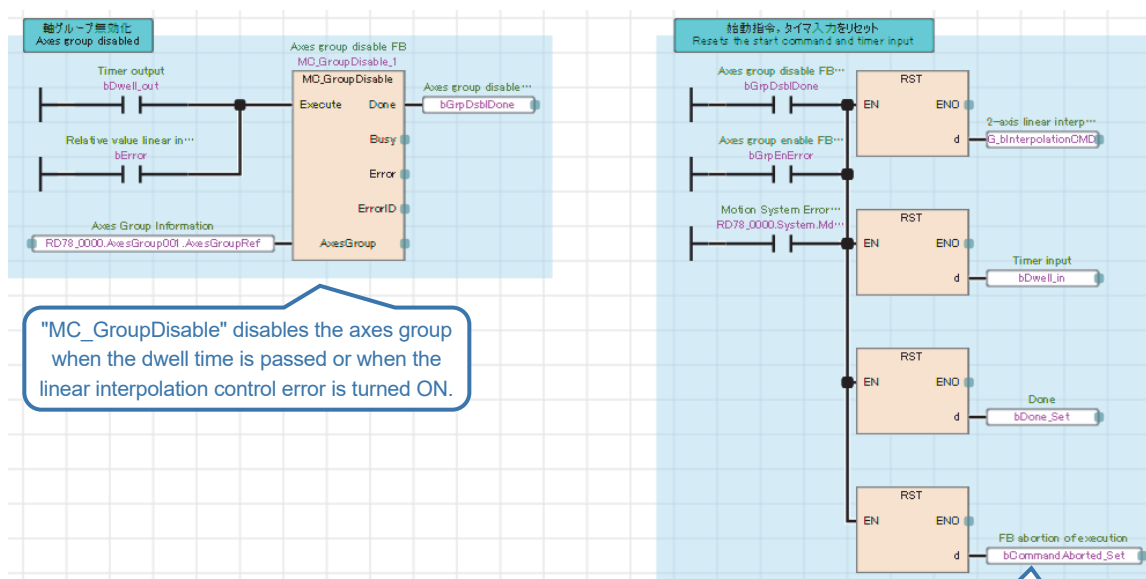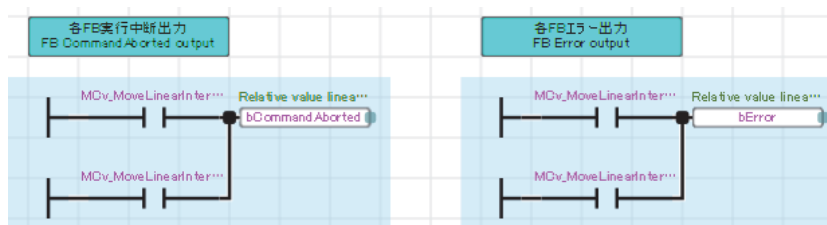


The labels are turned ON when the OR condition (CommandAborted and Error outputs of the two linear interpolation control FBs) is satisfied, which is used as an interlock condition or when releasing the self-holding circuit.

4.11 Synchronous Control (Program Name: Synchronous)

4.11.1 Procedures for executing synchronous control

The following shows the procedure flow for executing synchronous control.

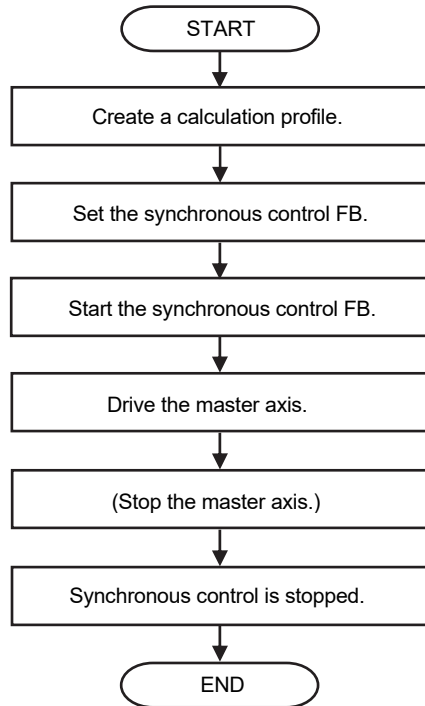


4.11.2 Calculation profile

Waveform data used for control is collectively called calculation profile data.
This section explains how to create a cam data.

(1) Creating a new calculation profile

In the navigation window of the motion control setting function, right-click "Calculation Profile" and select "Add New Data".

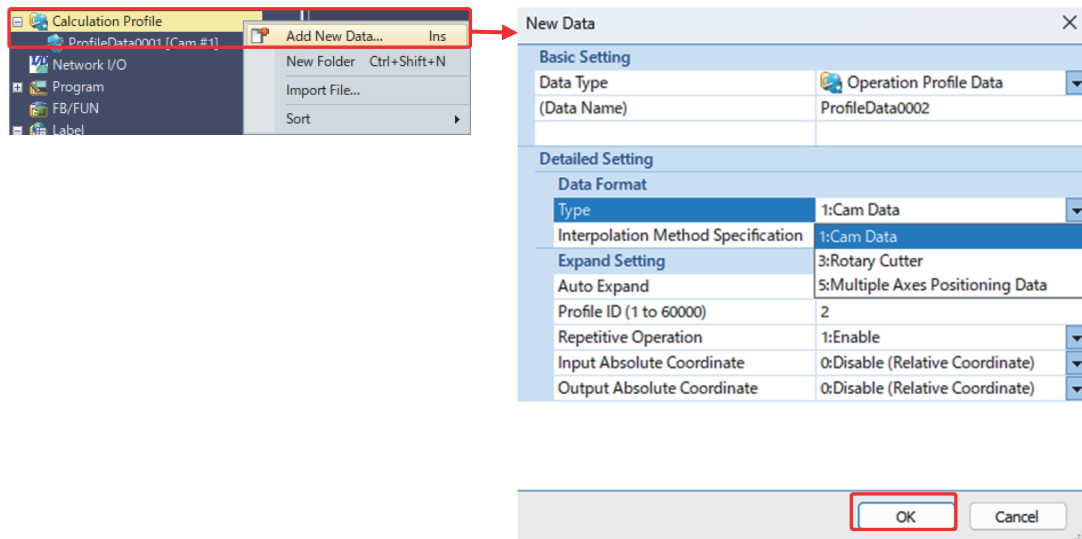

The following shows the setting items on the "New data" screen.

Item	Description
Automatic open	Yes: The calculation profile data is automatically opened at power-on. No: The open FB for calculation profile data needs to be executed.
Periodic	Invalid: The control ends when it executes until the end of calculation profile data. Valid: The execution of calculation profile data is continuously repeated.
Output absolute coordinate	Invalid (relative): When the calculation profile (cam) is started, an output value is calculated based on the current value. When executing a feed cam operation, select this setting. Valid (absolute): The output value at the time the calculation profile (cam) is started is calculated to be always the start point for one cycle of the calculation profile data. When the start point and the end point of the calculation profile data are different, the command is output in one operation cycle in order to return to the first output value at the next one cycle start.


The example in this document uses the initial value. Click the [OK] button.

[POINTS]

In motion control setting function version 1.042U or later, a "Multiple Axes Positioning Data" function has been added to the types of data format. The "Multiple Axes Positioning Data" function is supported by RD78G(H) with software version 28 or later.

(2) Creating a cam data

Set the calculation profile waveform.

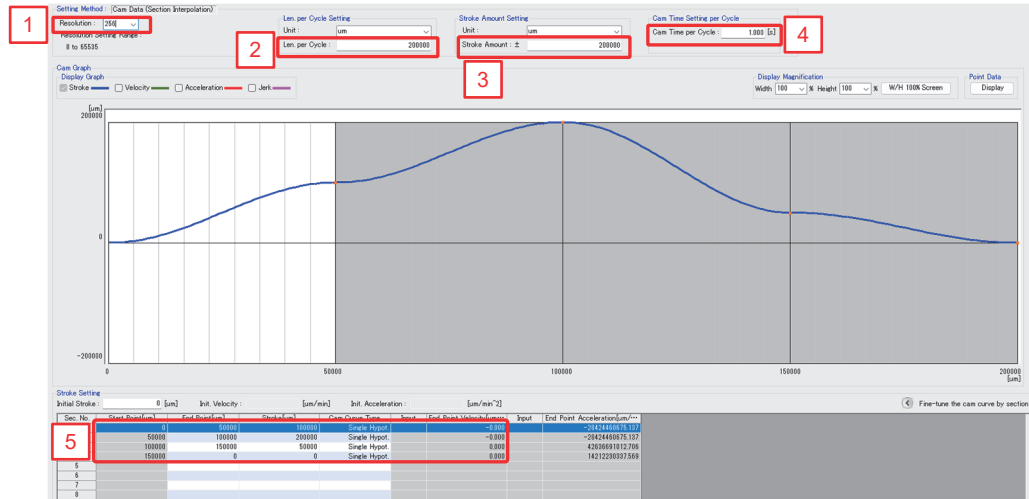

The following shows the necessary setting items.

No.	Item	Description
1	Resolution	Set the resolution of the cam data.
2	Length per Cycle	Set the length per cycle and its unit. (Set the movement amount of the master axis for one cam cycle)
3	Stroke Amount	Set the stroke amount and its unit. (Set the movement amount of the slave axis for one cam cycle)
4	Cam Time per Cycle	Set the time for one cam cycle. This setting is used when velocity, acceleration, and jerk are calculated.
5	Stroke Setting	Set the stroke.

The following shows the example settings.

No.	Item	Setting value
1	Resolution	256
2	Length per Cycle	200000 μm
3	Stroke Amount	200000 μm
4	Cam Time per Cycle	1.000
5	Stroke Setting	Refer to the following table.

Section No.	Start point	End point	Stroke	Cam curve type
1	0	50000	100000	Single hypotenuse
2	50000	100000	200000	Single hypotenuse
3	100000	150000	50000	Single hypotenuse
4	150000	0	0	Single hypotenuse

[POINTS]

When executing a linear cam operation (the same operation as the master axis, or the operation that changes the master axis speed based on a specified speed ratio), create a calculation profile for the linear cam, or use MC_GearIn.

The calculation profile data for the linear cam is not provided in the system.

4.11.3 Single axis synchronous control FBs


The single axis synchronous control FBs operate as software-based mechanical modules such as gears, speed change gears, and cams. These FBs transmit the position information (command) of Slave that is synchronized with Master.

(1) FBs

Type	Command	Description
MCFB (motion)	MC_CamIn (Cam Operation Start)	Executes cam operation.
	MC_GearIn (Gear Operation Start)	Executes gear operation based on the specified speed ratio between the master axis and the slave axis.
	MC_CombineAxes (Addition/Subtraction Positioning)	Combines motion of two axes by a selectable combination method, and outputs the result to the third axis.
	MCv_ChangeCycle (Current Value Change per Cycle)	Changes the cam current value per cycle to the specified value during MC_CamIn control. It is used to compensate the cam current value per cycle into an arbitrary value.
	MCv_BacklashCompensationFilter (Backlash Compensation Filter)	Executes the specific filter processing to the input of the main axis (Master), and outputs the result to the slave axis (Slave).
	MCv_SmoothingFilter (Smoothing Filter)	
	MCv_DirectionFilter (Moving Direction Restriction Filter)	
	MCv_SpeedLimitFilter (Speed Limit Filter)	
	MCv_AdvancedSync (Advanced Synchronous Control)	Starts synchronous control by following the specified advanced synchronous control settings.

4.11.4 Axes configuration


This chapter explains the following cam system.

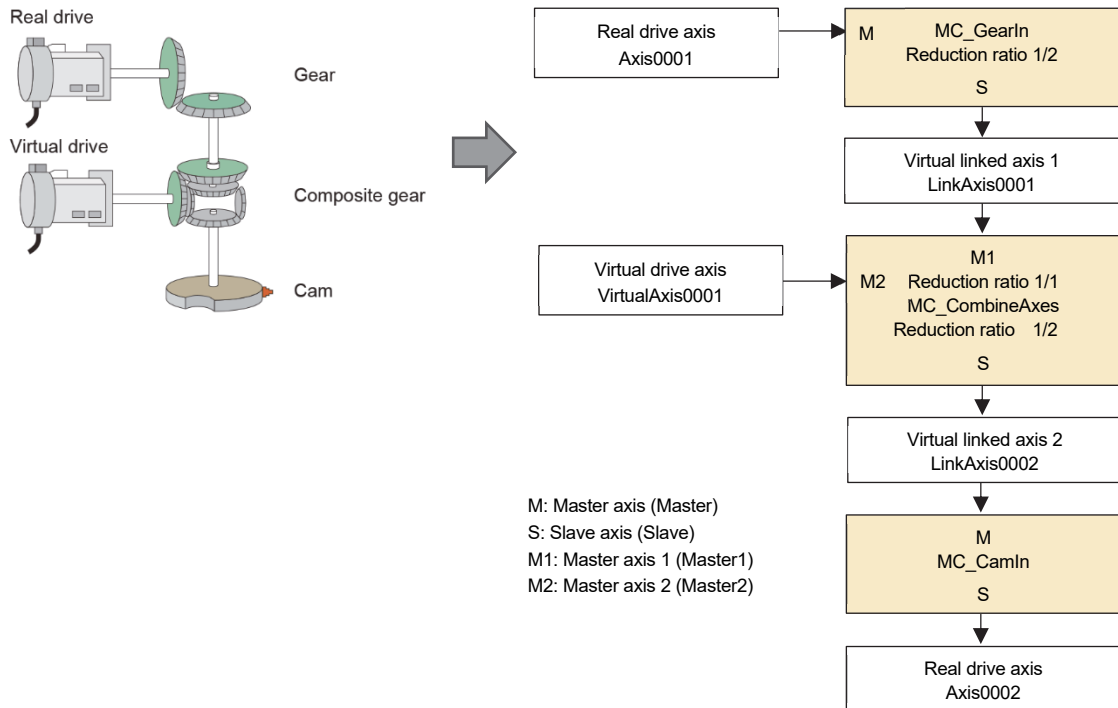

4.11.5 Program example

(1) Operation pattern

The X-axis moves from the origin point for 400000.0 [μm] while the Y-axis (Axis0002) is operated according to the cam pattern created in Section 4.11.2. When the X-axis reaches the target position (400000.0 [μm]), the virtual drive axis starts operation and the Y-axis repeats the cam operation. At this time, the X-axis is stopped and only the Y-axis is operated.

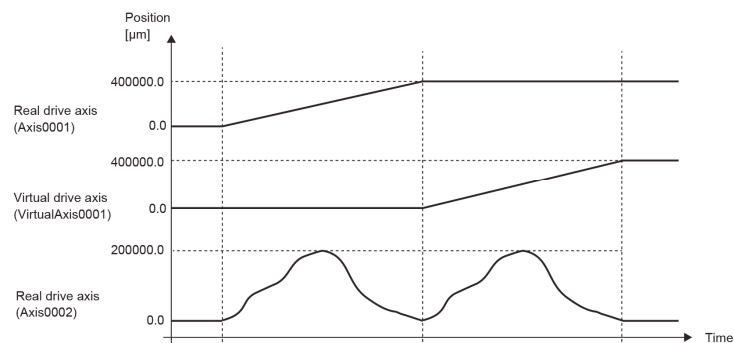

(2) Virtual drive axis and virtual linked axis

This program uses the virtual drive axis (VirtualAxis0001) and the virtual linked axes (LinkAxis0001, LinkAxis0002) in addition to the real drive axes (Axis0001, Axis0002). The AxisRef type structure is used in the PLC CPU module program that drives VirtualAxis and LinkAxis. Set each of the AxisRef structures to the public label setting. (Refer to Section 4.3.2.)

(3) Local labels

	Label Name	Data Type	English
1	MC_GearIn_1	MC_GearIn	...
2	MC_CombineAxes_1	MC_CombineAxes	...
3	MC_DamIn_1	MC_DamIn	...
4	MC_Stop_1	MC_Stop	...
5	MC_Stop_2	MC_Stop	...
6	MC_Stop_3	MC_Stop	...
7	leVelocity	FLOAT [Double Precision]	...
8	leAcceleration	FLOAT [Double Precision]	...
9	leDeceleration	FLOAT [Double Precision]	...
10	leJerk	FLOAT [Double Precision]	...
11	lePosition	FLOAT [Double Precision]	...
12	blnSync	Bit	...
13	MC_MoveRelative_1	MC_MoveRelative	...
14	bError	Bit	...
15	bDone1	Bit	...
16	MC_MoveRelative_2	MC_MoveRelative	...
17	bDone2	Bit	...
18	bStopDone	Bit	...
19	bSyncMove	Bit	...
20	bValueSet	Bit	...
21	bCommandAborted	Bit	...
22	CamID	MC_CAM_ID	...
23			

1) These labels are automatically added when the user drags and drops the corresponding FB to the program editor.

2) These labels are registered manually.


(Note): Registering MC_CAM_ID type structure

Click the [Library] tab in the element selection window, and select "Library" →

"MotionControl_RD78_****" → "Structured Data Type". Drag and drop "MC_CAM_ID" to

"Structured Data Types" under "Label" in the navigation window. The structure is registered

under the "Structured Data Types" tree and available as a data type on the label editor.

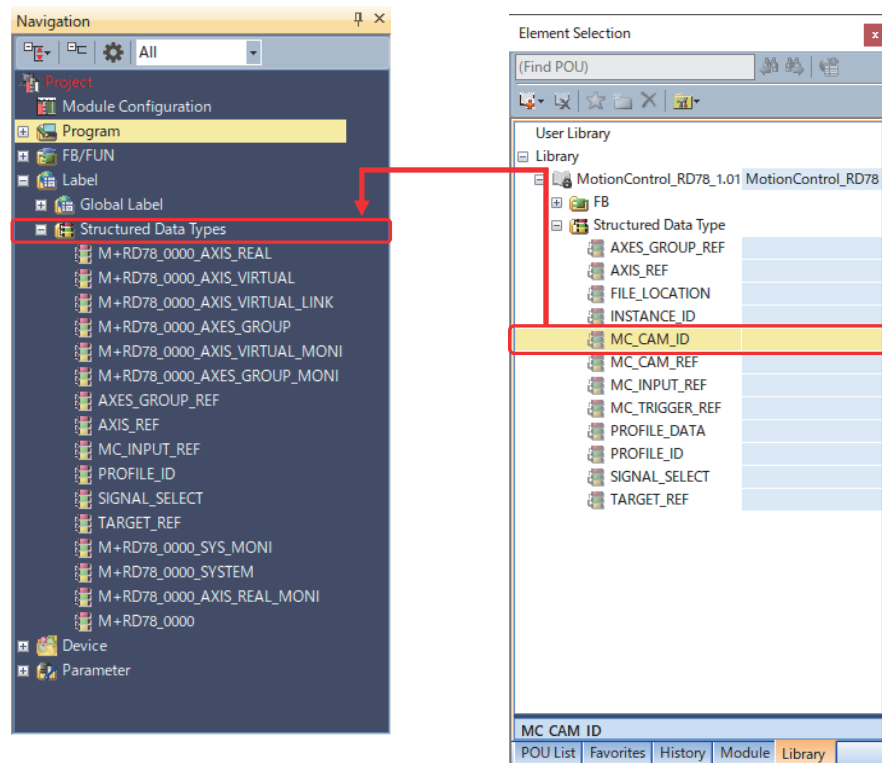

(4) Program example


When the synchronous control start is turned ON, each positioning data is stored to the specified label. When all the data is stored, the execution signal of the FB (MC_GearIn, MC_CombineAxes, and MC_CamIn) is kept ON by a self-holding circuit.

When the Axis0002 status is turned ON, Axis0001 master axis (Master) starts positioning. At this time, Axis0002 is operated according to the specified calculation profile. When positioning of Axis0001 is completed, the virtual drive axis (VirtualAxis0001) starts positioning. At this time, Axis0001 is stopped, but Axis0002 is operated according to the specified calculation profile. The synchronous control is stopped by executing MC_Stop on the real drive axis (Axis0002) and the virtual linked axes (LinkAxis0001 and LinkAxis0002) when any of the following conditions is satisfied: the positioning of the virtual drive axis (VirtualAxis0001) is completed; an error occurs; or the execution is aborted. The start signal is reset when the real drive axis (Axis0002) status is out of synchronization.

The interlock conditions are added to prevent execution of the synchronous control while other programs are running or when a system error occurs.


[Start signal]

Synchronous control start	G_bSyncCMD
---------------------------	------------



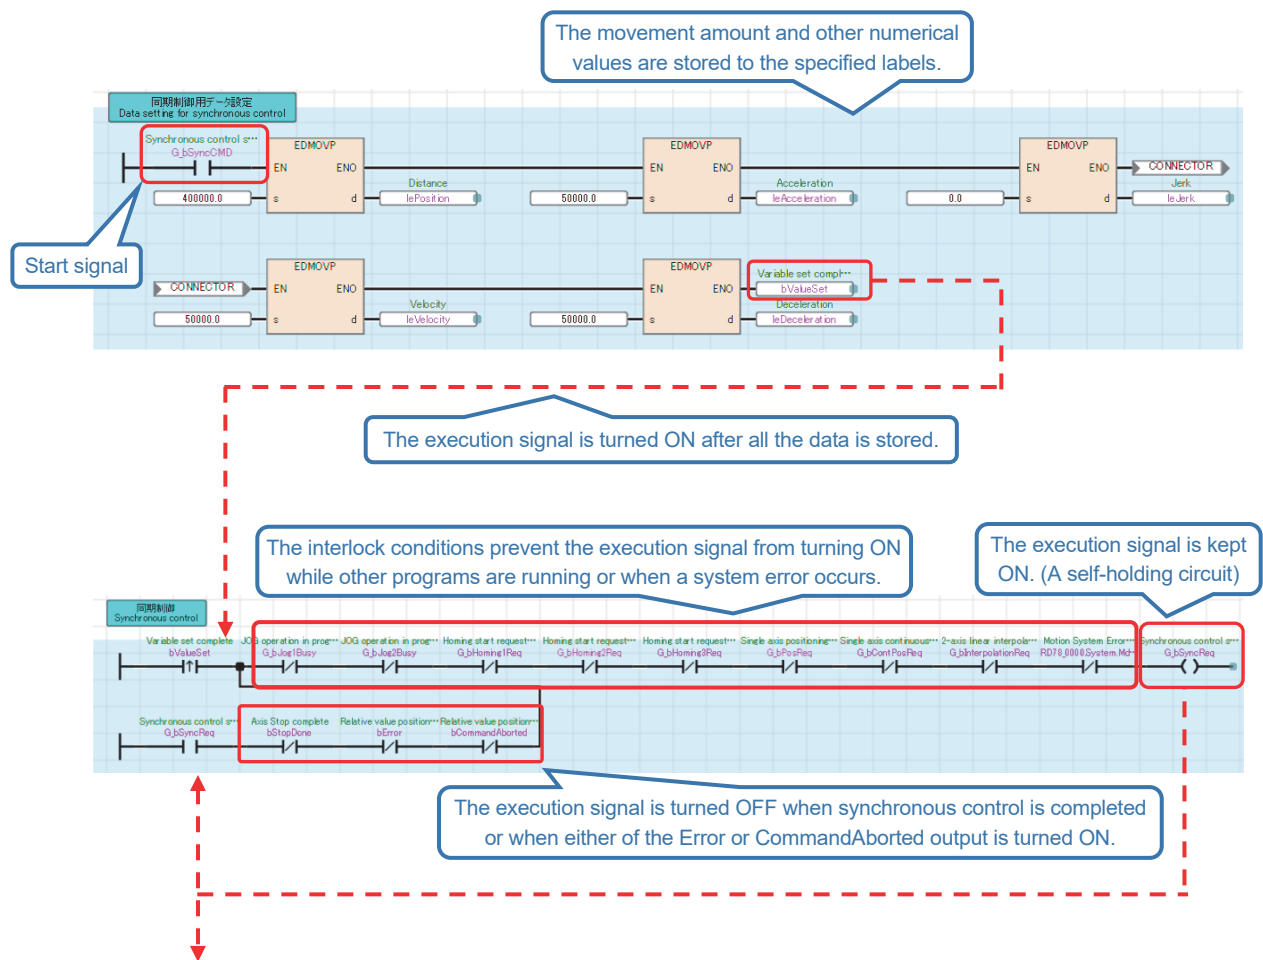


(To the next page)

(Continued)


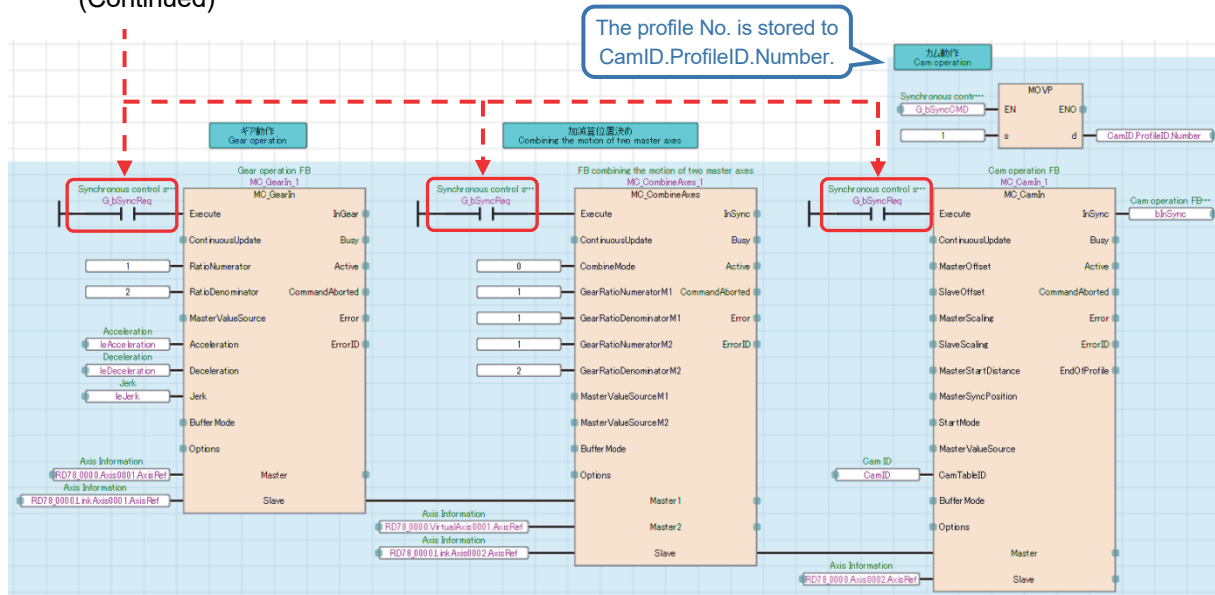


Axis0001 executes positioning when the status of Axis0002 turns to "7: SynchronizedMotion".

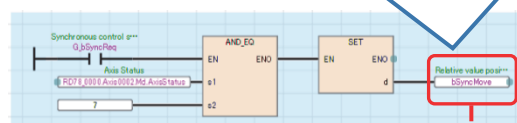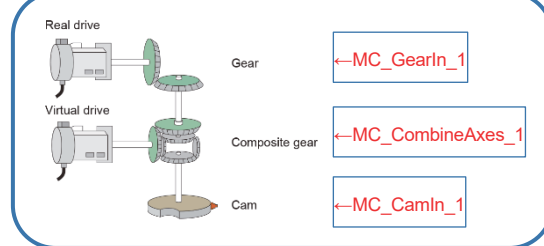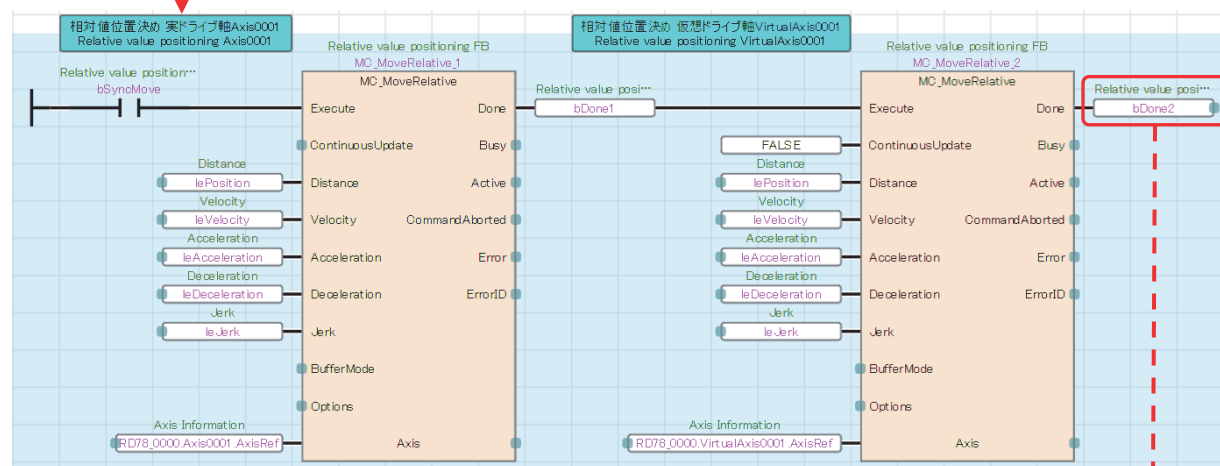

(To the next page)

(Continued)

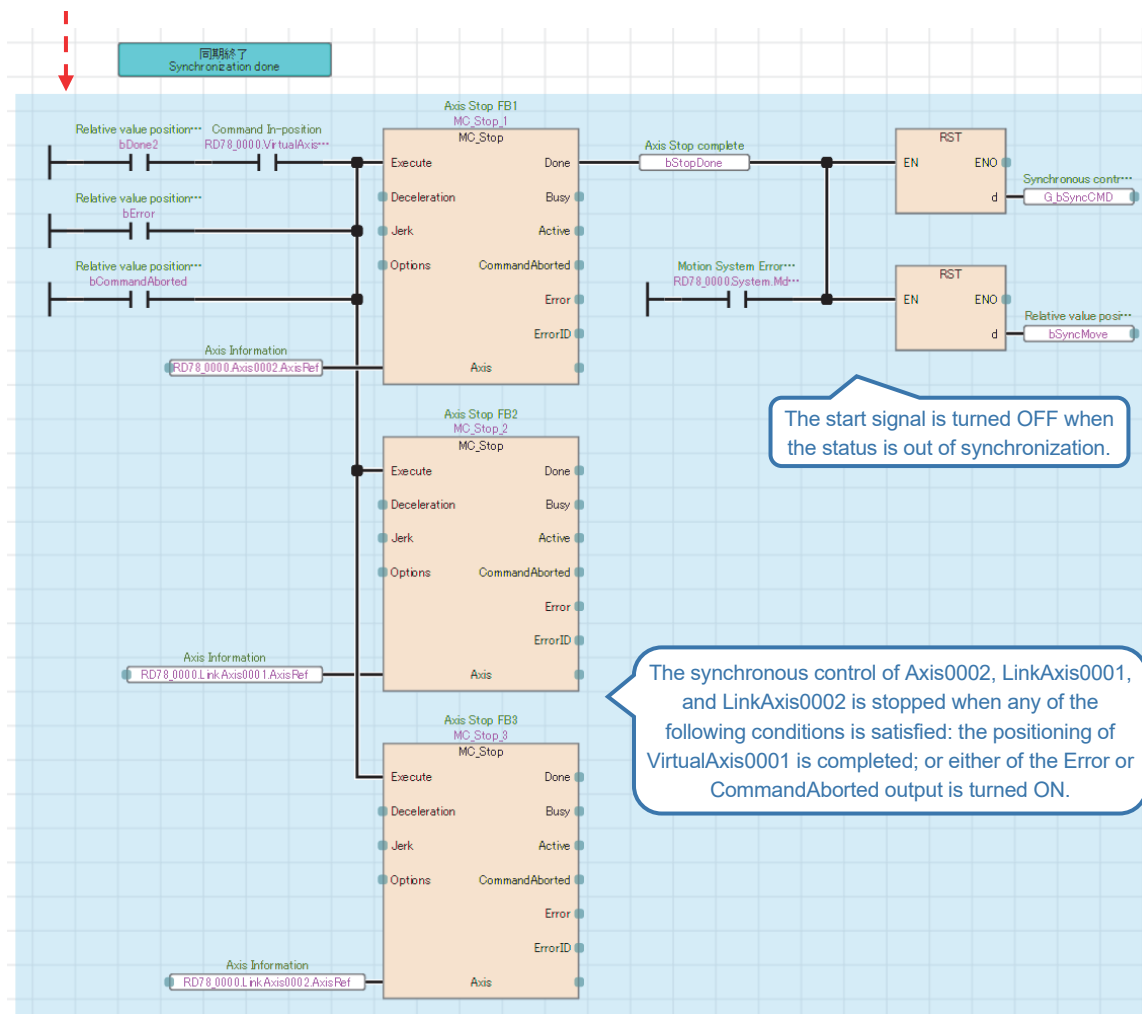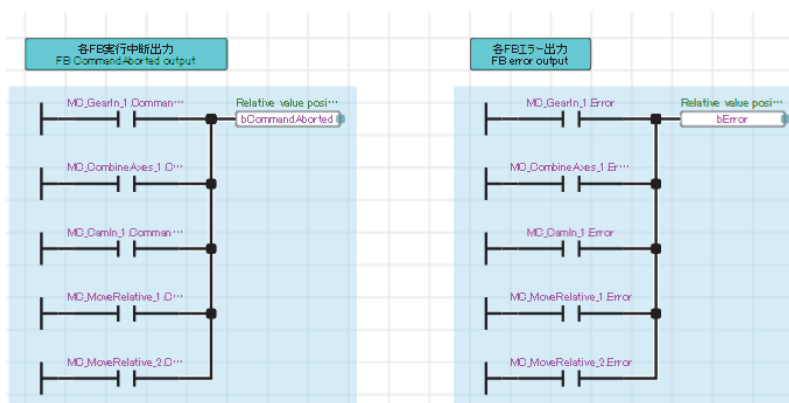

The labels are turned ON when the OR condition (the CommandAborted and Error outputs of the synchronous control FBs and the positioning FBs) is satisfied, which is used as an interlock condition or when releasing the self-holding circuit.

4.12 Error Reset (Program Name: ErrorReset)

This program resets the error on each axis.

(1) FBs

Type	Command	Description
MCFB (administrative)	MC_Reset	Resets errors and warnings of the axis.
	MC_GroupReset	Resets errors and warnings of the axes group.
	MCv_MotionErrorReset	Reset all errors and warnings of the motion system.

(2) Program example

The following shows the program example for error reset.

When the error reset label is turned ON, MC_Reset and MC_GroupReset are executed.



When the system error reset label is turned ON, MCv_MotionErrorReset is executed.



4.13 Checking Operation

4.13.1 Conversion and Writing of Programs

Write the program to the PLC CPU module. In MELSOFT GX Works3, select [Convert] → [Rebuild All] to convert all the program.

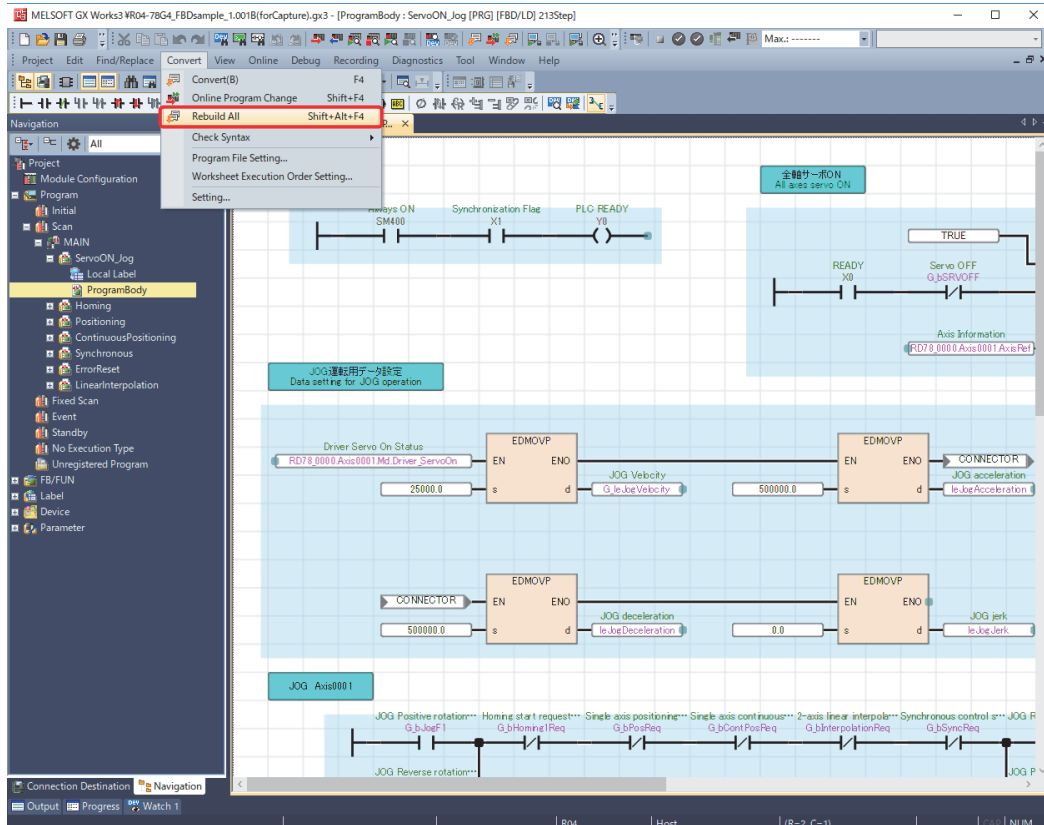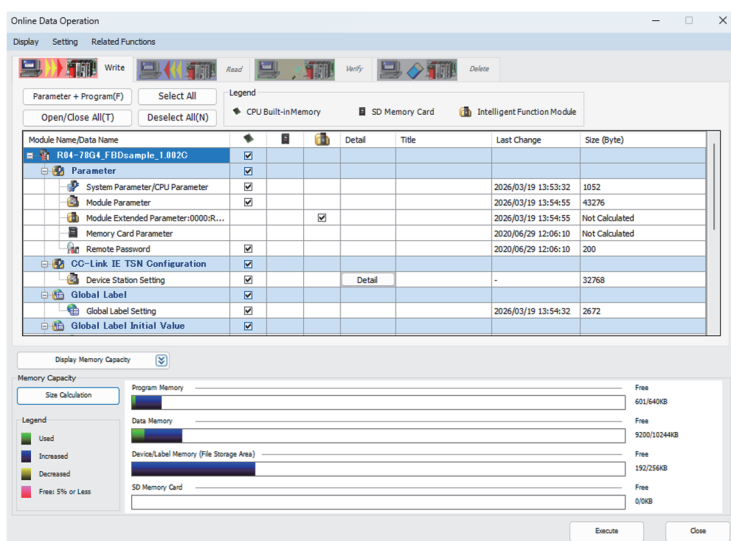


4.13.2 Axis monitor

The monitor screen displays the current values and the error codes of all axes in operation all at once. Users can check the current values and whether any error occurs during the operation.


(1) Displaying monitor screens

The monitor screen can be displayed by the following two methods.

- 1) Select [Tool] → [Drive Tool List] in MELSOFT GX Works3, and double-click "Monitor" on the "Drive Tool List" screen. Select the Motion module on the "Module Selection (Monitor)" screen, and click the [OK] button.

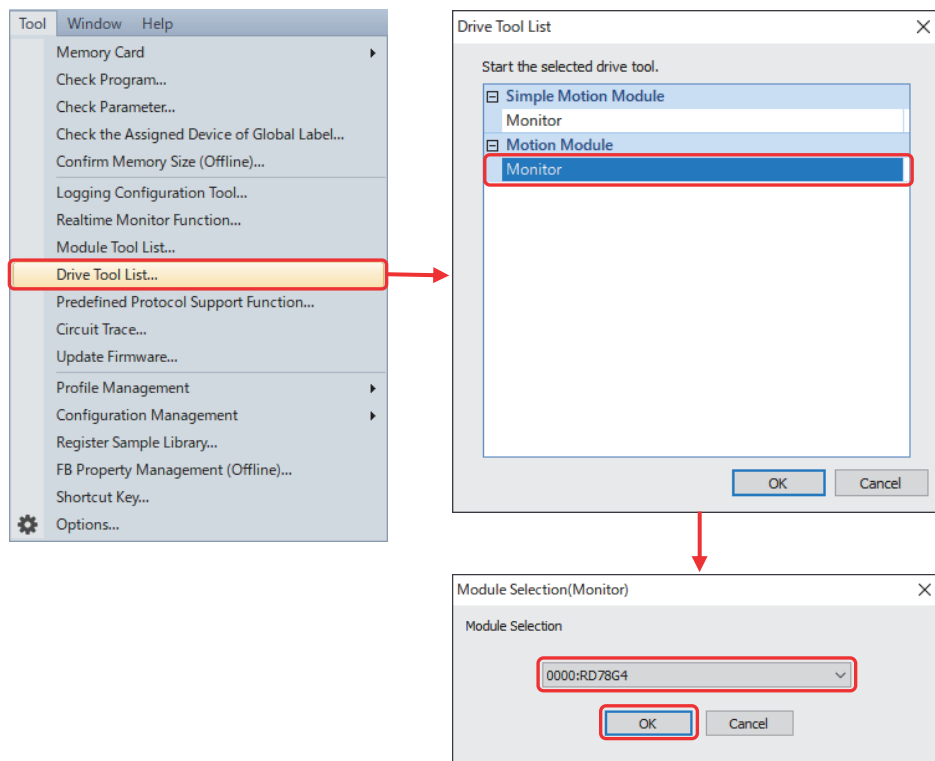

- 2) In the motion control setting function, select [Online] → [Motion Monitor] → [Axis Monitor].

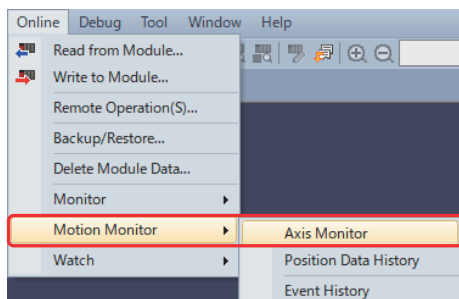

(2) Monitor screen

The screenshot shows the 'Axis Monitor' and 'System Monitor' windows. The 'Axis Monitor' window displays a table of data for two axes, with callouts 1 through 5 highlighting specific features. The 'System Monitor' window displays system status and error codes, with callout 2 highlighting the 'Monitor Item Selection' button.

Axis Monitor Data Table:

	Axis #1	Axis #2
Axis Name	Axis0001	Axis0002
Axis Status	4:Standstill	4:Standstill
Control Cycle	1	1
Position Command Unit Display	μm	μm
Velocity Command Unit Display	μm/s	μm/s
Set Position	6.85743987560272 ...	8.15823674201965 ...
Actual Position	6.85542869567871 ...	8.15838623046875 ...
Commanded Position	0.0 μm	0.0 μm
Set Velocity	0.0 μm/s	0.0 μm/s
Actual Velocity	-2.45869159698486...	-7.52508640289307...
Commanded Velocity	0.0 μm/s	0.0 μm/s
Negative Direction Velocity Limit Value	2500000000.0 μm/s	2500000000.0 μm/s
Positive Direction Velocity Limit Value	2500000000.0 μm/s	2500000000.0 μm/s
Automatically Decelerating	FALSE	FALSE
Command In-position	FALSE	FALSE
Negative Direction Torque Limit Value	300.0 %	300.0 %
Positive Direction Torque Limit Value	300.0 %	300.0 %
Execution Profile ID No.	0	0
Homing Completed	FALSE	FALSE
Homing Request	TRUE	TRUE
Start Permission at Homing Uncompleted	FALSE	FALSE
Upper Limit Signal Status	FALSE	FALSE
Lower Limit Signal Status	FALSE	FALSE
Forced Stop Cancelling	TRUE	TRUE
Axis Error Detection	FALSE	FALSE
Axis Error Code	0000	0000
Axis Warning Detection	FALSE	FALSE
Axis Warning Code	0000	0000
Driver Ready On Status	TRUE	TRUE
Driver Servo On Status	TRUE	TRUE

System Monitor Data Table:

PLC Ready	
Ready	
Synchronization flag	
System Basic Cycle Monitor.Processing Time	3920 ns
System Basic Cycle Monitor.Maximum Processi...	5280 ns
System Basic Cycle Monitor.Setting Cycle	1000000 ns
System Basic Cycle Monitor.Cycle Over	
Operation Cycle Monitor[1].Processing Time	56680 ns
Operation Cycle Monitor[1].Maximum Processi...	69960 ns
Operation Cycle Monitor[1].Setting Cycle	1000000 ns
Operation Cycle Monitor[1].Cycle Over	
Forced Stop Cancelling	
Motion Area System Error Detection	
Latest Motion Area System Error Code	0000
Motion Area System Warning Detection	
Latest Motion Area System Warning Code	0000
Network Area Error Detection	
Network Area Error Code	0000
Basic System Software Version	40
Boot Software Version	19
Network Boot Software Version	19

No.	Description
1	The monitor items for each axis are displayed.
2	The system monitor items are displayed.
3	The axis type to be monitored can be changed.
4	The monitor items can be added/deleted.
5	The monitor type can be split to display split screens.


4.13.3 Program monitor

The program monitor enables the user to check the current status of the program in execution on the program editor.

(1) Displaying monitor screen

Select [Online] → [Monitor] → [Start Monitoring (All Windows)], or click the icon [] on the tool bar.

(2) Monitor screen

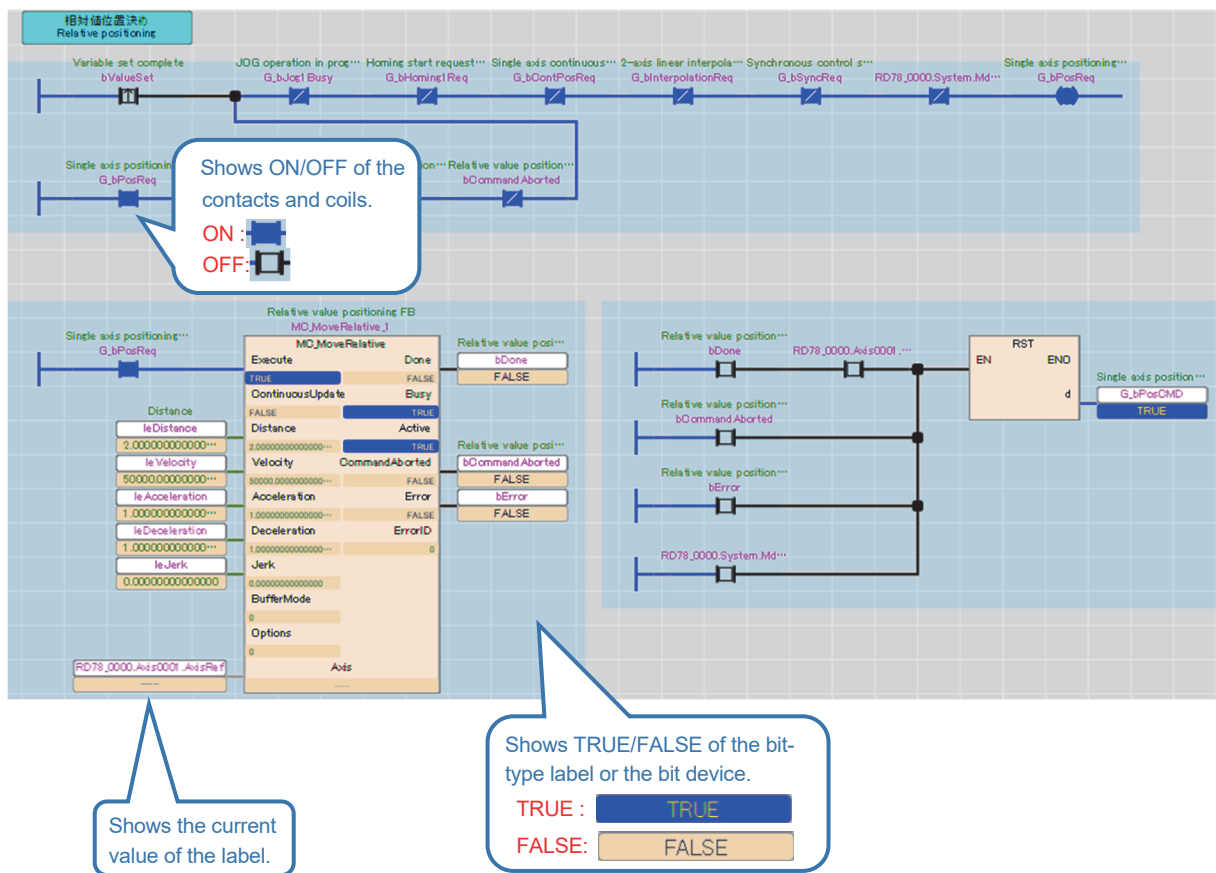


4.13.4 Watch

The watch function enables the user to check the current values of the registered devices and labels. Register the devices and labels to be monitored to a watch window.


(1) Displaying monitor screens

Select [View] → [Docking Window] → [Watch 1 to Watch 4] in MELSOFT GX Works3.

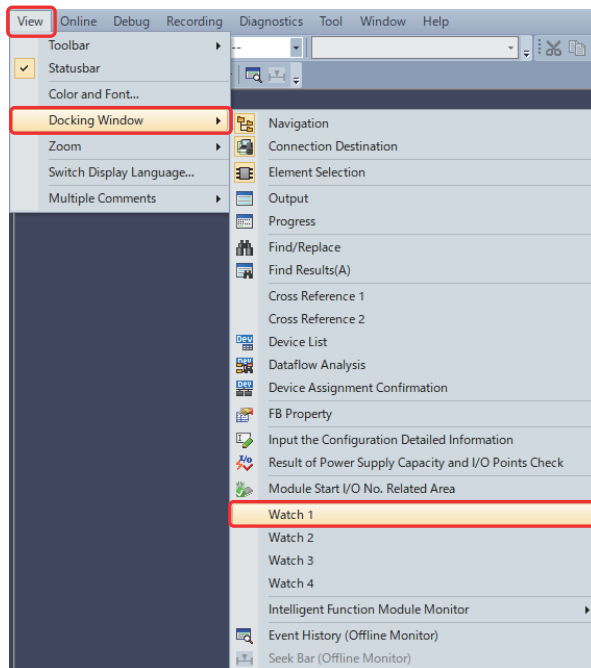

(2) Registration of devices/labels/structures to a watch window

Enter the device No./label/structure to be registered in the "Name" column of a watch window or right-click a label or a structure to be registered on the program editor, and select [Register to Watch Window] → [Watch 1 to 4].

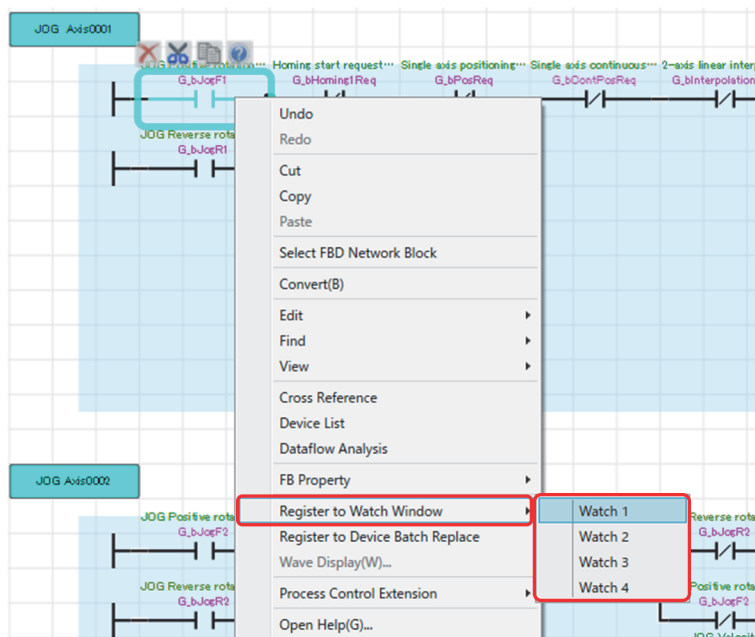


(3) Monitoring start

Select [Online] → [Watch] → [Start Watching] in MELSOFT GX Works3.

(4) Changing current values

Directly enter a value in "Current Value" during monitoring.

The bit device can be switched to ON/OFF with double-click while holding the [Shift] key or with [Shift] + [Enter] after selecting the row.

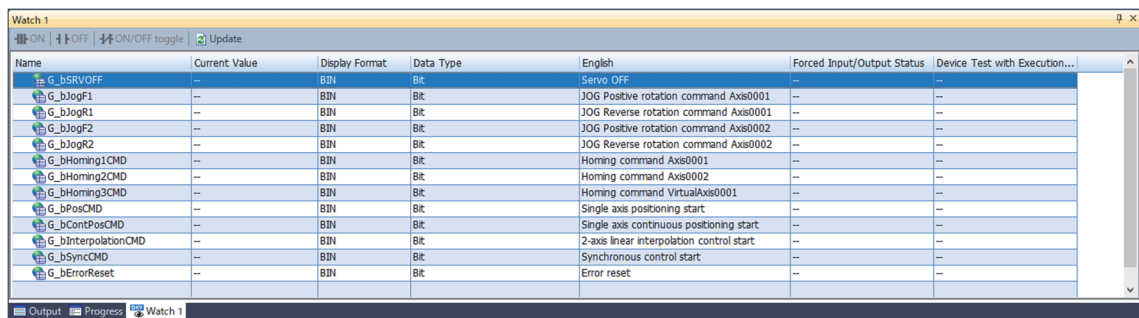

Name	Current Value	Display Format	Data Type	English	Forced Input/Output Status	Device Test with Execution...
G_bSRV/OFF	--	BIN	Bit	Servo Off	--	--
G_bJogF1	--	BIN	Bit	JOG Positive rotation command Axis0001	--	--
G_bJogR1	--	BIN	Bit	JOG Reverse rotation command Axis0001	--	--
G_bJogF2	--	BIN	Bit	JOG Positive rotation command Axis0002	--	--
G_bJogR2	--	BIN	Bit	JOG Reverse rotation command Axis0002	--	--
G_bHoming1CMD	--	BIN	Bit	Homing command Axis0001	--	--
G_bHoming2CMD	--	BIN	Bit	Homing command Axis0002	--	--
G_bHoming3CMD	--	BIN	Bit	Homing command VirtualAxis0001	--	--
G_bPosCMD	--	BIN	Bit	Single axis positioning start	--	--
G_bContPosCMD	--	BIN	Bit	Single axis continuous positioning start	--	--
G_bInterpolationCMD	--	BIN	Bit	2-axis linear interpolation control start	--	--
G_bSyncCMD	--	BIN	Bit	Synchronous control start	--	--
G_bErrorReset	--	BIN	Bit	Error reset	--	--

[POINTS]

In the sample program, "RD78_0000.G_bStopSignalX" and "RD78_0000.G_bStopSignalY" are registered in the watch window 1. Turning these signals ON aborts the operation.

4.13.5 Event History

The event history of the Motion module can be checked from [Online] → [Motion Monitor] → [Event History] in the motion control setting function.

If an error occurs, check the details of the error.

The error occurrence time in the event history of the Motion module synchronizes with those recorded in the servo amplifiers. Check the error details of the event history together with the data in the servo amplifier.

Event History - [0000:RD78G4]

Refresh(U) Number of Events:158 Refine(D)

Events to Exclude

Refine

☒ Match All the Conditions ☐ Match Any One of the Conditions

1. Event Type Including Next

2.

3.

☐ Include program errors (Allow jumping)

Start Refine Clear Refine Conditions

No.	Occurrence Date	Event Type	Status	Event Code	Overview
00001	2020/09/07 07:33:19.402538560	System		007F0	MCFB Start (Control System)
00002	2020/09/07 07:33:19.391777656	System		007EE	Servo System Recorder Start
00003	2020/09/07 07:33:19.289555680	System		007FE	Homing Request OFF to ON
00004	2020/09/07 07:33:19.289115064	System		007FD	Current Position Restoration Completion
00005	2020/09/07 07:33:19.289032336	System		007FD	Current Position Restoration Completion
00006	2020/09/07 07:33:19.288934016	System		007FD	Current Position Restoration Completion
00007	2020/09/04 08:46:03.947703512	System		007F0	MCFB Start (Control System)

Legend Major Moderate Minor Warning Information

Jump Clear All

Detailed Information	MCFB Start/Stop Information	-	-
Detail Code :0 FB Type :MCv_AllPower FB Instance ID :45430288 Instance Name :MCv_AllPower		-	-
Cause	MCFB was started.		
Corrective Action	-		

Create File... Close


To check the event history of the PLC CPU module, click [Diagnosis] → [System monitor] in MELSOFT GX Works3, and click "Event history" on the "System monitor" screen.

[illegible]

5. PROGRAMMING BY A PLC CPU MODULE AND THE MOTION MODULE

This chapter explains programming by a PLC CPU module and the Motion module.
To obtain the sample program used in this chapter, contact your local sales office.

- File name: **R04-78G4_ STsample_*****.gx3** (**** indicates the version)

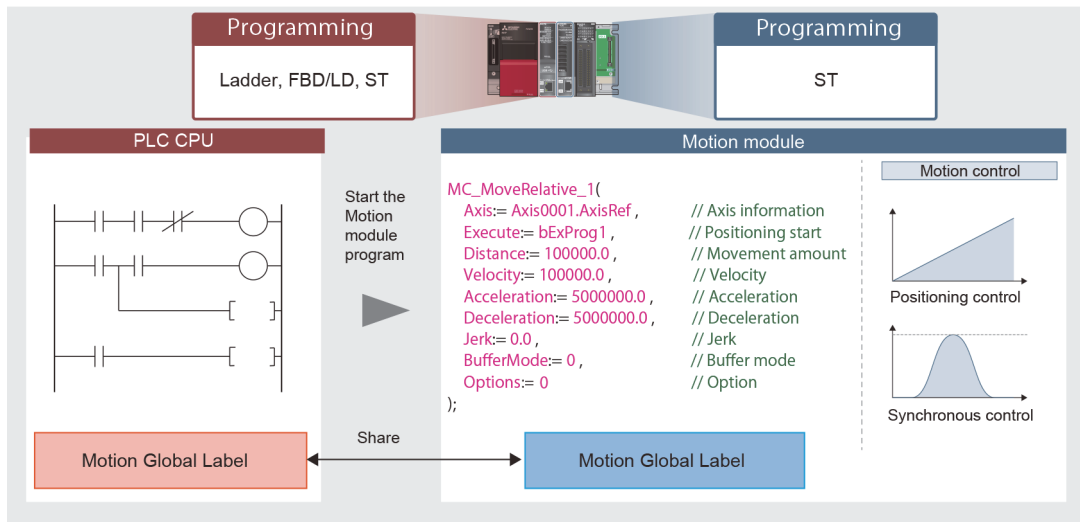

[POINTS]

When applying the sample program to an actual system, ensure the applicability and confirm that it will not cause system control problems.


Consider and add interlock conditions according to the user's system.

5.1 Programming Procedure for Motion Module


The motion control setting function is used to create a program for the Motion module.

5.1.1 Creating a program block

- 1) In the navigation window of the motion control setting function, right-click an execution type ("Normal" in this example) under "Program", and click "Add New Data".
- 2) On the "New Data" screen, set the data name. Only alphanumeric characters can be used to for the data name.

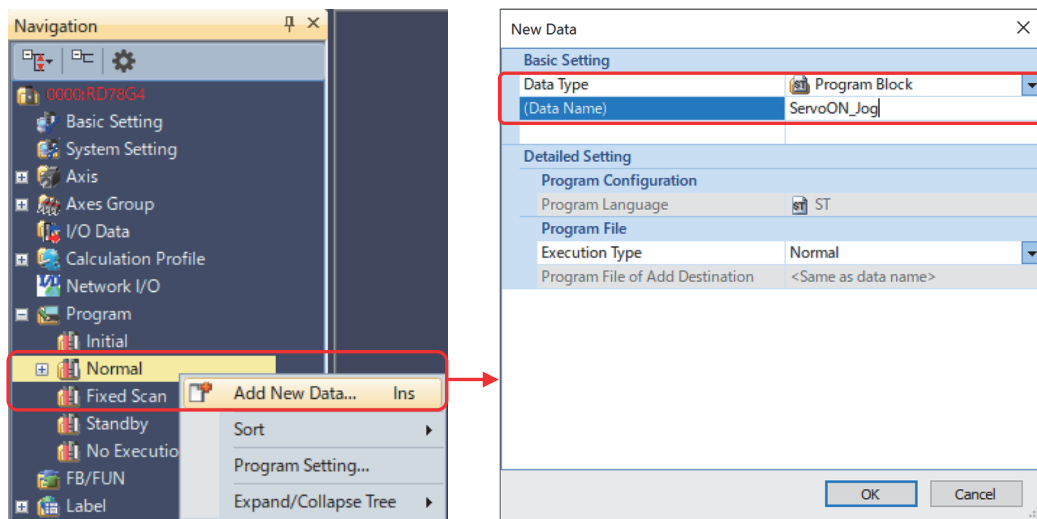

- 3) A program block is added to the navigation window.

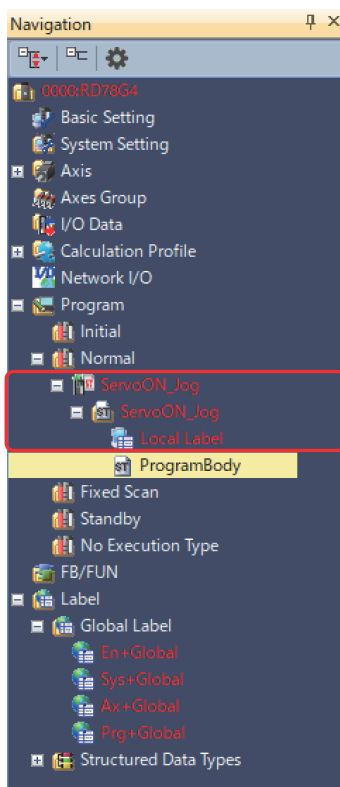

5.1.2 Program execution type

There are following four execution types.

Execution type	Description
0: Standby	This type of program is executed only when its execution is requested. The program is executed after converted to a normal execution type program by using a PSCAN instruction from another running program.
1: Normal	This type of program is executed by normal task of the motion system.
2: Initial	This type of program is executed only once when PLC READY [Y0] changes from OFF to ON.
3: Fixed scan	This type of program is executed at each specified time. (The first operation cycle: 62.5 [us] ^(Note-1) to 6000 [ms]) Note that the time shorter than the operation cycle cannot be set.

(Note-1): "us" indicates microsecond.

To set the execution type, drag and drop the program block onto the target execution type, or change the type from "Basic Setting" → "Program Execution Setting".

Execution Order	Program Name	Execution Type	Program Execution Condition	Fixed Scan Interval Setting
1	ServoON Jog	1:Normal		
2		0:Standby		
3		1:Normal		
4		2:Initial		
5		3:Fixed Scan		
6				

5.1.3 Inputting a FB

This section explains the procedure for setting the following JOG operation FB (MCv_Jog). The sample program adds some interlock conditions and public label settings to this program.

```

1 ;MCv_Jog_1(
2   Axis:= ?AXIS_REF? ,
3   JogForward:= ?BQOL? ,
4   JogBackward:= ?BQOL? ,
5   Velocity:= ?LREAL? ,
6   Acceleration:= ?LREAL? ,
7   Deceleration:= ?LREAL? ,
8   Jerk:= ?LREAL? ,
9   Options:= ?DWORD? ,
10  Done=> ?BQOL? ,
11  Busy=> ?BQOL? ,
12  Active=> ?BQOL? ,
13  CommandAborted=> ?BQOL? ,
14  Error=> ?BQOL? ,
15  ErrorID=> ?WORD?
16 );

```

(1) Preparing labels

Prepare labels for input/output signals of the FB. This example uses labels for the Velocity, Acceleration, Deceleration, and Jerk inputs of MCv_Jog. When registering a new label, consider whether the label is registered as a global or a local label.

In this example, the labels for JOG command, JOG signal during operation, and JOG velocity are registered as a global label, considering the JOG velocity is operated from an external device, such as GOT (HMI). The labels for JOG acceleration, JOG deceleration, and JOG jerk are as local labels of ServoON_Jog (refer to Section 5.1.1) since these labels are used only within the program. Refer to Section 5.2 for naming rules of labels.

[Global label]


Global [Global Label Setting]							
<Filter>		Easy Display	Display Setting	Check			
Label Name	Data Type	Class	Assign (Device/Label)	Initial Value	Constant	English	
1 G_ServoOFF	Bit	VAR_GLOBAL				Servo OFF	
2 G_JogF1	Bit	VAR_GLOBAL				JOG Positive rotation command Axis0001	
3 G_JogR1	Bit	VAR_GLOBAL				JOG Reverse rotation command Axis0001	

[Local label]

ServoON_Jog [PRG] [Local Label Setting]							
<Filter>		Easy Display	Display Setting	Check			
Label Name	Data Type	Class	Assign (Device/Label)	Initial Value	Constant	English	
1 MCv_AllPower_I	MCv_AllPower	VAR				All axes servo ON FB	
2 MCv_Jog1	MCv_Jog	VAR				JOG operation FB Axis0001	
3 MCv_Jog2	MCv_Jog	VAR				JOG operation FB Axis0002	
4 lJogAcceleration	FLOAT [Double Precision]	VAR				JOG acceleration	
5 lJogDeceleration	FLOAT [Double Precision]	VAR				JOG deceleration	
6 lJogJerk	FLOAT [Double Precision]	VAR				JOG jerk	

(2) Inputting a FB


Drag and drop "MCv_Jog" under "Operation-Individual" tree on the [POU list] tab of the element selection window.

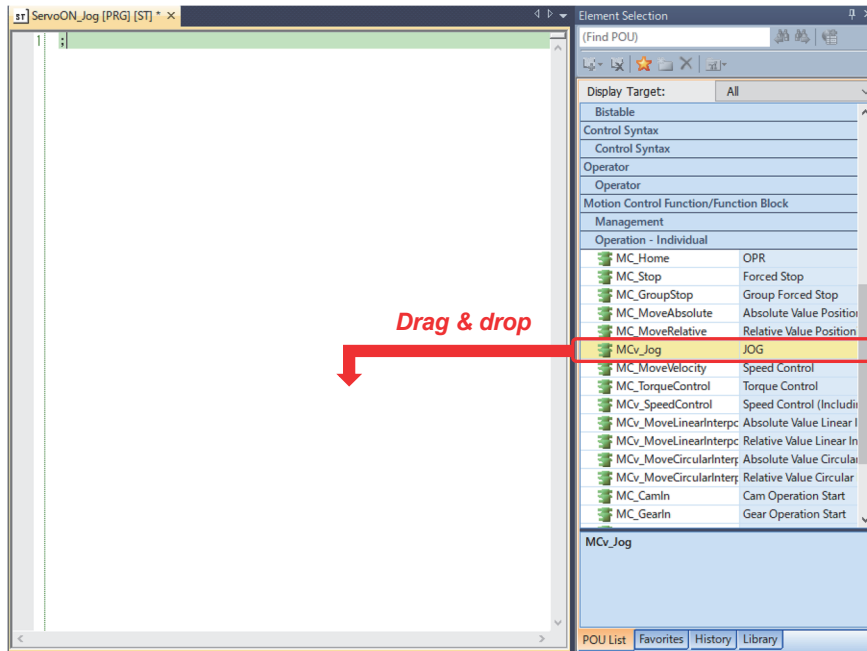

Motion module FBs are categorized in the following three groups.

Group	Description
Management (administrative FB)	A motion control FB that takes an axis or an axes group for the argument and does not change the axis status or the axes group status by execution
Operation-Individual (motion FB)	A motion control FB that takes an axis or an axes group for the argument and changes the axis status or the axes status by execution
StandardFB (general FB)	A motion control FB that does not take an axis or an axes group for the argument

When an undefined label is entered, the "Undefined Label Registration" screen appears. Enter the label name, the registered destination, and, if necessary, the comment. This example uses the initial settings.

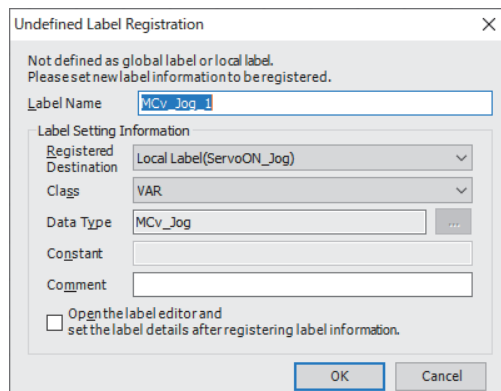

Users can break a line or adjust indents of a FB.

The following program example breaks the line at every I/O signal and adds indents as follows.

```

1  MCv_Jog_1(
2      Axis:= ?AXIS_REF? ,
3      JogForward:= ?BOOL? ,
4      JogBackward:= ?BOOL? ,
5      Velocity:= ?LREAL? ,
6      Acceleration:= ?LREAL? ,
7      Deceleration:= ?LREAL? ,
8      Jerk:= ?LREAL? ,
9      Options:= ?DWORD? ,
10     Done=> ?BOOL? ,
11     Busy=> ?BOOL? ,
12     Active=> ?BOOL? ,
13     CommandAborted=> ?BOOL? ,
14     Error=> ?BOOL? ,
15     ErrorID=> ?WORD?
16 );
17

```

(3) Inputting I/O signals

Enter labels for the undefined variables which display ?AXIS_REF?, ?BOOL?, etc.

(a) AxisRef type structure

The following describes how to input AxisRef type structure (axis information) of the axis 1 in the input variable of "Axis".

- 1) When entering "ax" instead of ?AXIS_REF?, the registered labels are displayed as a suggestion.

- 2) Select Axis0001 and enter ".". Then, the suggestions of the structure member for Axis0001 are displayed.

```

1 | MCV_Jog_1(
2 |   Axis:= Axis0001.
3 |   JogForward:= ?BOOL,
4 |   JogBackward:= ?BOOL,
5 |   Velocity:= ?LREAL,
6 |   Acceleration:= ?LREAL,
7 |   Deceleration:= ?LREAL,
8 |   Jerk:= ?LREAL,
9 |   Options:= ?DWORD,
10 |   Done=> ?BOOL,
11 |   Busy=> ?BOOL,
12 |   Active=> ?BOOL,
13 |   CommandAborted=> ?BOOL,
14 |   Error=> ?BOOL,
15 |   ErrorID=> ?WORD,
16 | );

```

AxisRef	AXIS_REF	Axis Information
Cd	AXIS_REAL_CMD	Axis Control Data
Md	AXIS_REAL_MONI	Axis Monitor Data
Pr	AXIS_REAL_PRM	Axis Parameter
PrConst	AXIS_REAL_PRM_CONST	Axis Parameter Constant

[Setting...](#)

- 3) Select "AxisRef".

```

1 | MCV_Jog_1(
2 |   Axis:= Axis0001.AxisRef,
3 |   JogForward:= ?BOOL,
4 |   JogBackward:= ?BOOL,
5 |   Velocity:= ?LREAL,
6 |   Acceleration:= ?LREAL,
7 |   Deceleration:= ?LREAL,
8 |   Jerk:= ?LREAL,
9 |   Options:= ?DWORD,
10 |   Done=> ?BOOL,
11 |   Busy=> ?BOOL,
12 |   Active=> ?BOOL,
13 |   CommandAborted=> ?BOOL,
14 |   Error=> ?BOOL,
15 |   ErrorID=> ?WORD,
16 | );

```

(b) Global and local labels

- 1) Enter G_bJogF1CMD (global label) for the JogForward input.

When entering "G_b" instead of ?BOOL?, the registered labels are displayed as a suggestion.

```

1 | MCV_Jog_1(
2 |   Axis:= Axis0001.AxisRef,
3 |   JogForward:= G_b,
4 |   JogBackward:= ?BOOL,
5 |   Velocity:= ?LREAL,
6 |   Acceleration:= ?LREAL,
7 |   Deceleration:= ?LREAL,
8 |   Jerk:= ?LREAL,
9 |   Options:= ?DWORD,
10 |   Done=> ?BOOL,
11 |   Busy=> ?BOOL,
12 |   Active=> ?BOOL,
13 |   CommandAborted=> ?BOOL,
14 |   Error=> ?BOOL,
15 |   ErrorID=> ?WORD,
16 | );

```

G_bJog1Busy	BOOL JOG運転中 Axis0001 / JOG operation...
G_bJogF1CMD	BOOL JOG正転指令 Axis0001 / JOG Positiv...
G_bJogR1CMD	BOOL JOG逆転指令 Axis0001 / JOG Rever...

[Setting...](#)

2) Select "G_bJogF1CMD".

```

1| MCv_Jog_1(
2|   _Axis:= Axis0001.AxisRef ,
3|   JogForward:= G_bJogF1CMD ,
4|   JogBackward:= ?BOOL? ,
5|   Velocity:= ?LREAL? ,
6|   Acceleration:= ?LREAL? ,
7|   Deceleration:= ?LREAL? ,
8|   Jerk:= ?LREAL? ,
9|   Options:= ?DWORD? ,
10|   Done=> ?BOOL? ,
11|   Busy=> ?BOOL? ,
12|   Active=> ?BOOL? ,
13|   CommandAborted=> ?BOOL? ,
14|   Error=> ?BOOL? ,
15|   ErrorID=> ?WORD?
16| );
17|

```

3) Enter the labels registered in (1) to the corresponding input signals (JogBackward, Velocity, Acceleration, Deceleration, Jerk, and Busy) in the same manner.

```

1| MCv_Jog_1(
2|   Axis:= Axis0001.AxisRef ,
3|   JogForward:= G_bJogF1CMD ,
4|   JogBackward:= G_bJogR1CMD ,
5|   Velocity:= G_leJogVelocity ,
6|   Acceleration:= leJogAcceleration ,
7|   Deceleration:= leJogDeceleration ,
8|   Jerk:= leJogJerk ,
9|   Options:= ?DWORD? ,
10|   Done=> ?BOOL? ,
11|   Busy=> G_bJog1Busy ,
12|   Active=> ?BOOL? ,
13|   CommandAborted=> ?BOOL? ,
14|   Error=> ?BOOL? ,
15|   ErrorID=> ?WORD?
16| );
17|

```

(c) Omitting I/O signals

I/O signals of a FB can be omitted when the initial value is used, or the signal is not used.

In this example, the initial value (0) is used for the Options input, and the Done, Active, CommandAborted, Error, and ErrorID outputs are not used. Therefore, these signals can be omitted.

Delete the unnecessary "," at the end of the FB.

```

1| MCv_Jog_1(
2|   Axis:= Axis0001.AxisRef ,
3|   JogForward:= G_bJogF1CMD ,
4|   JogBackward:= G_bJogR1CMD ,
5|   Velocity:= G_leJogVelocity ,
6|   Acceleration:= leJogAcceleration ,
7|   Deceleration:= leJogDeceleration ,
8|   Jerk:= leJogJerk ,
9|   Busy=> G_bJog1Busy ,
10| );
11|

```

Delete "," at the end of the FB.

(d) Adding comments and editing for appearance

Add comments or indents as necessary.

```
1 //Axis0001 JOG
2 MCV_Jog_1(
3     Axis      := Axis0001.AxisRef ,
4     JogForward := G_bJogFICMD ,
5     JogBackward := G_bJogRICMD ,
6     Velocity   := G_leJogVelocity ,
7     Acceleration:= leJogAcceleration ,
8     Deceleration:= leJogDeceleration ,
9     Jerk       := leJogJerk ,
10    Busy       => G_bJog1Busy
11 );
12
```

The program creation is completed.

5.1.4 ENUM enumerator

The constant values of the axis status (Axis0001.Md.AxisStatus), the buffer mode (BufferMode), etc. are defined as an ENUM enumerator. Programming using the ENUM enumerator is possible.

(1) Inputting ENUM enumerator

[Example of ENUM enumerators for the FB argument]


The enumerator for BufferMode is defined by "MC_BUFFER_MODE__mc*****" (label).

(For details of the BufferMode, refer to Section 5.9.)

```

17
18 //相対値位置決め, Relative value positioning
19 MC_MoveRelative_1(
20   Axis       := Axis0001.AxisRef ,
21   Execute    := bExecute_P ,
22   Distance   := lDistance ,
23   Velocity   := lVelocity ,
24   Acceleration := lAcceleration ,
25   Deceleration := lDeceleration ,
26   Jerk       := lJerk ,
27   BufferMode  := mc_buf,
28   Done       => bDone,
29   Busy       => bBusy,
30   CommandAborted => bCommandAborted,
31   Error      => bError
32 );
33
34

```

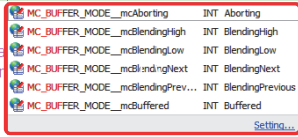

[Example of ENUM enumerator for axis variable]

The enumerator for axis status is defined by "MC_AXIS_STATUS__*****" (label).


```

66
67 //入力軸始動, Input axis start
68 SET(G_bSyncCMD & (Axis0002.Md.AxisStatus = MC_AXIS_STATUS__SynchronizedMotion), bSyncMoveCMD);
69

```

(2) Checking values of ENUM enumerators

- 1) Select [Tool] → [Option] to display the option screen.
- 2) Set "Constant" of the ST editor to "Yes", and click the [OK] button.
- 3) Check the value of an ENUM enumerator by moving the cursor on it in the program.

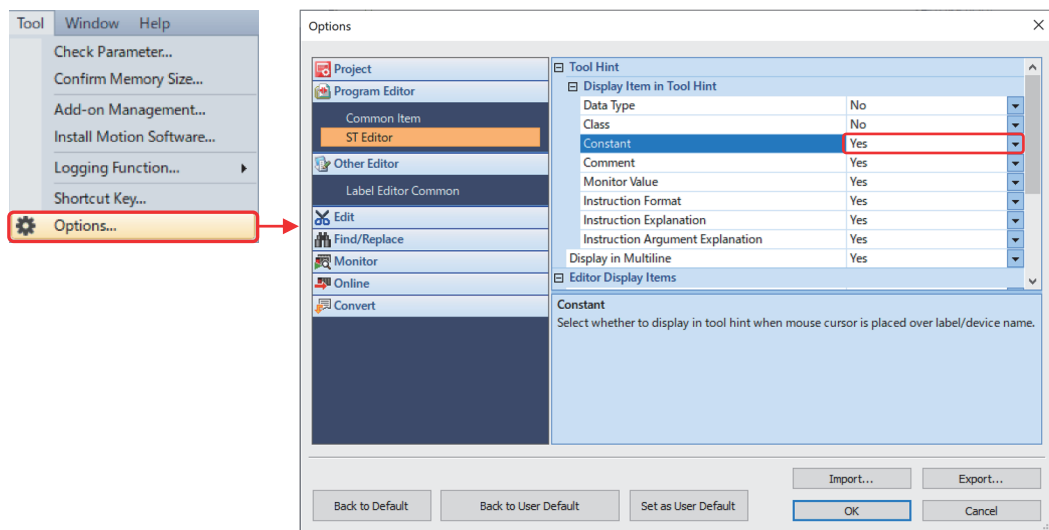

The Options dialog box is shown with the 'ST Editor' option under 'Tool Hint' set to 'Yes'. The 'Constant' option is also set to 'Yes'.

```


BufferMode := MC_BUFFER_MODE__mcAborting
Done       => 0
CommandAborted => Aborting
Error      => bError

```

5.1.5 Conversion of all the programs and reflection of public labels

(1) Conversion of all the programs


Select [Convert] → [Rebuild All] in the motion control setting function, and then a message window appears. Click the [OK] button to convert all the programs.

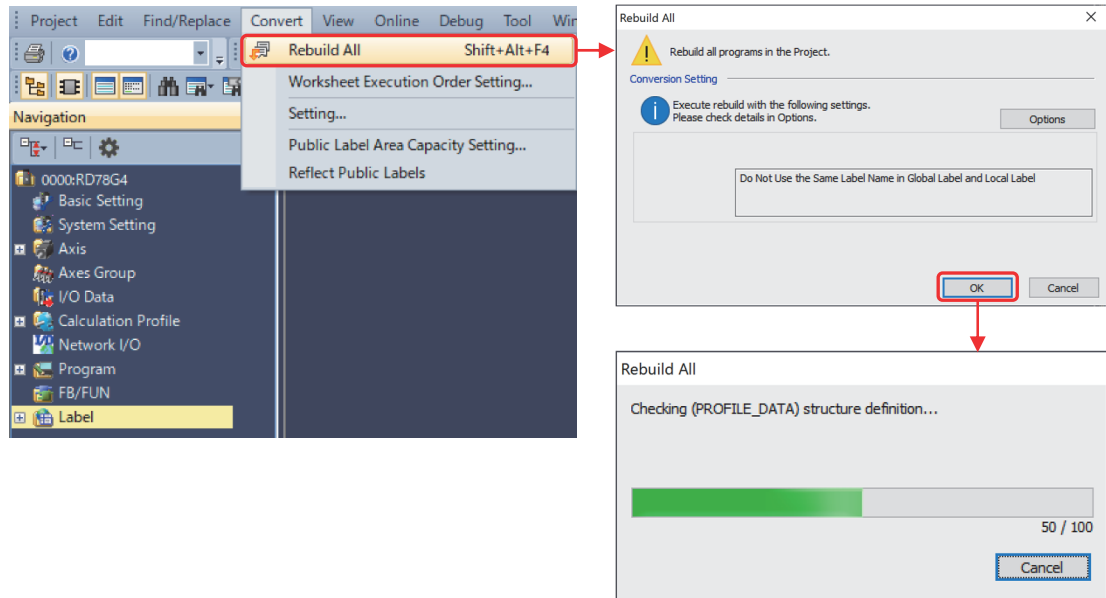

(2) Reflection of public labels

When some labels are registered as a public label, reflect the public labels.

Select [Convert] → [Reflect Public Labels], and then a message window appears. Click the [OK] button to reflect the public labels to the PLC CPU module. (Refer to Section 3.14.2.)

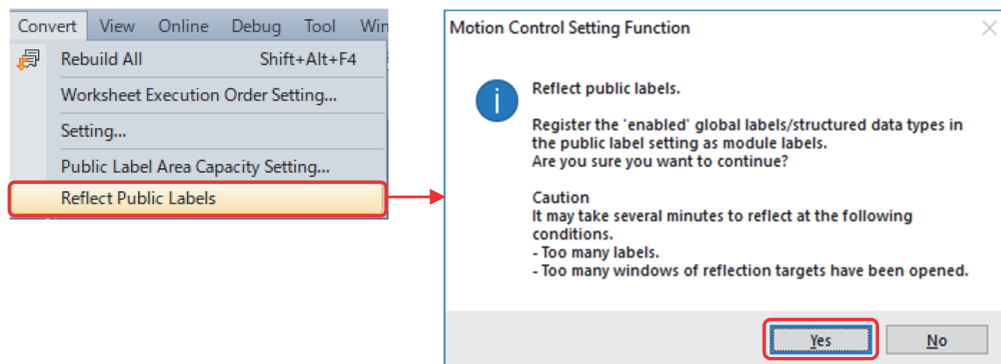

Edit the PLC CPU module program after reflecting the public labels.

5.2 Naming Rules of Labels

This document uses the following prefix rules for labels to distinguish their data type.

Data type		Value range	Prefix	
			Local	Global
Bit	BOOL	FALSE(0), TRUE(1)	b	G_b
Word [unsigned] /bit string [16 bits]	WORD	0 to 65535	u	G_u
Double word [unsigned]/ bit string [32 bits]	DWORD	0 to 4294967295	ud	G_ud
Word [signed]	INT	-32468 to 32767	w	G_w
Double word [signed]	DINT	-2147483648 to 2147483647	d	G_d
Single-precision real number	REAL	-2^{128} to -2^{-126} , 0, 2^{-126} to 2^{128}	e	G_e
Double-precision real number	LREAL	-2^{1024} to -2^{-1022} , 0, 2^{-1022} to 2^{1024}	le	G_le
Time	TIME	T#-24d20h31m23s648ms to T#24d20h31m23s647ms	tm	G_tm
Timer	TIMER	TIMER structure S: contact C: coil N: current value	td	G_td

[Examples of local labels]

Bit: bMoveCMD

Double-precision real number: lePosition

Arrays: wAxes[16]

Timer: tdTimer1

[Examples of global labels]


Bit: G_bJogF1


Double-precision real number: G_leVelocity

5.3 Projects

5.3.1 Program names

The following shows the program examples explained in this chapter.
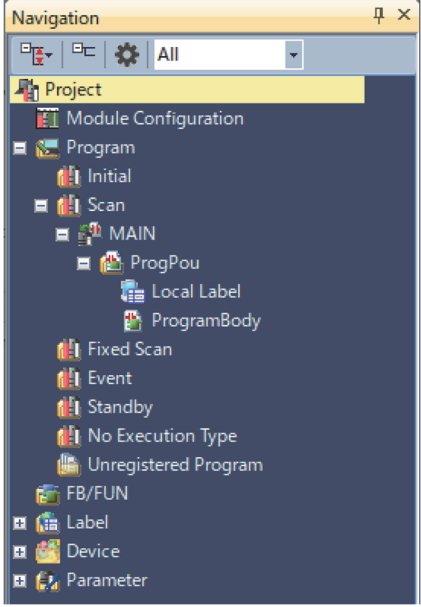
<p>[PLC CPU module]</p> 	<p>Program name: MAIN</p> <p>A device in the PLC CPU module turns ON/OFF the start signal of the Motion module</p> <p>The program is created in ladder because what the program mainly processes is contacts.</p>
--	---
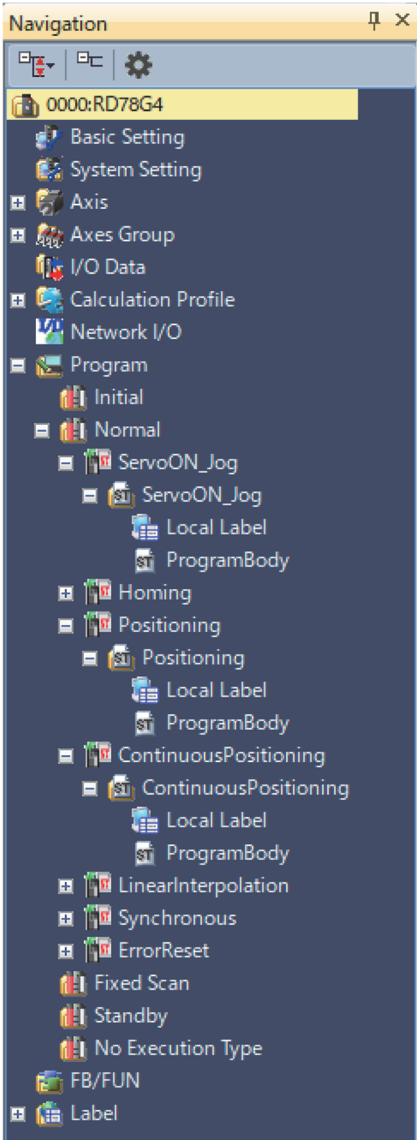
<p>[Motion module]</p> 	<p>Program name: ServoON_Jog (PLC READY, all axes servo ON, JOG operation)</p> <p>Program name: Homing</p> <p>Program name: Positioning (single axis positioning)</p> <p>Program name: ContinuousPositioning (single axis continuous positioning)</p> <p>Program name: LinearInterpolation (two-axis linear interpolation control)</p> <p>Program name: Synchronous (synchronous control)</p> <p>Program name: ErrorReset (error reset)</p>
---	---

5.3.2 Settings for global and public labels

The following shows the setting examples of the global labels in the sample program.
For the local labels, refer to each program.

(1) PLC CPU module

The PLC CPU module uses the public labels of the Motion module.

(2) Motion module

The following shows the global and public label settings of the Motion module.

[Global]

	Label Name	Data Type	Class	Initial	Const	Comment	Rem	Public Label	Motion Control
1	G.bSRVONCMD	Bit	VAR_GLOBAL			サーボオン / Servo ON/OFF		Enable	WRITE (⇒ Motion)
2	G.bHoming1CMD	Bit	VAR_GLOBAL			原点復帰指令 Axis0001 / Homing command Axis0001		Enable	WRITE (⇒ Motion)
3	G.bHoming2CMD	Bit	VAR_GLOBAL			原点復帰指令 Axis0002 / Homing command Axis0002		Enable	WRITE (⇒ Motion)
4	G.bHoming3CMD	Bit	VAR_GLOBAL			原点復帰指令 VirtualAxis0001 / Homing command VirtualAxis0001		Enable	WRITE (⇒ Motion)
5	G.bPosCMD	Bit	VAR_GLOBAL			単軸位置決め始動 / Single axis positioning start		Enable	WRITE (⇒ Motion)
6	G.bContPosCMD	Bit	VAR_GLOBAL			単軸連続位置決め始動 / Single axis continuous positioning start		Enable	WRITE (⇒ Motion)
7	G.bInterpolationCMD	Bit	VAR_GLOBAL			2軸直線補間制御始動 / 2-axis linear interpolation control start		Enable	WRITE (⇒ Motion)
8	G.bSyncCMD	Bit	VAR_GLOBAL			同期制御始動 / Synchronous control start		Enable	WRITE (⇒ Motion)
9	G.bResetCMD	Bit	VAR_GLOBAL			エラーリセット / Error reset		Enable	WRITE (⇒ Motion)
10	G.bMotionResetCMD	Bit	VAR_GLOBAL			システムエラーリセット / System error reset		Enable	WRITE (⇒ Motion)
11	G.bJogF1CMD	Bit	VAR_GLOBAL			JOG正転指令 Axis0001 / JOG Positive rotation command Axis0001		Enable	WRITE (⇒ Motion)
12	G.bJogR1CMD	Bit	VAR_GLOBAL			JOG逆転指令 Axis0001 / JOG Reverse rotation command Axis0001		Enable	WRITE (⇒ Motion)
13	G.bJogF2CMD	Bit	VAR_GLOBAL			JOG正転指令 Axis0002 / JOG Positive rotation command Axis0002		Enable	WRITE (⇒ Motion)
14	G.bJogR2CMD	Bit	VAR_GLOBAL			JOG逆転指令 Axis0002 / JOG Reverse rotation command Axis0002		Enable	WRITE (⇒ Motion)
15	G.leJogVelocity	FLOAT [Double]	VAR_GLOBAL			JOG速度 / JOG Velocity		Enable	WRITE (⇒ Motion)
16	G.bHoming1Done	Bit	VAR_GLOBAL			原点復帰完了 Axis0001 / Homing complete Axis0001		Enable	READ (Motion ⇒)
17	G.bHoming2Done	Bit	VAR_GLOBAL			原点復帰完了 Axis0002 / Homing complete Axis0002		Enable	READ (Motion ⇒)
18	G.bHoming3Done	Bit	VAR_GLOBAL			原点復帰完了 VirtualAxis0001 / Homing complete VirtualAxis0001		Enable	READ (Motion ⇒)
19	G.bPosDone	Bit	VAR_GLOBAL			単軸位置決め完了 / Single axis positioning complete		Enable	READ (Motion ⇒)
20	G.bContPosDone	Bit	VAR_GLOBAL			単軸連続位置決め完了 / Single axis continuous positioning complete		Enable	READ (Motion ⇒)
21	G.bInterpolationDone	Bit	VAR_GLOBAL			2軸直線補間制御完了 / 2-axis linear interpolation control complete		Enable	READ (Motion ⇒)
22	G.bSyncDone	Bit	VAR_GLOBAL			同期制御完了 / Synchronous control complete		Enable	READ (Motion ⇒)
23	G.bJog1Busy	Bit	VAR_GLOBAL			JOG運転中 Axis0001 / JOG operation in progress Axis0001		Enable	READ (Motion ⇒)
24	G.bJog2Busy	Bit	VAR_GLOBAL			JOG運転中 Axis0002 / JOG operation in progress Axis0002		Enable	READ (Motion ⇒)
25	G.bStopSignalX	Bit	VAR_GLOBAL			停止指令 Axis0001 / Stop command Axis0001		Enable	READ (Motion ⇒)
26	G.bStopSignalY	Bit	VAR_GLOBAL			停止指令 Axis0002 / Stop command Axis0002		Enable	READ (Motion ⇒)
27									

1) These labels are used to execute operation of each program.

2) This double-precision real number label stores the JOG velocity.

By registering this label as a global label, the JOG velocity can be changed from a GOT (HMI) or other programs.

*When changing the JOG velocity from a GOT, access from external devices must be enabled.

3) These labels transmit the completion signal of each program to the PLC CPU module.

4) These labels turn ON while the JOG operation is being executed.

They are used as an interlock condition to prevent execution of the JOG operation while other programs are running.

5) These labels stop the axis operation.

The operation is aborted when these labels are turned ON during the operation.

(Refer to Section 5.13.4 for details.)

[Sys+Global]

The following is the structure that stores data related to the system. Set "Public label" to "Enable".

	Label Name	Data Type	Class	Initial Value	Constant	Comment	Remark	Public Label	Motion Control
1	System	SYSTEM	VAR_GLOBAL	<Detailed Setting>				Enable	—
2									

[AX+Global]

These labels are registered automatically when the axis is set in the motion control setting function. No operation is required on the label editor.

	Label Name	Data Type	Class	Initial Value	Constant	Comment	Remark	Public Label	Motion Control
1	Axis0001	AXIS_REAL	VAR_GLOBAL	<Detailed Setting>		[X_Axis]		Disable	—
2	Axis0002	AXIS_REAL	VAR_GLOBAL	<Detailed Setting>		[Y_Axis]		Disable	—
3	VirtualAxis0001	AXIS_VIRTUAL	VAR_GLOBAL	<Detailed Setting>		[Vir_Axis01]		Disable	—
4	LinkAxis0001	AXIS_VIRTUAL_LINK	VAR_GLOBAL	<Detailed Setting>		[Lin_Axis01]		Disable	—
5	LinkAxis0002	AXIS_VIRTUAL_LINK	VAR_GLOBAL	<Detailed Setting>		[Lin_Axis02]		Disable	—
6									

[Gr+Global]

This label is registered automatically when the axes group is set in the motion control setting function. No operation is required on the label editor.

Label Name	Data Type	Class	Initial Value	Constant	Comment	Remark	Public Label	Motion Control
1 AxesGroup001	AXES_GROUP	VAR_GLOBAL	<Detailed>...		[X-Y Table]		Disable	-
2								

[Prf+Global]

These labels are registered automatically when the profile data is registered in the motion control setting function. No operation is required on the label editor.

Label Name	Data Type	Class	Initial Value	Constant	Comment	Remark	Public Label	Motion Control
1 ProfileData001	MC_CAM_REF	VAR_GLOBAL	<Detailed>...		[Cam #1]		Disable	-
2								

[Prg+Global]

These labels are registered automatically when the program is created in the motion control setting function. No operation is required on the label editor.

Label Name	Data Type	Class	Initial Value	Constant	Comment	Remark	Public Label	Motion Control
1 ServoON Jog	PROGRAM_INFO	VAR_GLOBAL	<Detailed>...				Disable	-
2 Homing	PROGRAM_INFO	VAR_GLOBAL	<Detailed>...				Disable	-
3 Positioning	PROGRAM_INFO	VAR_GLOBAL	<Detailed>...				Disable	-
4 ContinuousPosi...	PROGRAM_INFO	VAR_GLOBAL	<Detailed>...				Disable	-
5 LinearInterpolat...	PROGRAM_INFO	VAR_GLOBAL	<Detailed>...				Disable	-
6 Synchronous	PROGRAM_INFO	VAR_GLOBAL	<Detailed>...				Disable	-
7 ErrorReset	PROGRAM_INFO	VAR_GLOBAL	<Detailed>...				Disable	-
8								

[En+Global]

This group is for defining ENUM enumerators, which is automatically registered by the system. No operation is required on the user side.

[SYS_MONI structure]

Label Name	Data Type	Class	Initial Value	Constant	Comment	Public Label	Motion Control
1 Addon_AbsSystem	ADDON_MONI				Add-on AbsSystem Monitor	Disable	-
2 Addon_Axis	ADDON_MONI				Add-on Axis Monitor	Disable	-
3 Addon_ExternalSignal	ADDON_MONI				Add-on ExternalSignal Monitor	Disable	-
4 Addon_FileTransfer	ADDON_MONI				Add-on FileTransfer Monitor	Disable	-

≈

23 BuffermemoryRefreshCycle	CYCLE_MONI				Buffer Memory Refresh Cycle Moni...	Disable	-
24 Environment_UserRootPath	String(127)				User Root Path	Disable	-
25 Error	Bit		0		Motion System Error Detection	Enabled	-
26 ErrorHistory	Word [Unsigned]/Bit...		0		Error History Information	Disable	-
27 ErrorHistory_Latest	Word [Signed]		0		Latest Error History Data No.	Disable	-

≈

[SYSTEM structure]

Label Name	Data Type	Class	Initial	Constant	English(Display Target)	Public Label	Motion Control
1 PrConst	SYS_PRM_CONST				System Parameter Constant	Disabled	WRITE (=> Moti...
2 Pr	SYS_PRM				System Parameter	Disabled	WRITE (=> Moti...
3 Md	SYS_MONI				System Monitor Data	Enabled	READ (Motion =...
4 Cd	SYS_CMD				System Control Data	Disabled	WRITE (=> Moti...
5 LOGGING_REALT...	LOGGING_REALTIME				Logging Real-time Monitor	Disabled	-
6 LoggingRef	LOGGING_REF(1..10)				Logging	Disabled	-
7 Project	PROJECT				Project	Disabled	-
8							

Label Name	Data Type	Comment	Initial	Public Label
BuffermemoryRefreshCycle	CYCLE_MONI	Buffer Memory Refr...		Disabled
CoRecordingStatus	Word [Signed]	Co-recording Opera...		Disabled
Error	Bit	Motion Area System...		Enabled
ErrorHistory	Word [Unsigned]/Bit	Error History Info...		Disabled
ErrorHistory_Latest	Word [Signed]	Latest Error Histo...		Disabled

[POINTS]

When the public label settings of the Motion module are changed, reflect the public labels.
(Refer to Section 3.14.2.)

5.4 PLC READY (Program Name: ServoON_Jog)

 
The Motion module uses 32 points each for inputs and outputs to send/receive data to/from a PLC CPU module.

Regardless of the programming language, PLC READY [Y0] needs to be turned ON by a PLC CPU module to start operation of the Motion module.

(1) Program example

PLC READY flag [Y0] is turned ON when the PLC CPU module is powered ON and the synchronization flag [X1] for the Motion module is turned ON.

[PLC CPU module]



[Motion module]

None

5.5 Servo ON (Program Name: ServoON_Jog)

This program turns ON the real drive axes connected to the servo system.
The following two FBs are used for executing servo ON.

(1) FBs

Type	Command	Description
MCFB (administrative)	MC_Power	Switches a specified axis to the operation possible status.
	MCv_AllPower	Switches all axes to the operation possible status.

(2) Local labels

#	Label Name	Data Type	Class	Initial Value	Constant	Comment
1	MCv_AllPower_1	MCv_AllPower	VAR			全軸サーボオンFB / All axes servo ON FB
2	MCv_Jog_1	MCv_Jog	VAR			JOG運転FB1 Axis0001 / JOG operation FB1 Axis0001
3	MCv_Jog_2	MCv_Jog	VAR			JOG運転FB2 Axis0002 / JOG operation FB2 Axis0002
4	leJogAcceleration	FLOAT [Double Precision]	VAR			JOG加速度 / JOG acceleration
5	leJogDeceleration	FLOAT [Double Precision]	VAR			JOG減速度 / JOG deceleration
6	leJogJerk	FLOAT [Double Precision]	VAR			JOGジャーク / JOG jerk
7						

The labels for JOG operation

Drag and drop MCv_AllPower to the program editor. The FB (MCv_AllPower_1) is added as a local label. (Refer to Section 5.1.3.)

(3) Program example

When PLC READY [Y0] is turned ON, Ready [X0] is turned ON.

Turning ON of X0 is used as the condition for executing all axes servo ON.

When executing servo OFF, turn ON [M0].

[PLC CPU module]



[Motion module]

```

1 //----全軸サーボON-----
2 //----All axes servo ON-----
3
4 MCv_AllPower_1(
5   Enable := TRUE,
6   ServoON := G_bsrVONCMD
7 );

```

5.6 JOG Operation (Program Name: ServoON_Jog)

The servo system outputs commands to a target axis and operates the axis in a specified direction while the JOG positive/reverse rotation commands are ON.

(1) FB

Type	Command	Description
MCFB (motion)	MCv_Jog	Executes a JOG operation according to the target velocity.

(2) Acceleration/deceleration processing function

The acceleration/deceleration function is used to adjust the acceleration/deceleration curve of the motion control according to the user's machine.

(a) Overview

Select the acceleration/deceleration methods from the following.

Method	Description
Acceleration/deceleration specification method (Initial)	Accelerates/decelerates the axis by the acceleration, deceleration, and jerk values specified in the FB.
Acceleration/deceleration time-fixed method	Accelerates/decelerates the axis based on the time specified in the FB regardless of speed.

(b) Setting method

The acceleration/deceleration method can be specified by the Options input of motion FBs, such as MCv_Jog.

Bit	Description
0 to 2	Acceleration/deceleration method setting 0: mcAccDec (acceleration/deceleration specification method) 1: mcFixedTime (acceleration/deceleration time-fixed method)
3 to 15	The function varies depending on the FB.
16 to 31	


(c) Acceleration/deceleration specification method

Select "0: mcAccDec" in the Options input (using bit 0 to 2 for acceleration/deceleration method setting) of the FB, and set acceleration, deceleration, and jerk.

1) Trapezoidal acceleration/deceleration

When "0.0" is set for the Jerk input of the FB, the operation is referred to as the trapezoidal acceleration/deceleration.


The velocity creates a trapezoidal shape.

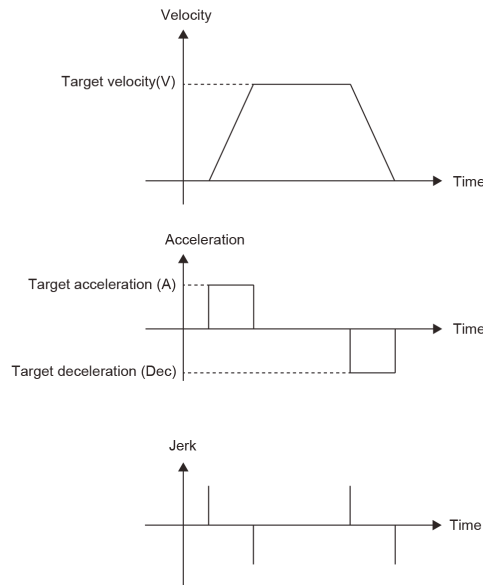

2) Jerk acceleration/deceleration


When values other than "0.0" is set for the Jerk input of the FB, the operation is referred to as the jerk acceleration/deceleration.

The velocity creates an S-curve shape.

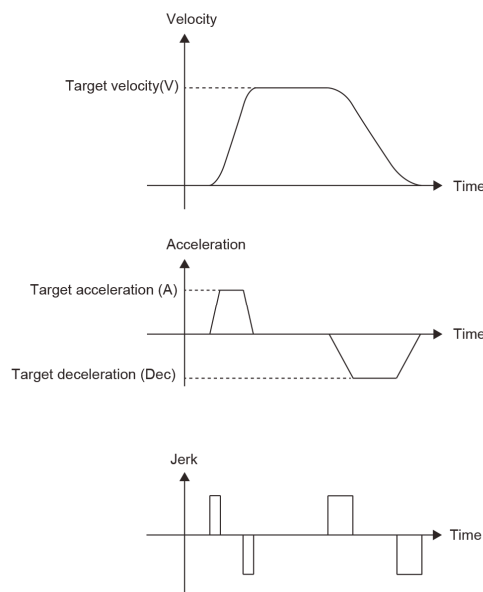

(d) Acceleration/deceleration time-fixed method

Select "1: mcFixedTime" in the Options input (using bit 0 to 2 for acceleration/deceleration method setting) of the FB, and set the acceleration time in the Acceleration input of the FB. The Deceleration and Jerk inputs are not used.

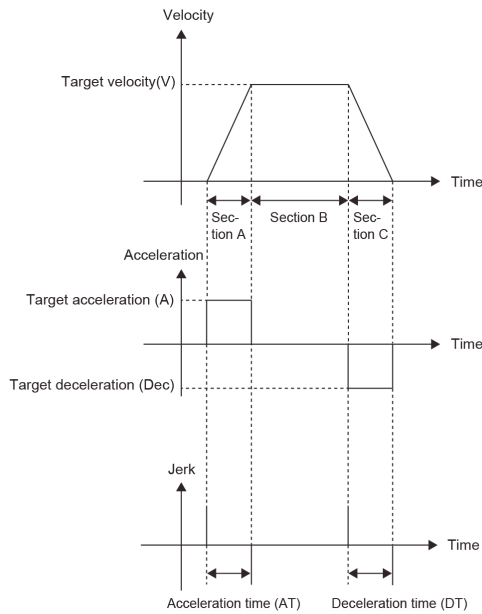

(e) FB input variables

The following table lists the input variables explained in (b) to (d).

Input variable	Name	Details
Velocity	Target velocity	Specify the target velocity.
Acceleration	Acceleration or acceleration/deceleration time	Specify the acceleration or the acceleration/deceleration time. <ul style="list-style-type: none"> • The unit is $[U/s^2]$ when the method is set to "0: mcAccDec". • The unit is [s] when the method is set to "1: mcFixedTime".
Deceleration	Deceleration	Specify the deceleration. <ul style="list-style-type: none"> • The unit is $[U/s^2]$ when the method is set to "0: mcAccDec". • Not used when the method is set to "1: mcFixedTime"
Jerk	Jerk	Specify the jerk. <ul style="list-style-type: none"> • The unit is $[U/s^3]$ when the method is set to "0: mcAccDec". • Not used when the method is set to "1: mcFixedTime".
Options	Options	Specify the acceleration/deceleration method using bit 0 to 2. 0: mcAccDec Acceleration/deceleration specification method 1: mcFixedTime Acceleration/deceleration time-fixed method

[POINTS]

When the "Acceleration/deceleration specification method" (Options: 0) is selected, the acceleration/deceleration can be calculated using the acceleration/deceleration time as follows.

[Target velocity: V [U/s], acceleration time [s], deceleration time [s]],

Velocity := (target velocity V);

Acceleration := (target velocity V/acceleration time);

Deceleration := (target velocity V/deceleration time);

Options := (mcAccDec);

(3) Local labels

The label used in the Servo ON program

	Label Name	Data Type	Class	Initial Value	Constant	Comment
1	MCv_AllPower.1	MCv_AllPower	VAR			全軸サーボON/FB / All axes servo ON/FB
2	MCv_Jog.1	MCv_Jog	VAR			JOG運転FB1 Axis0001 / JOG operation FB1 Axis0001
3	MCv_Jog.2	MCv_Jog	VAR			JOG運転FB2 Axis0002 / JOG operation FB2 Axis0002
4	leJogAcceleration	FLOAT [Double Precision]	VAR			JOG加速度 / JOG acceleration
5	leJogDeceleration	FLOAT [Double Precision]	VAR			JOG減速度 / JOG deceleration
6	leJogJerk	FLOAT [Double Precision]	VAR			JOGジャーク / JOG jerk
7						

1) These labels are automatically added when the user drags and drops the FB "MCv_Jog" to the program editor.

2) These labels are registered manually.

(4) Program example


The JOG velocity is set from the PLC CPU module program since it is registered as a public label ("Write=>Motion") is selected). After the PLC CPU module is turned to RUN state, the JOG velocity can be changed from the PLC CPU module program or on GOT (HMI).

The ON/OFF status of the devices assigned as JOG operation signals (positive/reverse rotation) is transmitted to the Motion module through the public labels.

The interlock conditions are added to prevent execution of the JOG operation while other programs are running.

[Start signal]

	Axis0001	Axis0002
JOG positive rotation command	M1	M3
JOG reverse rotation command	M2	M4

 

The configuration of the axis 2 program is the same as that of the axis 1 program.

5.7 Homing (Program Name: Homing)

The homing method is set using the servo amplifier parameter [Pr. PT45 (Home position return method)].


This section explains the data set method homing.

For the dog type homing, refer to Appendix.

(1) Overview

The data set type homing sets the current position as the home position.

[Time chart of data set type homing (Method37)]

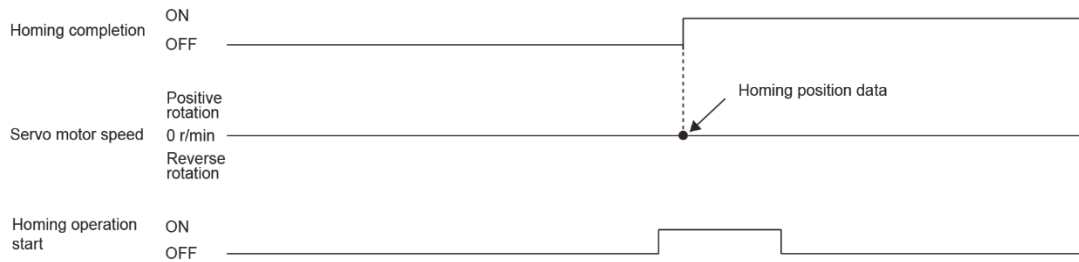

(2) FB

Type	Command	Description
MCFB (motion)	MC_Home	Executes homing of the specified axis.

(3) Local labels

	Label Name	Data Type	Class	Initial Value	Constant	Comment
1)	MC_Home_1	MC_Home	VAR			原点復帰FB1 Axis0001 / Homing FB1 Axis0001
	MC_Home_2	MC_Home	VAR			原点復帰FB2 Axis0002 / Homing FB2 Axis0002
	MC_Home_3	MC_Home	VAR			原点復帰FB3 VirtualAxis0001 / Homing FB3 VirtualAxis0001
	bHoming1Done	Bit	VAR			原点復帰FB1 Done出力 / Homing FB1 Done output
	bHoming1Error	Bit	VAR			原点復帰FB1 Error出力 / Homing FB1 Error output
2)	bHoming2Done	Bit	VAR			原点復帰FB2 Done出力 / Homing FB2 Done output
	bHoming2Error	Bit	VAR			原点復帰FB2 Error出力 / Homing FB2 Error output
	bHoming3Done	Bit	VAR			原点復帰FB3 Done出力 / Homing FB3 Done output
	bHoming3Error	Bit	VAR			原点復帰FB3 Error出力 / Homing FB3 Error output

1) These labels are automatically added when the user drags and drops the FB (MC_Home) to the program editor.

2) These labels are registered manually.

(4) Program example


The start signal (the rising edge of the homing command device) is transmitted to the Motion module through the public label. When the homing is completed, the homing completion signal is transmitted to the PLC CPU module to turn OFF the start signal.

The interlock conditions are added to prevent execution of the homing while other programs are running or when a system error occurs.

[Start signal]

	Axis0001	Axis0002	VirtualAxis0001
Homing command	M10	M11	M12

[PLC CPU module]

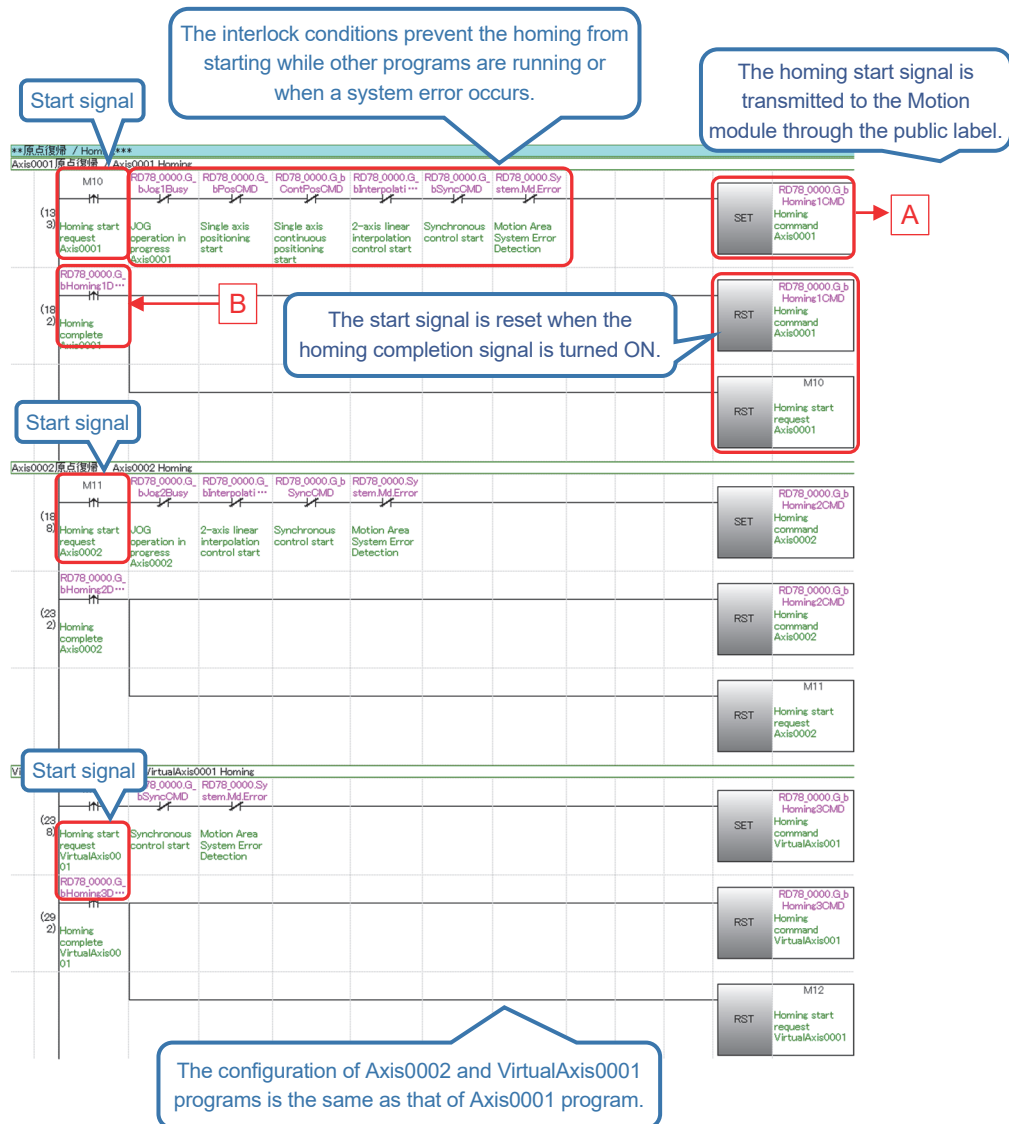

[Motion module]

```

1  //----原点復帰 Axis0001----
2  //----Homing Axis0001-----
3
4  //原点復帰, Homing
5  MC_Home_1(
6      Axis      := Axis0001.AxisRef ,
7      Execute   := G_bHoming1CMD ,
8      Position  := 0.0 ,
9      Done      => bHoming1Done,
10     Error     => bHoming1Error
11 );
12
13 //シーケンサに送る原点復帰完了信号をONする
14 //Transmits homing complete signal to the PLC CPU
15 G_bHoming1Done := bHoming1Done OR bHoming1Error;
16
17 //----原点復帰 Axis0002----
18 //----Homing Axis0002-----
19
20 //原点復帰, Homing
21 MC_Home_2(
22     Axis      := Axis0002.AxisRef ,
23     Execute   := G_bHoming2CMD ,
24     Position  := 0.0 ,
25     Done      => bHoming2Done,
26     Error     => bHoming2Error
27 );
28
29 //シーケンサに送る原点復帰完了信号をONする
30 //Transmits homing complete signal to the PLC CPU
31 G_bHoming2Done := bHoming2Done OR bHoming2Error;
32
33 //----原点復帰 VirtualAxis0001----
34 //----Homing VirtualAxis0001-----
35
36 //原点復帰, Homing
37 MC_Home_3(
38     Axis      := VirtualAxis0001.AxisRef ,
39     Execute   := G_bHoming3CMD ,
40     Position  := 0.0 ,
41     Done      => bHoming3Done,
42     Error     => bHoming3Error
43 );
44
45 //シーケンサに送る原点復帰完了信号をONする
46 //Transmits homing complete signal to the PLC CPU
47 G_bHoming3Done := bHoming3Done OR bHoming3Error;
48

```

A

B

The configuration of Axis0002 and VirtualAxis0001 programs is the same as that of Axis0001 program.

5.8 Single Axis Positioning Control (Program Name: Positioning)

The single axis positioning control executes positioning to a specified position by using the address information.

(1) FBs

Type	Command	Description
MCFB (motion)	MC_MoveAbsolute	Executes positioning using a specified absolute position.
	MC_MoveRelative	Executes positioning using a specified relative distance.


(2) Local labels

	Label Name	Data Type	Class	Initial Value	Constant	Comment
1)	MC_MoveRelative1	MC_MoveRelative	VAR			相対値位置決めFB / Relative value positioning FB
	lDistance	FLOAT (Double Precision)	VAR			移動量 / Distance
	lVelocity	FLOAT (Double Precision)	VAR			速度 / Velocity
	lAcceleration	FLOAT (Double Precision)	VAR			加速度 / Acceleration
	lDeceleration	FLOAT (Double Precision)	VAR			減速度 / Deceleration
	lJerk	FLOAT (Double Precision)	VAR			ジャーク / Jerk
2)	bDone	Bit	VAR			相対値位置決めFB Done出力 / Relative value positioning FB Done output
	bBusy	Bit	VAR			相対値位置決めFB Busy出力 / Relative value positioning FB Busy output
	bError	Bit	VAR			相対値位置決めFB Error出力 / Relative value positioning FB Error output
	bExecute_P	Bit	VAR			実行指令 / Start
	bCommandAborted	Bit	VAR			相対値位置決めFB 実行中断出力 / Relative value positioning FB CommandAborted output

- 1) This label is automatically added when the user drags and drops the FB (MC_MoveRelative) to the program editor.
- 2) These labels are registered manually.

(3) Program example

This program executes relative positioning in the following operation pattern.

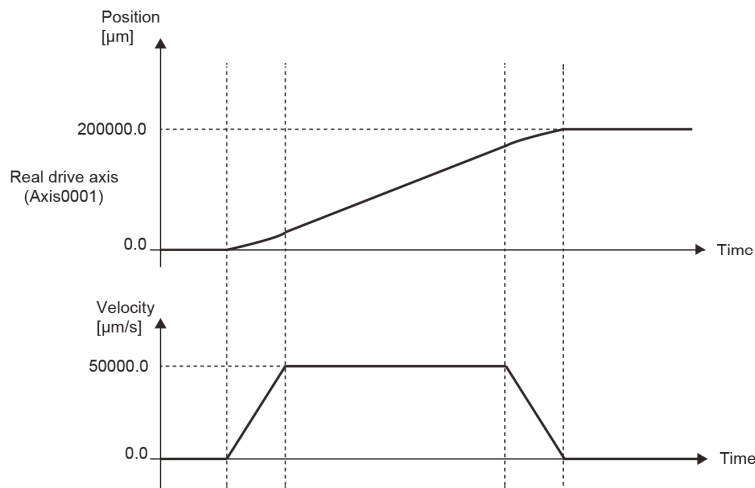


The start signal (the rising edge of the single axis positioning command device) is transmitted to the Motion module through the public label. Responding to the start signal, the Motion module stores each positioning data to the specified local label. When all the data are stored, the positioning FB is executed. When the positioning is completed, the completion signal is transmitted to the PLC CPU module to turn OFF the start signal.

The interlock conditions are added to prevent execution of the single axis positioning while other programs are running or when a system error occurs.


[Start signal]

Single axis positioning command	M20
---------------------------------	-----

[PLC CPU]

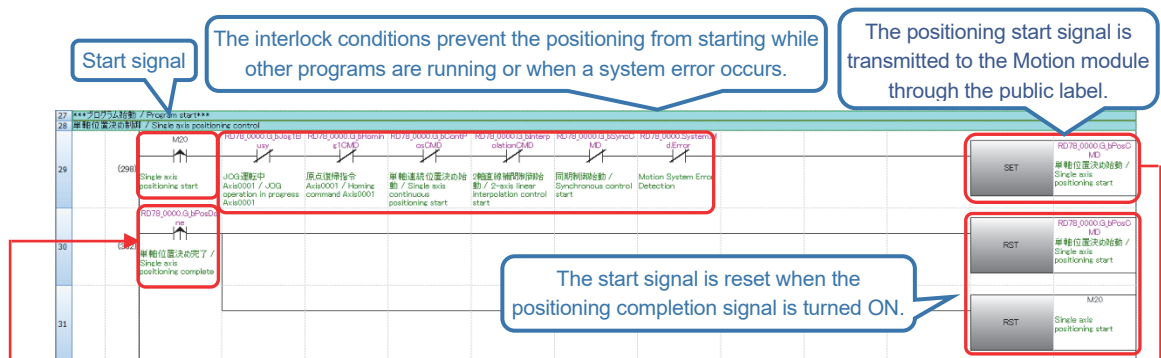

[Motion module]

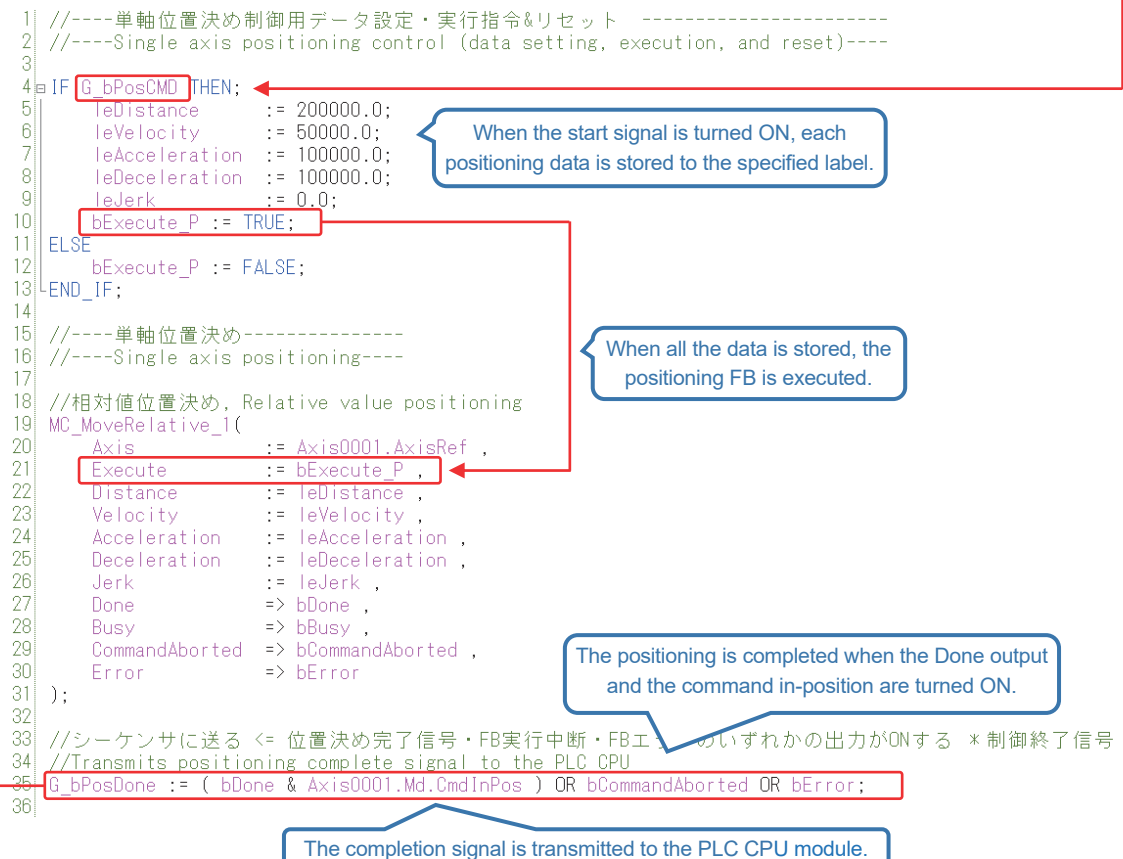

5.9 Single Axis Continuous Positioning (Program Name: ContinuousPositioning)

(1) Overview

An axis can continuously execute multiple motion FBs without stopping by buffering the next motion FB of another instance while executing the first motion FB. Select the buffer mode through the BufferMode input of a motion control FB.

Up to two motion FBs can be buffered on one axis.

(2) Operation pattern of buffer mode

Buffer mode	Operation
0: mcAborting The on-going FB is interrupted (canceled), and the next FB is immediately executed.	
1: mcBuffered The next FB is executed after completion of the on-going FB (the axis decelerates to a stop).	
2: mcBlendingLow The lower target velocity of the on-going FB and the next FB is used as the switching speed.	
3: mcBlendingPrevious The next FB is executed after the target position of the on-going FB is reached. The target velocity is that of the next FB.	
4: mcBlendingNext The next FB is executed after the target position of the on-going FB is reached. When the target position is reached, the velocity is switched to that of the next FB.	
5: mcBlendingHigh The higher target velocity of the on-going FB and the next FB is used as the switching speed.	


(3) Local labels

	Label Name	Data Type	English
1)	MC_MoveRelative1	MC_MoveRelative	Relative value positioning FB1
	MC_MoveRelative2	MC_MoveRelative	Relative value positioning FB2
	TON_1	TON	On-delay timer FB
	leDistance1	FLOAT [Double Prec...	Distance1
	leDistance2	FLOAT [Double Prec...	Distance2
	leVelocity1	FLOAT [Double Prec...	Velocity1
	leVelocity2	FLOAT [Double Prec...	Velocity2
	leAcceleration1	FLOAT [Double Prec...	Acceleration1
	leDeceleration1	FLOAT [Double Prec...	Deceleration1
	leAcceleration2	FLOAT [Double Prec...	Acceleration2
	leDeceleration2	FLOAT [Double Prec...	Deceleration2
2)	leJerk	FLOAT [Double Prec...	Jerk
	bBusy1	Bit	Relative value positioning FB...
	bActive1	Bit	Relative value positioning FB...
	bDone2	Bit	Relative value positioning FB...
	bBusy2	Bit	Relative value positioning FB...
	bDwell_in	Bit	Timer input
	bDwell_out	Bit	Timer output
	bExecute_CP	Bit	Start
	bCommandAborted	Bit	Relative value positioning FB...
	bError	Bit	Relative value positioning FB...

- 1) These labels are automatically added when the user drags and drops the FB (MC_MoveRelative and TON) to the program editor.
- 2) These labels are registered manually.

(4) Program example

This program executes relative positioning in the following operation pattern.

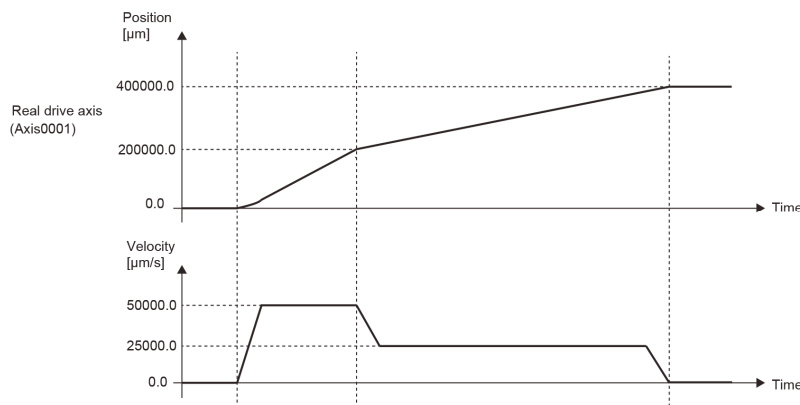

The start signal (the rising edge of the single axis continuous positioning command device) is transmitted to the Motion module through the public label. Responding to the start signal, the Motion module stores each positioning data to the specified local label. When all the data are stored, the relative value positioning FBs (MC_MoveRelative) are executed. The Active output of the first FB is connected to the Execute input of the next FB, which enables buffering of the next FB while executing the first FB. When the first FB is finished, the next FB is continuously executed. To set dwell time, the on-delay timer (100 [ms]) is used.


The completion signal is transmitted to the PLC CPU module to turn OFF the start signal when any of the following conditions is satisfied: the dwell time is passed; an error occurs; or the execution is aborted.

The interlock conditions are added to prevent execution of the single axis continuous positioning while other programs are running or when a system error occurs.

[Start signal]

Single axis continuous positioning command	M21
--	-----

[PLC CPU module]

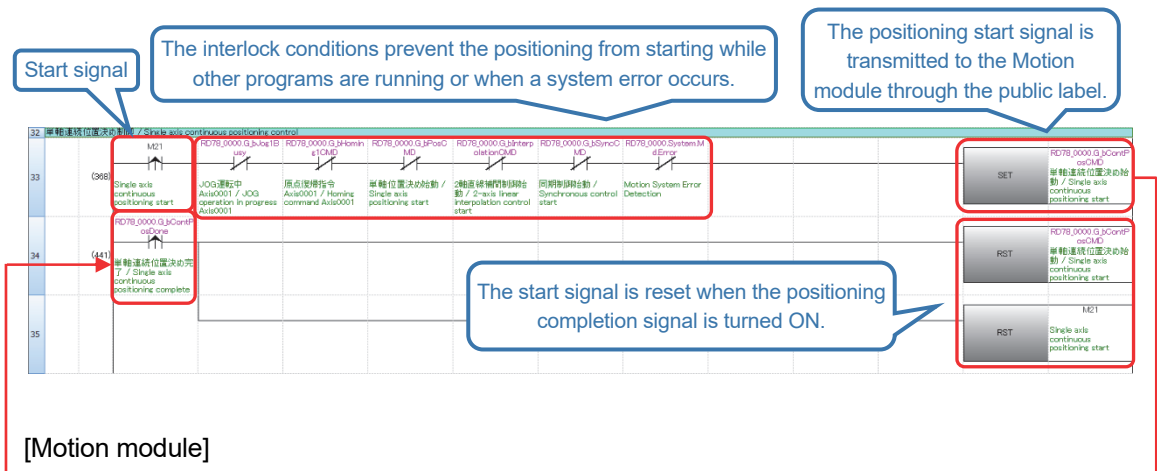

[Motion module]

```

1 //----単軸連続位置決め用データ設定・実行指令&リセット-----
2 //----Single axis continuous positioning control(data setting, execution, and reset)----
3
4 IF G_bContPosCMD THEN:
5     leDistance1 := 200000.0;
6     leDistance2 := 200000.0;
7     leVelocity1 := 50000.0;
8     leVelocity2 := 25000.0;
9     leAcceleration1 := 100000.0;
10    leDeceleration1 := 100000.0;
11    leAcceleration2 := 50000.0;
12    leDeceleration2 := 50000.0;
13    leJerk := 0.0;
14    bExecute_CP := TRUE;
15 ELSE
16    bExecute_CP := FALSE;
17 END_IF;
18
19 //----単軸連続位置決め+バッファモード+ドウェル-----
20 //----Single axis continuous positioning + Buffer mode + Dwell----
21
22 //相対位置決め1, Relative value positioning 1
23 MC_MoveRelative_1(
24     Axis := Axis0001.AxisRef,
25     Execute := bExecute_CP,
26     Distance := leDistance1,
27     Velocity := leVelocity1,
28     Acceleration := leAcceleration1,
29     Deceleration := leDeceleration1,
30     Jerk := leJerk,
31     Busv => bBusv1,
32     Active => bActive1
33 );
34
35 //相対位置決め2, Relative value positioning 2
36 MC_MoveRelative_2(
37     Axis := Axis0001.AxisRef,
38     Execute := bActive1,
39     Distance := leDistance2,
40     Velocity := leVelocity2,
41     Acceleration := leAcceleration2,
42     Deceleration := leDeceleration2,
43     BufferMode := MC_BUFFER_MODE_mcBlendingPrevious,
44     Done => bDone2,
45     Busy => bBusy2
46 );
47
48 //FB実行中断出力, FB CommandAborted output
49 bCommandAborted := MC_MoveRelative_1.CommandAborted OR MC_MoveRelative_2.CommandAborted;
50
51 //FBエラー出力, FB Error output
52 bError := MC_MoveRelative_1.Error OR MC_MoveRelative_2.Error;
53
54 //相対位置決め2完了信号でタイマ入力をセット
55 //Sets timer input with relative value positioning 2 complete signal
56 SET(bDone2, bDwell_in);
57
58 //ドウェル, Dwell
59 TON_1( IN := bDwell_in, PT := T#100ms, Q=> bDwell_out );
60
61 //シーケンサに送る <= ドウェル時間経過・FB実行中断・FBエラーのいずれかの出力がONする *制御終了信号
62 //Transmits continuous positioning complete signal to the PLC CPU
63 G_bContPosDone := bDwell_out OR bCommandAborted OR bError;
64
65 //位置決め完了時、相対位置決め2完了信号保持(タイマ入力)をリセット
66 //Resets timer input when positioning is completed
67 RST(bDwell_out, bDwell_in);
68

```

When the start signal is turned ON, each positioning data is stored to the specified label.

When all the data is stored, the positioning FB is executed.

The Active output of the first FB is connected to the Execute input of the next FB, which enables buffering of the next FB.

Refer to "POINTS" in this section.

The on-delay timer "TON" is used for the dwell time.


[POINTS]

Instead of connecting a label, output signals of a FB can be directly entered by describing
"(FB name). (output signal name)" in the editor.

5.10 Interpolation Control (Program Name: LinearInterpolation)

5.10.1 Procedure for interpolation control

The following shows the procedure flow for executing interpolation control of two or more axes.

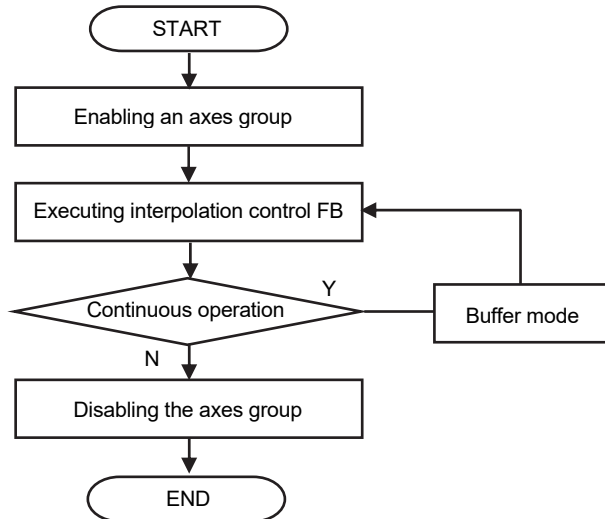

5.10.2 Enabling/disabling an axes group

Refer to Section 3.12 for axes group setting.

To execute interpolation control, change the axes group status to "4: GroupStandby".

(1) FBs

Type	Command	Description
MCFB (administrative)	MC_GroupEnable	Transits the specified axes group status from "0: GroupDisabled" to "4: GroupStandby".
	MC_GroupDisable	Transits the specified axes group status to "0: GroupDisabled".

5.10.3 Interpolation control

The FBs for linear and circular interpolation control are as follows. Execute the FB after the axes group is enabled.


(1) FBs

Type	Command	Description
MCFB (motion)	MCv_MoveLinearInterpolateAbsolute	Absolute value linear interpolation control
	MCv_MoveLinearInterpolateRelative	Relative value linear interpolation control
	MCv_MoveCircularInterpolateAbsolute	Absolute value circular interpolation control
	MCv_MoveCircularInterpolateRelative	Relative value circular interpolation control

5.10.4 Program example for linear interpolation

(1) Operation pattern

The machine goes back and forth between the origin point (0.0, 0.0) [μm] and P1 (100000.0, 200000.0) [μm].

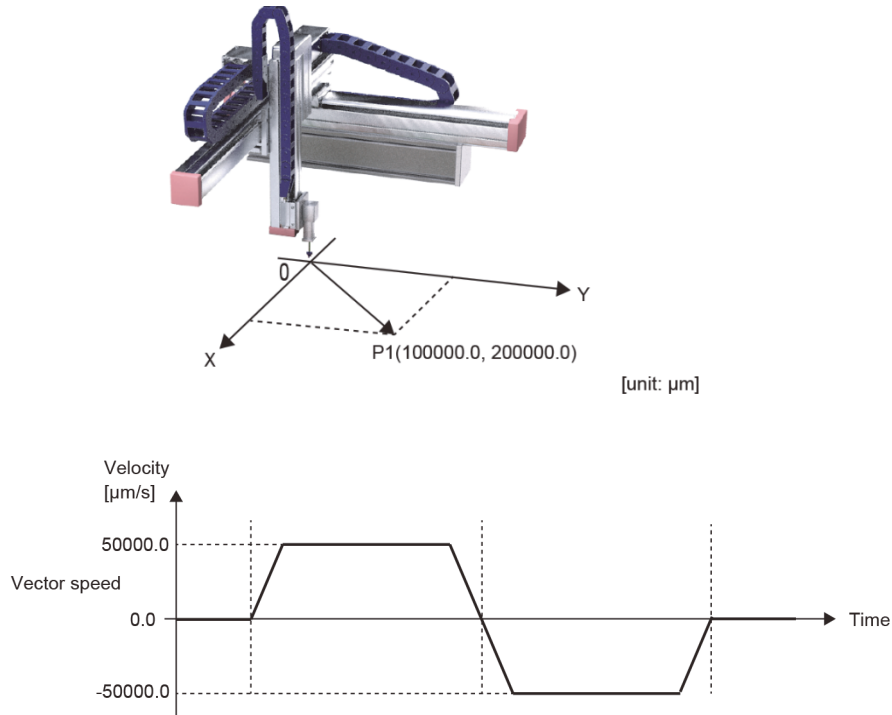

(2) Axis No. and movement amount settings

(a) LinearAxes input of MCv_MoveLinearInterpolateRelative

Use the array of INT (signed word) type with 16 elements.

In the sample program, wAxes[0..15] (label) is used.

The interpolation control axes are selected from the structuring axis [1] to [16] set in the axes group (in Section 3.12). Specify the structuring axis No. to be used for the interpolation control by wAxes. (Note that the wAxes must be set from the index No. [0] in order.)

(b) Distance input

Use the array of LREAL (double-precision real number) type with 16 elements

In the sample program, lePosition[0..15] is used.

Define the movement amount of the structuring axis [1] to [16] in lePosition[0] to lePosition[15].

[POINTS]

Regardless of the number of the interpolation control axes, the number of elements must be 16 for the INT-type array for the LinearAxes input and the LREAL-type array for the Distance input.

[Setting example 1]

- Axes group
Structuring axis [1]: Axis0001, structuring axis [2]: Axis0002,
and structuring axis [3]: Axis0003
- Linear interpolation
Axis0001 and Axis0002

Setting Item	
Select Folder	Display All Data
Item	AxesGroup001
Axis Group No.	1
Axis Group Parameter	Expands initial values at axis
Acceleration Limit Value	2147483647.0 pulse/s ²
Operation Selection at start	-1:Error (Not Started)
Structuring Axis[1]	Axis0001
Structuring Axis[2]	Axis0002
Structuring Axis[3]	Axis0003
Structuring Axis[4]	
Structuring Axis[5]	
Structuring Axis[6]	
Structuring Axis[7]	
Structuring Axis[8]	
Structuring Axis[9]	
Structuring Axis[10]	
Structuring Axis[11]	
Structuring Axis[12]	
Structuring Axis[13]	
Structuring Axis[14]	
Structuring Axis[15]	
Structuring Axis[16]	

wAxes[0] := 1; (← structuring axis [1])
wAxes[1] := 2; (← structuring axis [2])

lePosition[0] := (movement amount of structuring axis 1 (=Axis0001));
lePosition[1] := (movement amount of structuring axis 2 (=Axis0002));

[Setting example 2]

- Axes group
Structuring axis [1]: Axis0001, structuring axis [2]: Axis0002,
and structuring axis [3]: Axis0003
- Linear interpolation
Axis0002 and Axis0003

Setting Item	
Select Folder	Display All Data
Item	AxesGroup001
Axis Group No.	1
Axis Group Parameter	Expands initial values at axis
Acceleration Limit Value	2147483647.0 pulse/s ²
Operation Selection at start	-1:Error (Not Started)
Structuring Axis[1]	Axis0001
Structuring Axis[2]	Axis0002
Structuring Axis[3]	Axis0003
Structuring Axis[4]	
Structuring Axis[5]	
Structuring Axis[6]	
Structuring Axis[7]	
Structuring Axis[8]	
Structuring Axis[9]	
Structuring Axis[10]	
Structuring Axis[11]	
Structuring Axis[12]	
Structuring Axis[13]	
Structuring Axis[14]	
Structuring Axis[15]	
Structuring Axis[16]	

wAxes[0] := 2; (← structuring axis [2])
wAxes[1] := 3; (← structuring axis [3])

lePosition[0] := 0.0;
lePosition[1] := (movement amount of structuring axis 2 (=Axis0002));
lePosition[2] := (movement amount of structuring axis 3 (=Axis0003));

(3) Local label

	Label Name	Data Type	Class	Initial	Con	Comment
1)	1 MCv_MoveLinearInterpolateRelative_1	MCv_MoveLinear...	VAR			相対値直線補間制御FB1 / Relative value linear interpolation control FB1
	2 MCv_MoveLinearInterpolateRelative_2	MCv_MoveLinear...	VAR			相対値直線補間制御FB2 / Relative value linear interpolation control FB2
	3 MC_GroupEnable_1	MC_GroupEnable	VAR			軸グループ有効FB / Axes group enable FB
	4 MC_GroupDisable_1	MC_GroupDisable	VAR			軸グループ無効FB / Axes group disable FB
	5 wAxes	Word [Signed]0...	VAR			補間軸 / Interpolation axis
	6 tePosition1	FLOAT [Double]...	VAR			位置データ1 / Position data 1
	7 tePosition2	FLOAT [Double]...	VAR			位置データ2 / Position data 2
	8 teVelocity	FLOAT [Double]...	VAR			速度 / Velocity
	9 teAcceleration	FLOAT [Double]...	VAR			加速度 / Acceleration
	10 teDeceleration	FLOAT [Double]...	VAR			減速度 / Deceleration
	11 teJerk	FLOAT [Double]...	VAR			ジャーク / Jerk
	12 bGroupEnableDone	Bit	VAR			軸グループ有効完了 / Axes group enable done
	13 bGroupDisableDone	Bit	VAR			軸グループ無効完了 / Axes group disable done
2)	14 bBusy1	Bit	VAR			相対値直線補間制御FB1 Busy出力 / Relative value linear interpolation control FB1 Busy output
	15 bActive1	Bit	VAR			相対値直線補間制御FB1 Active出力 / Relative value linear interpolation control FB1 Active output
	16 bDone2	Bit	VAR			相対値直線補間制御FB2 Done出力 / Relative value linear interpolation control FB2 Done output
	17 bBusy2	Bit	VAR			相対値直線補間制御FB2 Busy出力 / Relative value linear interpolation control FB2 Busy output
	18 TON_1	TON	VAR			オンデレイタイマFB / On-delay timer FB
	19 bDwell_out	Bit	VAR			タイマ出力 / Timer output
	20 bDwell_in	Bit	VAR			タイマ入力 / Timer input
	21 bExecute_LP	Bit	VAR			実行指令 / Start
	22 bCommandAborted	Bit	VAR			相対値直線補間制御FB実行中断出力 / Relative value linear interpolation control FB CommandAborted output
	23 bError	Bit	VAR			相対値直線補間制御FB Error出力 / Relative value linear interpolation control FB Error output
	24					

- 1) These labels are automatically added when the user drags and drops the corresponding FB to the program editor.
- 2) These labels are registered manually.


(4) Program example

	Program description	Module
1)	The start signal (the rising edge of the two-axis linear interpolation control start device) is transmitted to the Motion module through the public label.	PLC CPU module
2)	<ul style="list-style-type: none"> Responding to the start signal, the Motion module stores the positioning data to the specified local labels. When all the data are stored, the axes group is enabled. After the axes group is enabled, the two relative value positioning FBs (MCv_MoveLinearInterpolateRelative) are started in buffer mode. The axes group is disabled when any of the following conditions is satisfied: the dwell time is passed; an error occurs; or the execution is aborted. When the axes group is disabled, the start signal and the on-delay timer input are reset. 	Motion module
3)	The interlock conditions are added to prevent execution of the two-axis interpolation control while other programs are running or when a system error occurs.	PLC CPU module

[Start signal]

Two-axis linear interpolation control start	M22
---	-----

[PLC CPU module]

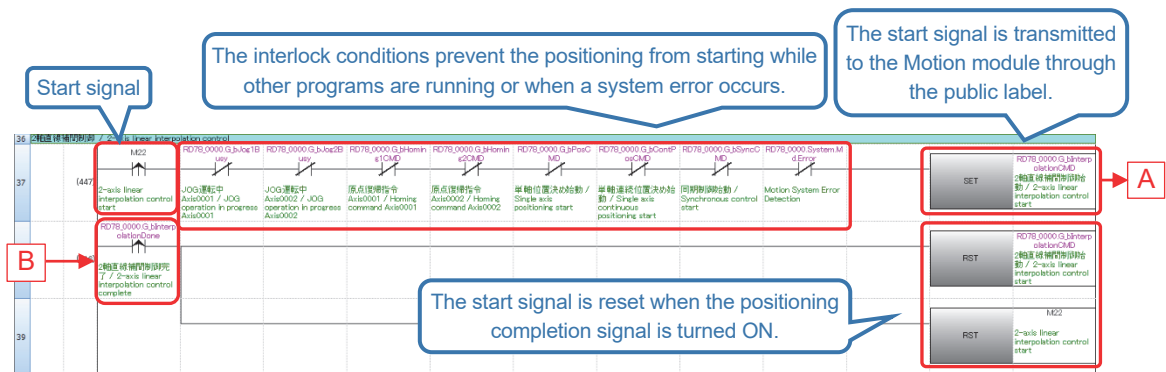

[Motion module]

```

1 //----2軸直線補間制御用データ設定・実行指令&リセット-----
2 //----2-axis linear interpolation control (data setting, execution, and reset)----
3
4 IF G_bInterpolationCMD THEN;
5     wAxes[0] := 1;
6     wAxes[1] := 2;
7     lePosition1[0] := 100000.0;
8     lePosition1[1] := 200000.0;
9     lePosition2[0] := -100000.0;
10    lePosition2[1] := -200000.0;
11    leVelocity := 50000.0;
12    leAcceleration := 50000.0;
13    leDeceleration := 50000.0;
14    leJerk := 0.0;
15    bExecute_LP := TRUE;
16 ELSE
17     bExecute_LP := FALSE;
18 END_IF;
19
20 //----直線補間制御+バッファモード-----
21 //----Linear interpolation control + Buffer mode-----
22
23 //軸グループ有効, Axes group enable
24 MC_GroupEnable_1(
25     AxesGroup := AxesGroup001.AxesGroupRef,
26     Execute := bExecute_LP,
27     Done => bGroupEnableDone
28 );
29
30 //直線補間制御1, Linear interpolation control 1
31 MCv_MoveLinearInterpolateRelative_1(
32     AxesGroup := AxesGroup001.AxesGroupRef,
33     Execute := bGroupEnableDone,
34     LinearAxes := wAxes,
35     Distance := lePosition1,
36     Velocity := leVelocity,
37     Acceleration := leAcceleration,
38     Deceleration := leDeceleration,
39     Jerk := leJerk,
40     VelocityMode := MC_INTERPOLATE_SPEED_MODE__VectorSpeed,
41     Busy => bBusy1,
42     Active => bActive1
43 );
44
45 //直線補間制御2, Linear interpolation control 2
46 MCv_MoveLinearInterpolateRelative_2(
47     AxesGroup := AxesGroup001.AxesGroupRef,
48     Execute := bActive1,
49     LinearAxes := wAxes,
50     Distance := lePosition2,
51     BufferMode := MC_BUFFER_MODE__mcBuffered,
52     Done => bDone2,
53     Busy => bBusy2
54 );
55
56 //FB実行中断出力, FB CommandAborted output
57 bCommandAborted := MCv_MoveLinearInterpolateRelative_1.CommandAborted OR
58     MCv_MoveLinearInterpolateRelative_2.CommandAborted;
59
60 //FBエラー出力, FB error output
61 bError := MCv_MoveLinearInterpolateRelative_1.Error OR
62     MCv_MoveLinearInterpolateRelative_2.Error;
63
64 //直線補間制御2完了信号またはFB実行中断でタイマ入力をセット
65 //Sets timer input with linear interpolation control 2 complete signal or FB CommandAborted output
66 SET( bDone2 OR bCommandAborted, bDwell_in );
67
68 //ドウェル, Dwell
69 TON_1( IN:=bDwell_in, PT:= T#100ms, Q=> bDwell_out );
70
71 //軸グループ無効, Axes group disable
72 MC_GroupDisable_1(
73     AxesGroup := AxesGroup001.AxesGroupRef,
74     Execute := bDwell_out OR bError,
75     Done => bGroupDisableDone
76 );
77
78 //シーケンスに送る <= ドウェル時間経過・FBエラーのいずれかの出力がONする *制御終了信号
79 //Transmits linear interpolation control complete signal to the PLC CPU
80 G_bInterpolationDone := bDwell_out OR bError;
81
82 //位置決め完了時、補間位置決め2完了信号保持(タイマ入力)をリセット
83 //Resets timer input when positioning is completed
84 RST( bDwell_out, bDwell_in );
85

```

A

When the start signal is turned ON, each positioning data is stored to the specified label.

When all the data is stored, the axes group enable FB is executed.

When the axes group is enabled, the two relative value linear interpolation control FBs start in buffer mode.

(Note)

The on-delay timer "TON" is used for the dwell time.

The FB disables the axes group.


B

(Note): When the values for the Velocity, Acceleration, and Deceleration inputs are omitted, those of the previous FB are applied.

5.11 Synchronous Control (Program Name: Synchronous)

5.11.1 Procedures for executing synchronous control

The following shows the procedure flow for executing synchronous control.

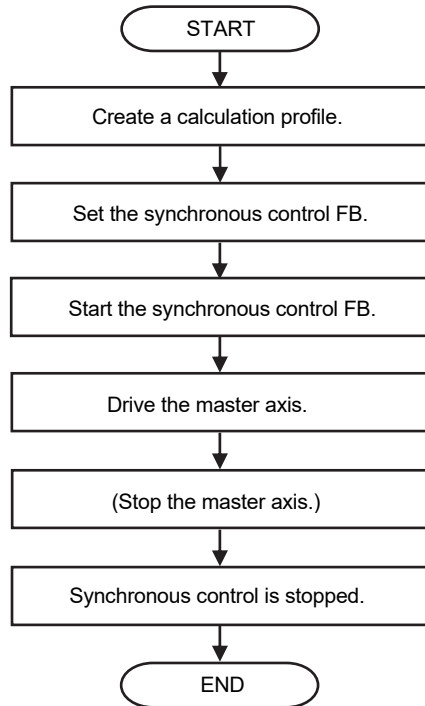


5.11.2 Calculation profile

Waveform data used for control is collectively called calculation profile data. This section explains how to create a cam data.

(1) Creating a new calculation profile

In the navigation window of the motion control setting function, right-click "Calculation Profile" and select "Add New Data".

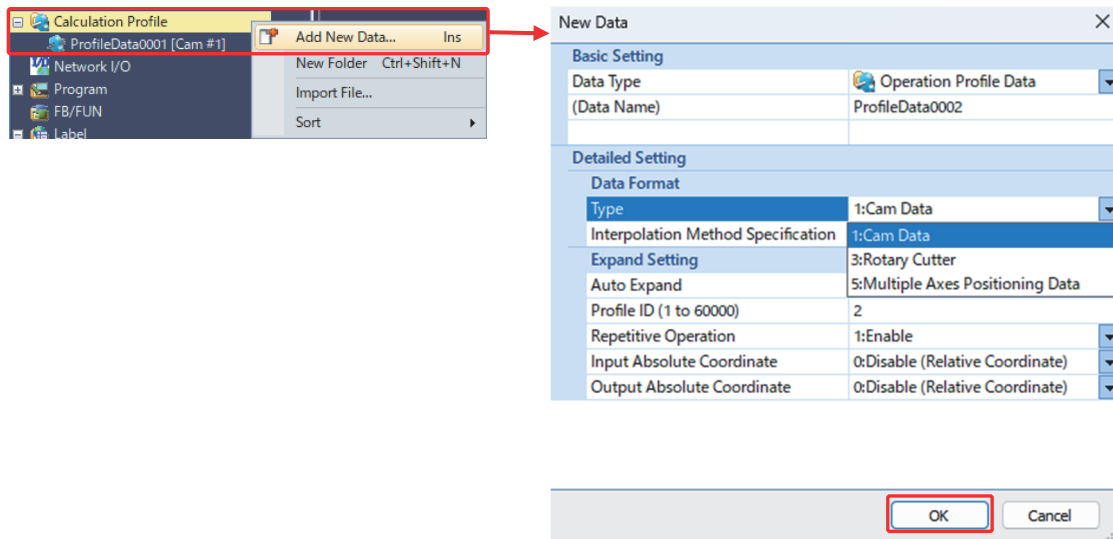

The following shows the setting items on the "New data" screen.


Item	Description
Automatic open	Yes: The calculation profile data is automatically opened at power-on. No: The open FB for calculation profile data needs to be executed.
Periodic	Invalid: The control ends when it executes until the end of calculation profile data. Valid: The execution of calculation profile data is continuously repeated.
Output absolute coordinate	Invalid (relative): When the calculation profile (cam) is started, an output value is calculated based on the current value. When executing a feed cam operation, select this setting. Valid (absolute): The output value at the time the calculation profile (cam) is started is calculated to be always the start point for one cycle of the calculation profile data. When the start point and the end point of the calculation profile data are different, the command is output in one operation cycle in order to return to the first output value at the next one cycle start.

The example in this document uses the initial value. Click the [OK] button.

[POINTS]

In motion control setting function version 1.042U or later, a "Multiple Axes Positioning Data" function has been added to the types of data format. The "Multiple Axes Positioning Data" function is supported by RD78G(H) with software version 28 or later.

- (2) Creating a cam data
Set the calculation profile waveform.

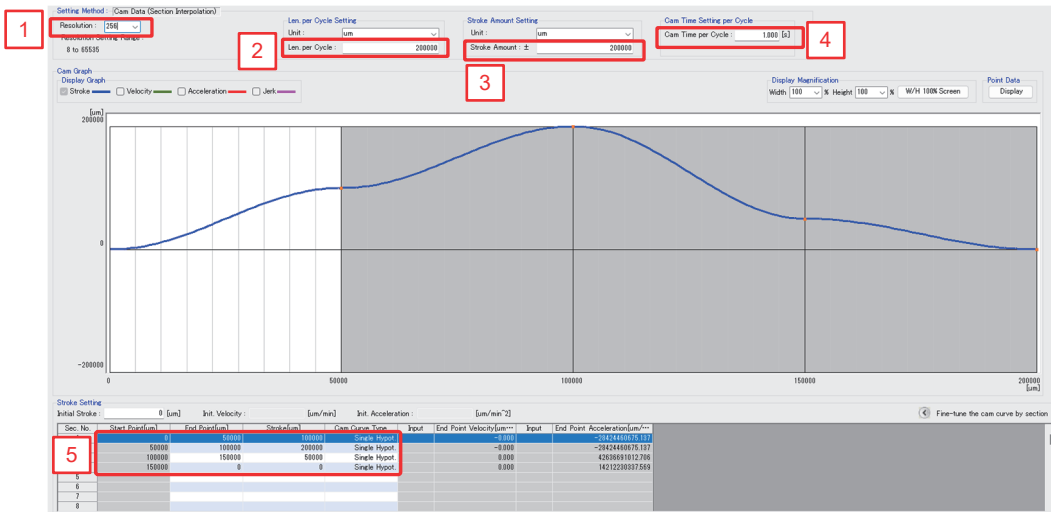

The following shows the necessary setting items.

No.	Item	Description
1	Resolution	Set the resolution of the cam data.
2	Length per Cycle	Set the length per cycle and its unit. (Set the movement amount of the master axis for one cam cycle)
3	Stroke Amount	Set the stroke amount and its unit. (Set the movement amount of the slave axis for one cam cycle)
4	Cam Time per Cycle	Set the time for one cam cycle. This setting is used when velocity, acceleration, and jerk are calculated.
5	Stroke Setting	Set the stroke.

The following shows the example settings.

No.	Item	Setting value
1	Resolution	256
2	Length per Cycle	200000 μm
3	Stroke Amount	200000 μm
4	Cam Time per Cycle	1.000
5	Stroke Setting	Refer to the following table.

Section No.	Start point	End point	Stroke	Cam curve type
1	0	50000	100000	Single hypotenuse
2	50000	100000	200000	Single hypotenuse
3	100000	150000	50000	Single hypotenuse
4	150000	0	0	Single hypotenuse

[POINTS]

When executing a linear cam operation (the same operation as the master axis, or the operation that changes the master axis speed based on a specified speed ratio), create a calculation profile for the linear cam, or use MC_GearIn.

The calculation profile data for the linear cam is not provided in the system.

5.11.3 Single axis synchronous control FBs


The single axis synchronous control FBs operate as software-based mechanical modules such as gears, speed change gears, and cams. These FBs transmit the position information (command) of Slave that is synchronized with Master.

(1) FBs

Type	Command	Description
MCFB (motion)	MC_CamIn (Cam Operation Start)	Executes cam operation.
	MC_GearIn (Gear Operation Start)	Executes gear operation based on the specified speed ratio between the master axis and the slave axis.
	MC_CombineAxes (Addition/Subtraction Positioning)	Combines motion of two axes by a selectable combination method, and outputs the result to the third axis.
	MCv_ChangeCycle (Current Value Change per Cycle)	Changes the cam current value per cycle to the specified value during MC_CamIn control. It is used to compensate the cam current value per cycle into an arbitrary value.
	MCv_BacklashCompensationFilter (Backlash Compensation Filter)	Executes the specific filter processing to the input of the master axis (Master), and outputs the result to the slave axis (Slave).
	MCv_SmoothingFilter (Smoothing Filter)	
	MCv_DirectionFilter (Moving Direction Restriction Filter)	
	MCv_SpeedLimitFilter (Speed Limit Filter)	
	MCv_AdvancedSync (Advanced Synchronous Control)	Starts synchronous control by following the specified advanced synchronous control settings.

5.11.4 Axes configuration


This chapter explains the following cam system.

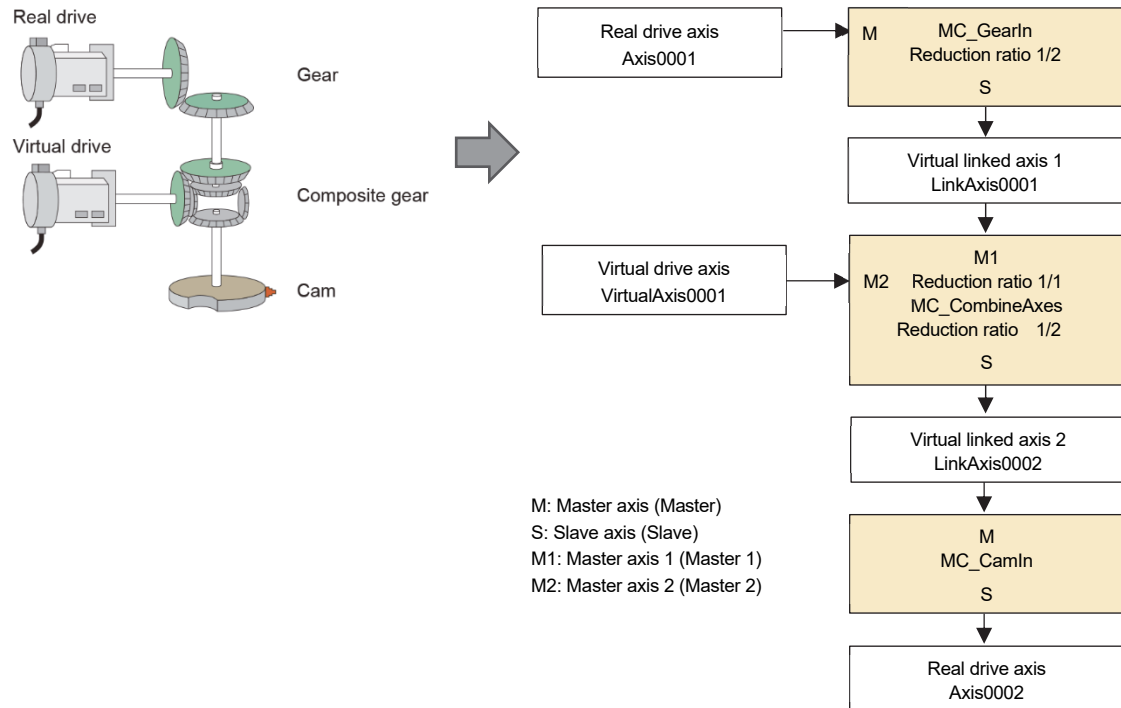

5.11.5 Program example

(1) Operation pattern

The X-axis moves from the origin point for 400000.0 [μm] while the Y-axis (Axis0002) is operated according to the cam pattern created in Section 5.11.2. When the X-axis reaches the target position (400000.0 [μm]), the virtual drive axis starts operation and the Y-axis repeats the cam operation. At this time, the X-axis is stopped and only the Y-axis is operated.

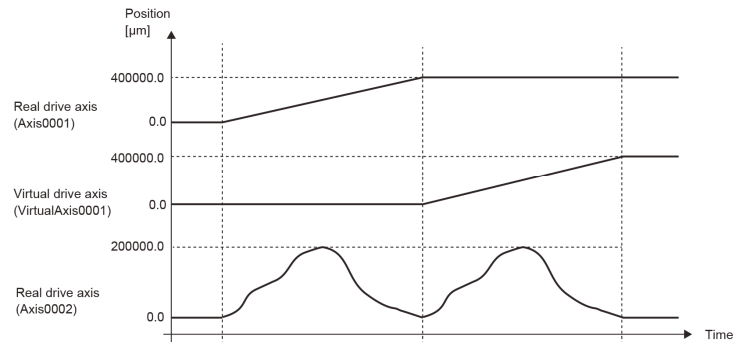

(2) Local labels

	Label Name	Data Type	Class	Initial	Const	Comment
1	MC_GearIn_1	MC_GearIn	VAR			ギア動作FB / Gear operation FB
2	MC_CombineAves_1	MC_CombineAves	VAR			加減算位置決めFB / FB combining the motion of two master axes
3	MC_CamIn_1	MC_CamIn	VAR			カム動作FB / Cam operation FB
4	bGearInBusy	Bit	VAR			ギア動作FB Busy出力 / Gear operation FB Busy output
5	bCombineAvesBusy	Bit	VAR			加減算位置決め動作FB Busy出力 / FB combining the motion of two master axes Busy output
6	bCamInBusy	Bit	VAR			カム動作FB Busy出力 / Cam operation FB Busy output
7	MC_MoveRelative_1	MC_MoveRelative	VAR			相対値位置決めFB / Relative value positioning FB
8	MC_MoveRelative_2	MC_MoveRelative	VAR			相対値位置決めFB / Relative value positioning FB
9	MC_Stop_1	MC_Stop	VAR			軸停止FB1 / Axis Stop FB1
10	MC_Stop_2	MC_Stop	VAR			軸停止FB2 / Axis Stop FB2
11	MC_Stop_3	MC_Stop	VAR			軸停止FB3 / Axis Stop FB3
12	leAcceleration	FLOAT [Double P...	VAR			加速度 / Acceleration
13	leDeceleration	FLOAT [Double P...	VAR			減速度 / Deceleration
14	leJerk	FLOAT [Double P...	VAR			ジャーク / Jerk
15	lePosition1	FLOAT [Double P...	VAR			移動量 / Distance
16	leVelocity	FLOAT [Double P...	VAR			速度 / Velocity
17	bInSync	Bit	VAR			カム動作FB inSync出力 / Cam operation FB inSync output
18	bDone1	Bit	VAR			相対値位置決めFB1 Done出力 / Relative value positioning FB1 Done output
19	bBusy1	Bit	VAR			相対値位置決めFB1 Busy出力 / Relative value positioning FB1 Busy output
20	bDone2	Bit	VAR			相対値位置決めFB2 Done出力 / Relative value positioning FB2 Done output
21	bBusy2	Bit	VAR			相対値位置決めFB2 Busy出力 / Relative value positioning FB2 Busy output
22	bStopReq1	Bit	VAR			軸停止要求1 / Axis Stop request 1
23	bStopDone1	Bit	VAR			軸停止完了1 / Axis Stop complete 1
24	bStopDone2	Bit	VAR			軸停止完了2 / Axis Stop complete 2
25	bStopDone3	Bit	VAR			軸停止完了3 / Axis Stop complete 3
26	bSyncMoveCMD	Bit	VAR			相対値位置決めFB / Relative value positioning start
27	bExecute_S	Bit	VAR			実行指令 / Start
28	bCommandAborted	Bit	VAR			相対値位置決めFB 実行中断出力 / Relative value positioning FB CommandAborted output
29	bError	Bit	VAR			相対値位置決めFB Error出力 / Relative value positioning FB Error output
30						

1) These labels are automatically added when the user drags and drops the corresponding FB to the program editor.

2) These labels are registered manually.


(3) Program example

	Program description	Module
1)	The start signal (the rising edge of the synchronous control start device) is transmitted to the Motion module through the public label.	PLC CPU module
2)	<ul style="list-style-type: none"> Responding to the start signal, the Motion module stores the positioning data to the specified labels. When all the data are stored, the execution signals of the single axis synchronous control FBs (MC_GearIn, MC_CombineAxes, and MC_CamIn) are turned ON. When the Axis0002 status is turned to "7: SynchronizedMotion", Axis0001 master axis (Master) starts positioning. At this time, Axis0002 is operated according to the specified calculation profile. When positioning of Axis0001 is completed, the virtual drive axis (VirtualAxis0001) starts positioning. At this time, Axis0001 is stopped, but Axis0002 is operated according to the specified calculation profile. The synchronous control is stopped by executing MC_Stop on the real drive axis (Axis0002) and the virtual linked axes (LinkAxis0001 and LinkAxis0002) when any of the following conditions is satisfied: the positioning of the virtual drive axis (VirtualAxis0001) is completed; an error occurs; or the execution is aborted. The start signal is reset when the real drive axis (Axis0002) status is out of synchronization. 	Motion module
3)	The interlock conditions are added to prevent execution of the synchronous control while other programs are running or when a system error occurs.	PLC CPU module


[Start signal]

Synchronous control start	M23
---------------------------	-----

[PLC CPU module]

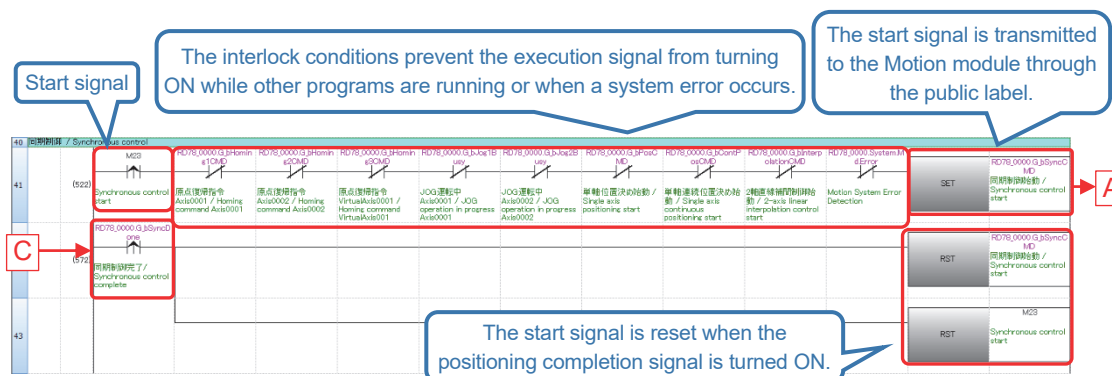

[Motion module]

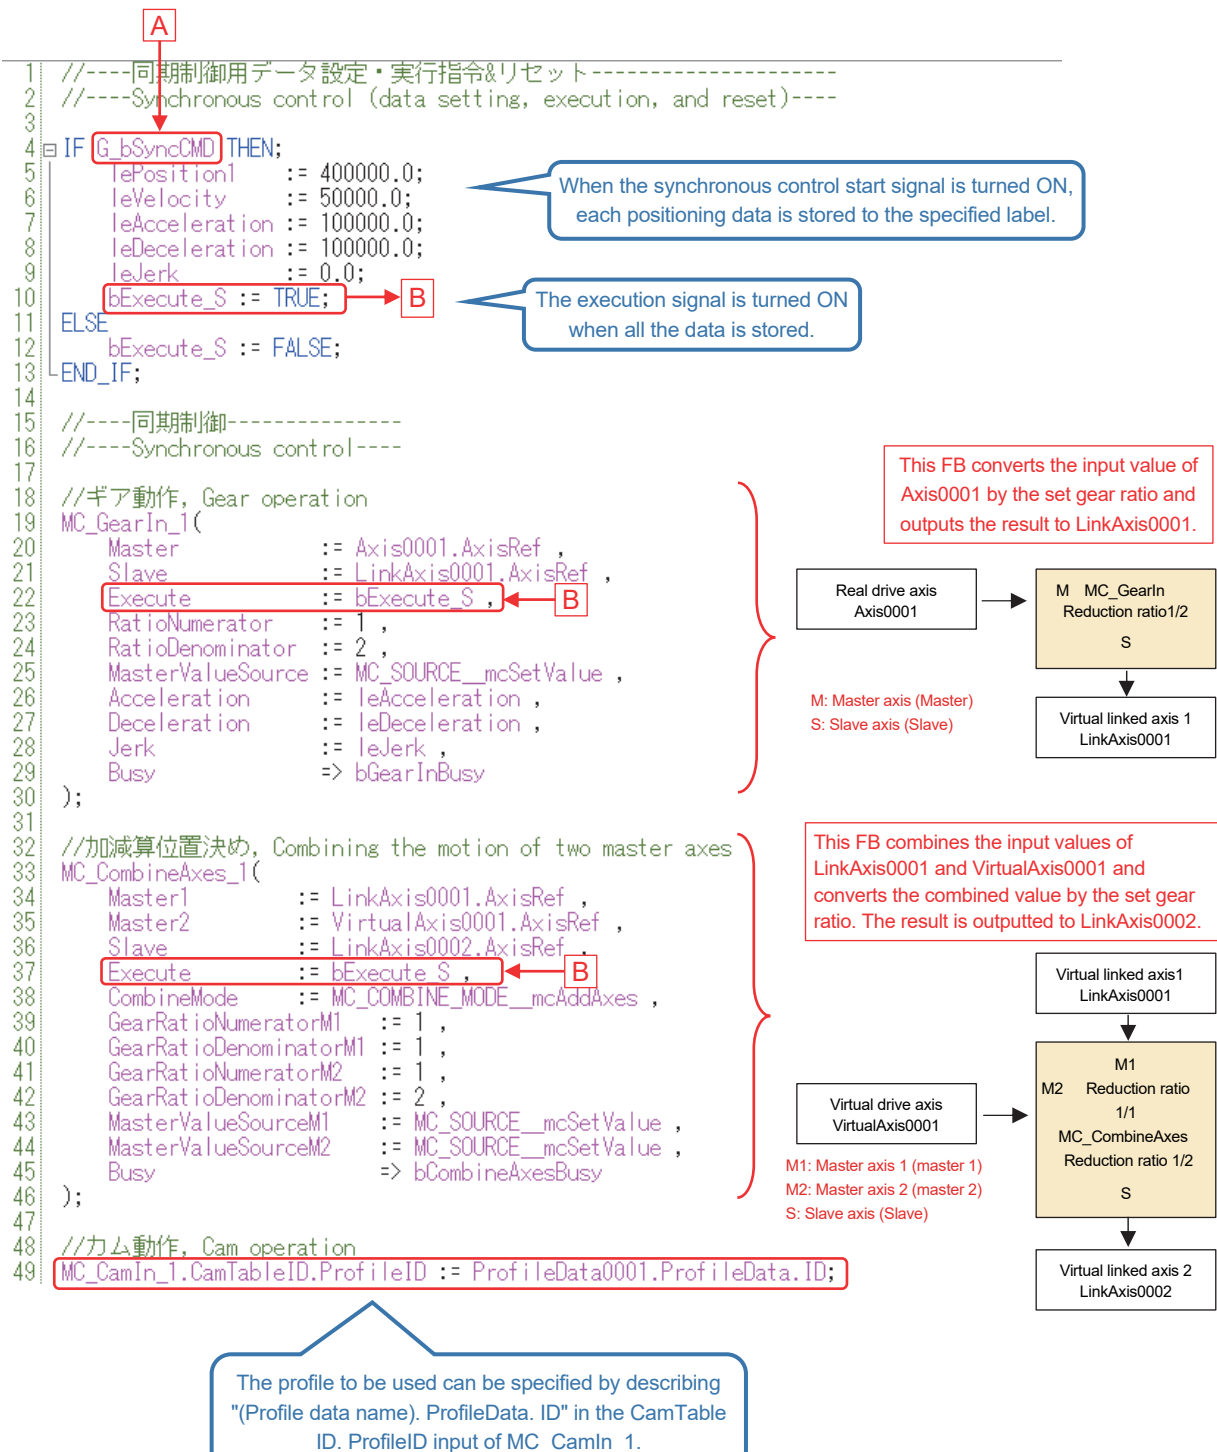

(To the next page)

(Continued)


The CamTableID input is omitted since it is set in line 45.

```

51 MC_CamIn_1(
52   Master      := LinkAxis0002.AxisRef ,
53   Slave       := Axis0002.AxisRef ,
54   Execute     := bExecute_S ,
55   MasterOffset := 0.0 ,
56   SlaveOffset  := 0.0 ,
57   MasterScaling := 1.0 ,
58   SlaveScaling  := 1.0 ,
59   MasterStartDistance := 0.0 ,
60   MasterSyncPosition := 0.0 ,
61   StartMode    := MC_START_MODE_mcImmediate ,
62   MasterValueSource := MC_SOURCE_mcSetValue ,
63   InSync       => bInSync ,
64   Busy         => bCamInBusy
65 );
66

```

This FB drives Axis 0002 by the input value of LinkAxis0002 with the specified calculation profile.

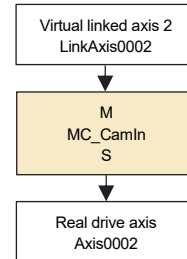

Axis0001 executes positioning when the status of Axis0002 turns to "7: SynchronizedMotion".

```

67 //入力軸始動, Input axis start
68 bSyncMoveCMD := G_bSyncCMD & ( Axis0002.Md.AxisStatus = MC_AXIS_STATUS_SynchronizedMotion );
69
70 //相対値位置決め 実ドライブ軸 Axis0001
71 //Relative value positioning real drive axis Axis0001
72 MC_MoveRelative_1(
73   Axis      := Axis0001.AxisRef ,
74   Execute   := bSyncMoveCMD ,
75   Distance  := lePosition1 ,
76   Velocity  := leVelocity ,
77   Acceleration := leAcceleration ,
78   Deceleration := leDeceleration ,
79   Jerk      := leJerk ,
80   Done      => bDone1 ,
81   Busy      => bBusy1
82 );
83
84 //相対値位置決め 仮想ドライブ軸 VirtualAxis0001
85 //Relative value positioning virtual drive axis VirtualAxis0001
86 MC_MoveRelative_2(
87   Axis      := VirtualAxis0001.AxisRef ,
88   Execute   := bDone1 & Axis0001.Md.CmdInPos ,
89   Distance  := lePosition1 ,
90   Velocity  := leVelocity ,
91   Acceleration := leAcceleration ,
92   Deceleration := leDeceleration ,
93   Jerk      := leJerk ,
94   Done      => bDone2 ,
95   Busy      => bBusy2
96 );
97
98 //FB実行中断出力, FB CommandAborted output
99 bCommandAborted := MC_GearIn_1.CommandAborted OR
100                  MC_CombineAxes_1.CommandAborted OR
101                  MC_CamIn_1.CommandAborted OR
102                  MC_MoveRelative_1.CommandAborted OR
103                  MC_MoveRelative_2.CommandAborted;
104
105 //FBエラー出力, FB error output
106 bError := MC_GearIn_1.Error OR MC_CombineAxes_1.Error OR
107          MC_CamIn_1.Error OR MC_MoveRelative_1.Error OR
108          MC_MoveRelative_2.Error;
109
110 //位置決め完了時、または実行中断時、エラー発生時に軸停止信号をON, Turns axis stop signal ON
111 bStopReq1 := ( bDone2 & VirtualAxis0001.Md.CmdInPos ) OR bError OR bCommandAborted;
112

```

Axis0001 positioning

VirtualAxis0001 starts positioning when the positioning of Axis0001 is completed.

VirtualAxis0001 positioning

The axis stop signal (bStopReq1) is turned ON when any of the following conditions is satisfied: the positioning of VirtualAxis0001 is completed; an error occurs; or the execution is aborted.

(To the next page)

(Continued)

```

113 //同期終了, Synchronization done
114 MC_Stop_1(
115     Axis    := Axis0002.AxisRef ,
116     Execute := bStopReq1 ,
117     Done    => bStopDone1
118 );
119
120 MC_Stop_2(
121     Axis    := LinkAxis0001.AxisRef ,
122     Execute := bStopReq1 ,
123     Done    => bStopDone2
124 );
125
126 MC_Stop_3(
127     Axis    := LinkAxis0002.AxisRef ,
128     Execute := bStopReq1 ,
129     Done    => bStopDone3
130 );
131
132 //同期終了後、始動要求信号をリセット
133 //Resets the start request signal when synchronization is completed
134 RST( bStopDone1 OR System.Md.Error, bSyncMoveCMD );
135 RST( bStopDone1 OR System.Md.Error, bStopReq1 );
136
137 //シーケンサに送る <= 位置決め完了信号・FB実行中断・FBエラーのいずれかの出力がONする *制御終了信号
138 //Transmits synchronous control complete signal to the PLC CPU
139 G_bSyncDone := ( bStopDone2 & VirtualAxis0001.Md.CmdInPos ) OR bCommandAborted OR bError ;
140

```

Axis0002, LinkAxis0001, and LinkAxis0002 are out of synchronization.

C ← G_bSyncDone

5.12 Error Reset (Program Name: ErrorReset)

This program resets the error on each axis.

(1) FBs


Type	Command	Description
MCFB (administrative)	MC_Reset	Resets errors and warnings of the axis.
	MC_GroupReset	Resets errors and warnings of the axes group.
	MCv_MotionErrorReset	Reset all errors and warnings of the motion system.

(2) Program example

The following shows the program example for error reset.

The ON/OFF status of the device assigned as the start signal of the error reset is transmitted to the Motion module through the public label.

[PLC CPU module]

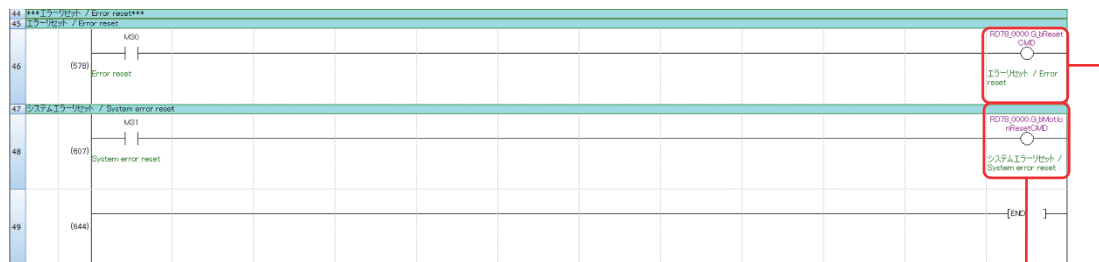

[Motion module]

```

1
2 // エラーリセット, Error reset
3 MC_Reset_1(Axis:= Axis0001.AxisRef, Execute:= G_bResetCMD );
4 MC_Reset_2(Axis:= Axis0002.AxisRef, Execute:= G_bResetCMD );
5 MC_Reset_3(Axis:= VirtualAxis0001.AxisRef, Execute:= G_bResetCMD );
6 MC_Reset_4(Axis:= LinkAxis0001.AxisRef, Execute:= G_bResetCMD );
7 MC_Reset_5(Axis:= LinkAxis0002.AxisRef, Execute:= G_bResetCMD );
8
9 // 軸グループエラーリセット, Axes group error reset
10 MC_GroupReset_1(AxesGroup:= AxesGroup001.AxesGroupRef, Execute:= G_bResetCMD );
11
12 // コントローラエラーリセット, Controller error reset
13 MCv_MotionErrorReset_1(Execute:= G_bMotionResetCMD );
14

```


5.13 Checking Operation

5.13.1 Conversion and Writing of Programs

Write the programs to the PLC CPU module and the Motion module.

After the programs are created in MELSOFT GX Works3 and the motion control setting function, convert all the programs from [Convert] → [Rebuild All].

(Note): When the parameters and the public labels of the Motion module are changed, convert and write the programs to the PLC CPU module after reflecting the public labels.

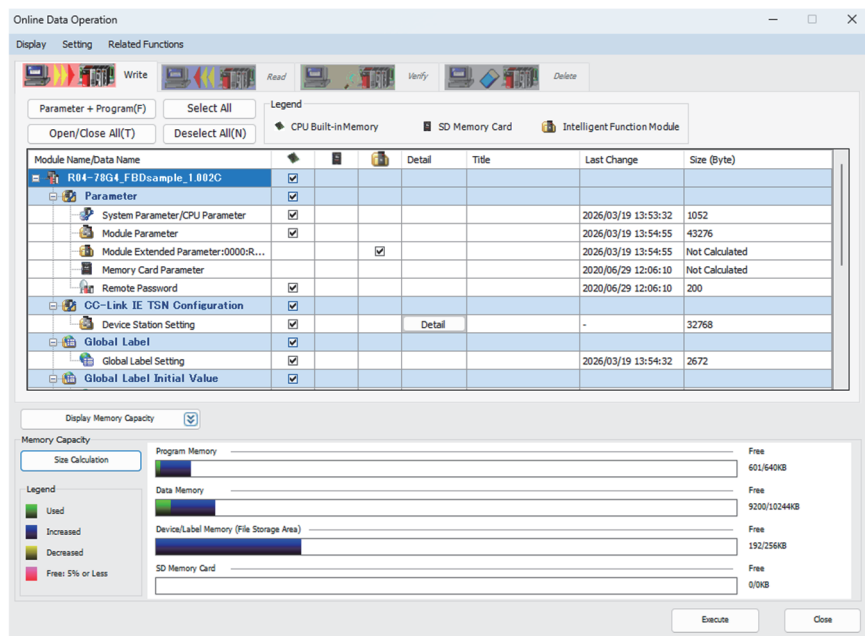

5.13.2 Axis monitor

The monitor screen displays the current values and the error codes of all axes in operation all at once. Users can check the current values and whether any error occurs during the operation.

(1) Displaying monitor screens

Select [Online] → [Motion Monitor] → [Axis Monitor] in the motion control setting function.

(2) Monitor screen

The screenshot shows two side-by-side windows. The left window is titled '0000:RD78G64 - Axis Monitor' and contains a table with two columns: 'Axis #1' and 'Axis #2'. The table lists various parameters such as Axis Name, Axis Status, Control Cycle, Position Command Unit, Velocity Command Unit, Set Position, Actual Position, Commanded Position, Set Velocity, Actual Velocity, Commanded Velocity, Negative Direction Velocity Limit Value, Positive Direction Velocity Limit Value, Automatically Decelerating, Command In-position, Negative Direction Torque Limit Value, Positive Direction Torque Limit Value, Execution Profile ID No., Homing Completed, Homing Request, Start Permission at Homing Uncompleted, Upper Limit Signal Status, Lower Limit Signal Status, Forced Stop Cancelling, Axis Error Detection, Axis Error Code, Axis Warning Detection, Axis Warning Code, Driver Ready On Status, and Driver Servo On Status. The right window is titled 'System Monitor' and displays a list of system status items with their corresponding values, such as PLC Ready, Ready, Synchronization flag, System Basic Cycle Monitor, Operation Cycle Monitor, and Network Area Error Detection. Red boxes and numbers 1 through 5 are overlaid on the screenshot to highlight specific features: 1 points to the table in the Axis Monitor window; 2 points to the System Monitor window; 3 points to the 'Monitor Type' dropdown menu; 4 points to the 'Monitor Item Selection' button; and 5 points to the 'Split' button.

No.	Description
1	The monitor items for each axis are displayed.
2	The system monitor items are displayed.
3	The axis type to be monitored can be changed.
4	The monitor items can be added/deleted.
5	The monitor type can be split to display split screens.

5.13.3 Program monitor

The program monitor enables the user to check the current status of the program in execution on the program editor.

(1) Displaying monitor screen

[PLC CPU module]

Select [Online] → [Monitor] → [Start Monitoring (All Windows)] in MELSOFT GX Works3, or click the icon [] on the tool bar.

[Motion module]

Select [Online] → [Monitor] → [Start Monitoring (All Windows)] in the motion control setting function, or click the icon [] on the tool bar.

(2) Monitor screen

The following shows the monitor screen of the motion control setting function.



5.13.4 Watch

The watch function enables the user to check the current values of the registered devices and labels. Register the devices and labels to be monitored to a watch window.


(1) Displaying monitor screens

[PLC CPU module]


Select [View] → [Docking Window] → [Watch 1 to Watch 4] in MELSOFT GX Works3.

[Motion module]

Select [View] → [Docking Window] → [Watch 1 to Watch 4] in the motion control setting function.

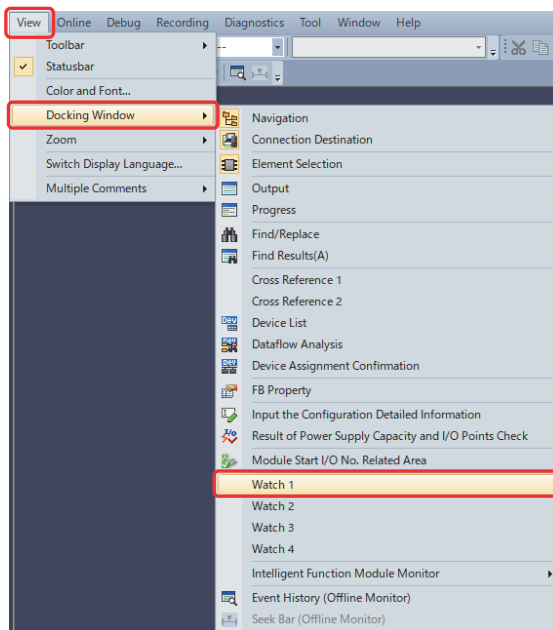


[MELSOFT GX Works3]

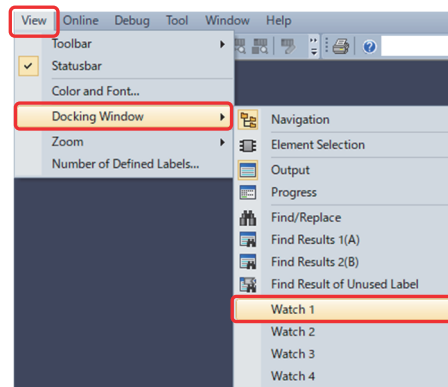

[Motion control setting function]

(2) Registration of labels and structures to a watch window

Enter the label or the structure to be registered in the "Name" column of a watch window or right-click a label or a structure to be registered on the program editor, and select [Register to Watch Window] → [Watch Window 1 to 4].

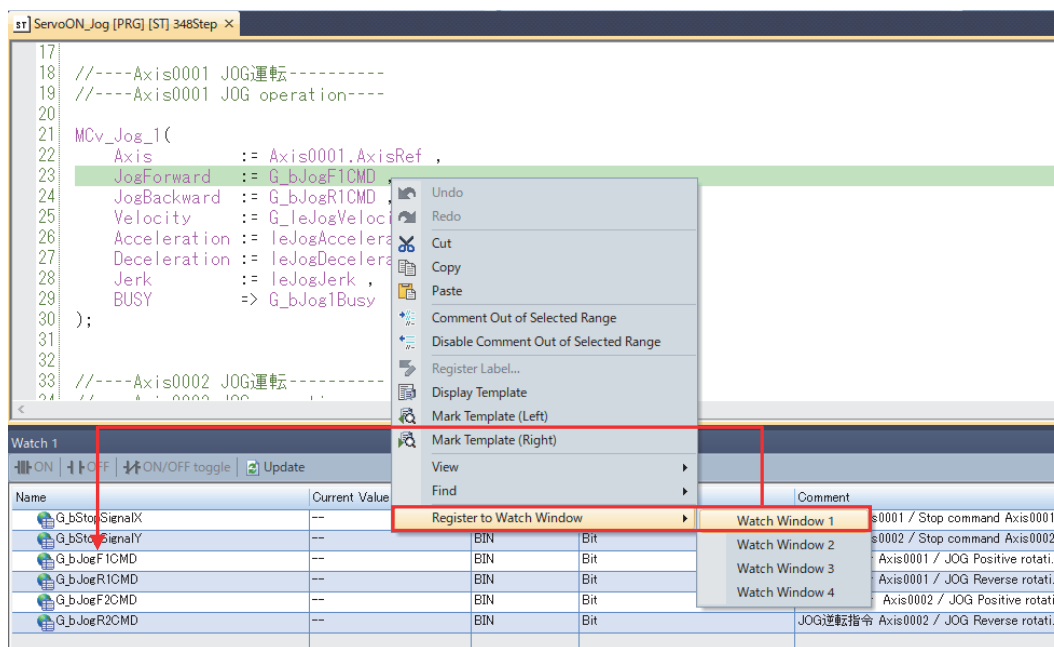

(3) Monitoring start

Select [Online] → [Watch] → [Start Watching] in MELSOFT GX Works3 or the motion control setting function.

(4) Changing current values

Directly enter a value in "Current Value" during monitoring.

The bit device can be switched to ON/OFF with double-click while holding the [Shift] key or with [Shift] + [Enter] after selecting the row.

[POINTS]

In the sample program, "G_bStopSignalX" and "G_bStopSignalY" are registered in the watch window 1. Turning these signals ON stops the axis operation.

When "G_bStopSignalX" and "G_bStopSignalY" are operated from the PLC CPU module, change the motion control attribute setting from "READ(Motion=>)" to "WRITE(=>Motion)", and reflect the public label.

5.13.5 Event History

The event history of the Motion module can be checked from [Online] → [Motion Monitor] → [Event History] in the motion control setting function. If an error occurs, check the details of the error. The error occurrence time in the event history of the Motion module synchronizes with those recorded in the servo amplifiers. Check the error details of the event history together with the data in the servo amplifier.

Event History - [0000:RD78G4]

Refresh(U) Number of Events:158 Refine(D)

Events to Exclude

Refine

☒ Match All the Conditions ☐ Match Any One of the Conditions

1. Event Type Including Next

2.

3.

☐ Include program errors (Allow jumping)

Start Refine Clear Refine Conditions

No.	Occurrence Date	Event Type	Status	Event Code	Overview
00001	2020/09/07 07:33:19.402538560	System		007F0	MCFB Start (Control System)
00002	2020/09/07 07:33:19.391777656	System		007EE	Servo System Recorder Start
00003	2020/09/07 07:33:19.289555680	System		007FE	Homing Request OFF to ON
00004	2020/09/07 07:33:19.289115064	System		007FD	Current Position Restoration Completion
00005	2020/09/07 07:33:19.289032336	System		007FD	Current Position Restoration Completion
00006	2020/09/07 07:33:19.288934016	System		007FD	Current Position Restoration Completion
00007	2020/09/04 08:46:03.947703512	System		007F0	MCFB Start (Control System)

Legend

Major Moderate Minor

Warning Information

Jump

Clear All

Detailed Information	MCFB Start/Stop Information	-	-
Detail Code :0 FB Type :MCv_AllPower FB Instance ID :45430288 Instance Name :MCv_AllPower			
Cause	MCFB was started.		
Corrective Action	-		

Create File... Close

To check the event history of the PLC CPU module, click [Diagnosis] → [System monitor] in MELSOFT GX Works3, and click "Event history" on the "System monitor" screen.

MEMO

[illegible]


APPENDIX 1 Configuring Settings Using External Devices

External input signals can be used for the hardware stroke limit signals and the proximity dog signal.

Usable external signals	Reference
DI signal of the servo amplifier	Appendix 1.1
Input signal of the PLC CPU module	Appendix 1.2
Input signal of the remote input module	Appendix 1.3

APPENDIX 1.1 Using the DI signal of the servo amplifier

This section explains the case where the LSP/LSN signals of the servo amplifier are used for the hardware stroke limit signals and the case where homing is executed with the DOG signal of the servo amplifier.

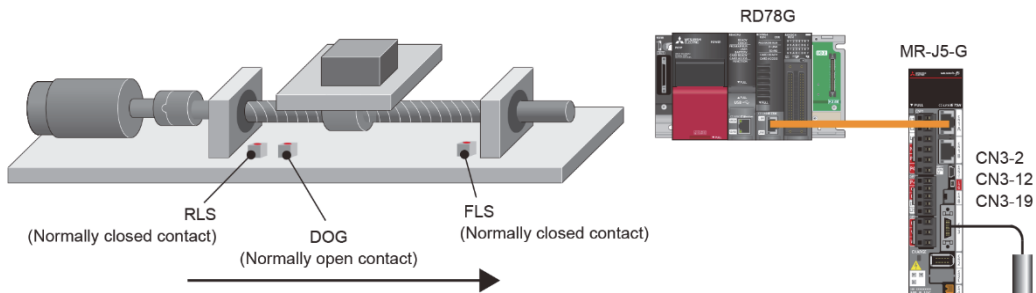

(1) Hardware stroke limit

The negative logic (normally closed contact) is recommended for wiring of the hardware stroke limit.

[CAUTION]

If the positive logic (normally open contact) is used for wiring of the hardware stroke limit, it may cause a serious accident at sensor failure or disconnection.

(a) The connection destination of the servo amplifier signals and the location of the sensors

The setting location of the sensor varies according to the setting of the servo parameter [Pr. PA14 (Travel direction selection)]. Set the limit switches connected to the servo amplifier as follows:

- 1) [Pr. PA14]: 0 (CCW or positive direction when the positioning address increases)
 - LSP signal: Upper stroke limit of the positioning address increasing side (FLS)
 - LSN signal: Lower stroke limit of the positioning address decreasing side (RLS)
- 2) [Pr. PA14]: 1 (CW or negative direction when the positioning address increases)
 - LSP signal: Lower stroke limit of the positioning address decreasing side (RLS)
 - LSN signal: Upper stroke limit of the positioning address increasing side (FLS)

(b) Servo parameters


Make sure that the servo parameters are set as follows:

No.	Item	Setting value
Pr. PD41.2	Limit switch enabled status selection	1: Only enabled in home position return mode
Pr. PD41.3	Sensor input method selection	0: Input from servo amplifier

I/O					Selected Items Write	Axis Writing
No.	Abbr.	Name	Unit	Setting range	Station1	Station2
Digital I/O						
Device setting						
PD03.0-1	*	Device selection DI1		00-7F	Setting	Setting
PD04.0-1	*	Device selection DI2		00-7F	0A	0A
PD05.0-1	*	Device selection DI3		00-7F	0B	0B
PD51.0-1	*	Device selection DI3-2		00-7F	22	22
PD38.0-1	*	Device selection DI4		00-7F	62	62
PD39.0-1	*	Device selection DI5		00-7F	2C	2C
PD07.0-1	*	Device selection DO 1		00-7F	2D	2D
PD08.0-1	*	Device selection DO2		00-7F	05	05
PD09.0-1	*	Device selection DO3		00-7F	04	04
Device assignment						
PD01.0-7	*DIA1	Input signal automatic on selection 1		0000000-00000FF0	Setting	Setting
Input filter						
PD11.0	*	Input signal filter selection		0-8	7 : 3.500ms	7 : 3.500ms
ALM output						
PD14.1	*	Selection of output device at warning occurrence		0-1	0 : WNG signal turn (	0 : WNG signal turn (
Analog output						
Analog monitor						
PC09.0-1		Analog monitor 1 output selection		00-1F	00 : Servo motor spe	00 : Servo motor spe
PC11	MO1	Analog monitor 1 offset		-999-999	0	0
PC10.0-1		Analog monitor 2 output selection		00-1F	01 : Torque or thrust	01 : Torque or thrust
PC12	MO2	Analog monitor 2 offset		-999-999	0	0
Stroke limit function						
Stroke limit function						
PC19.0	*	[AL. 099 Stroke limit warning] selection		0-1	1 : Disabled	1 : Disabled
PD41.2	*	Limit switch enabled status selection		0-1	1 : Only enabled in	1 : Only enabled in
PD41.3	*	Sensor input method selection		0-1	0 : Input from servo	0 : Input from servo

(c) Changing the PDO mapping

- 1) On the "CC-Link IE TSN Configuration" window, double-click "<Detail Setting>" in the "PDO Mapping Setting" to display the "PDO Mapping Setting" screen.

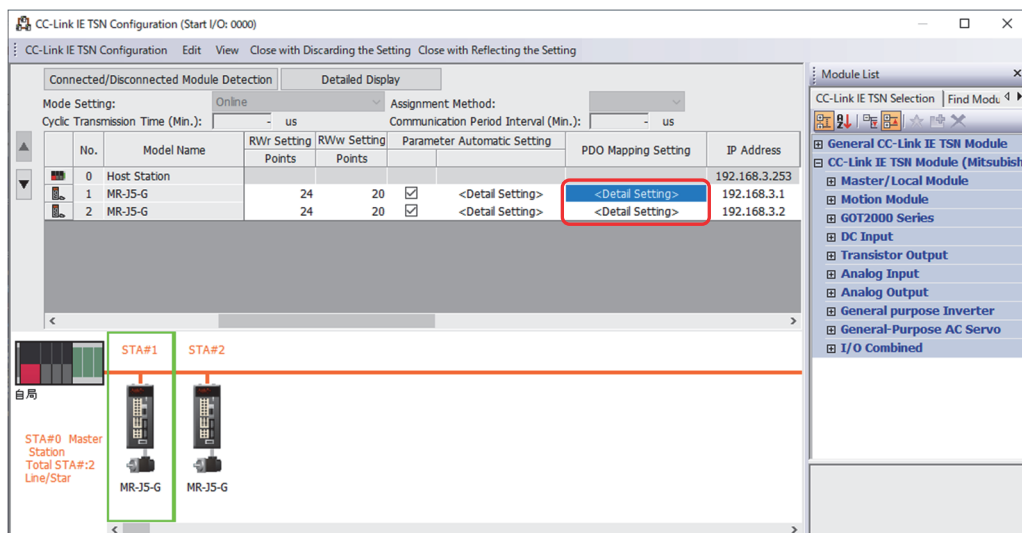


2) Set the end of the PDO mapping parameter as follows, and click the [OK] button.

Index (hexadecimal)	Sub-index (hexadecimal)
60fd	00

The entry name is displayed as "Digital inputs".

(The double word type data is displayed in two lines.)

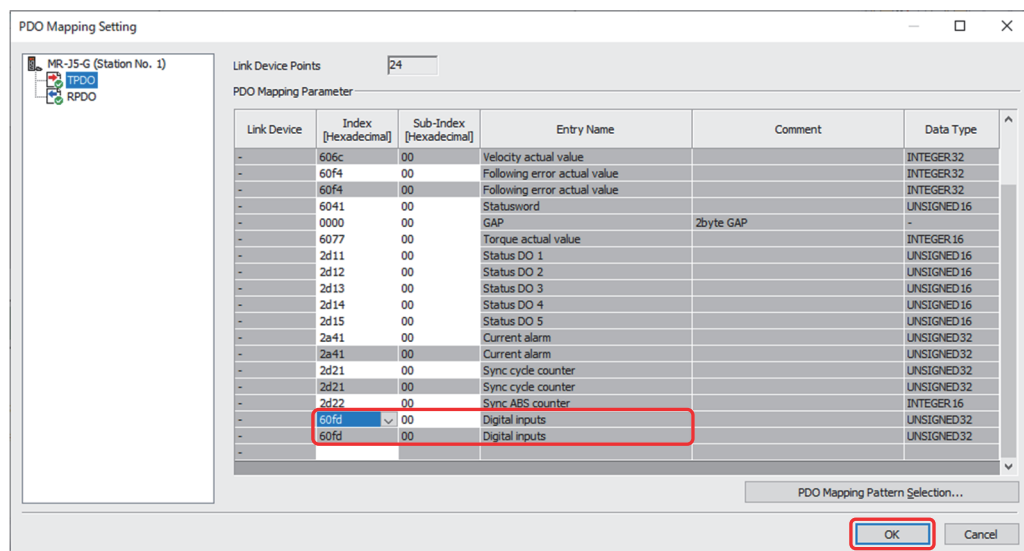

Set as above for all axes that use hardware limit signals connected to the servo amplifier.


[POINTS]

"Digital inputs" is a label that contains the status of the servo amplifier input signal.


- bit0: Negative limit switch
- bit1: Positive limit switch

For details, refer to "MR-J5-G/MR-J5W-G User's Manual (Object Dictionary)".

- 3) After the setting is completed, click "Close with Reflecting the Setting" on the "CC-Link IE TSN Configuration" window to reflect the data.

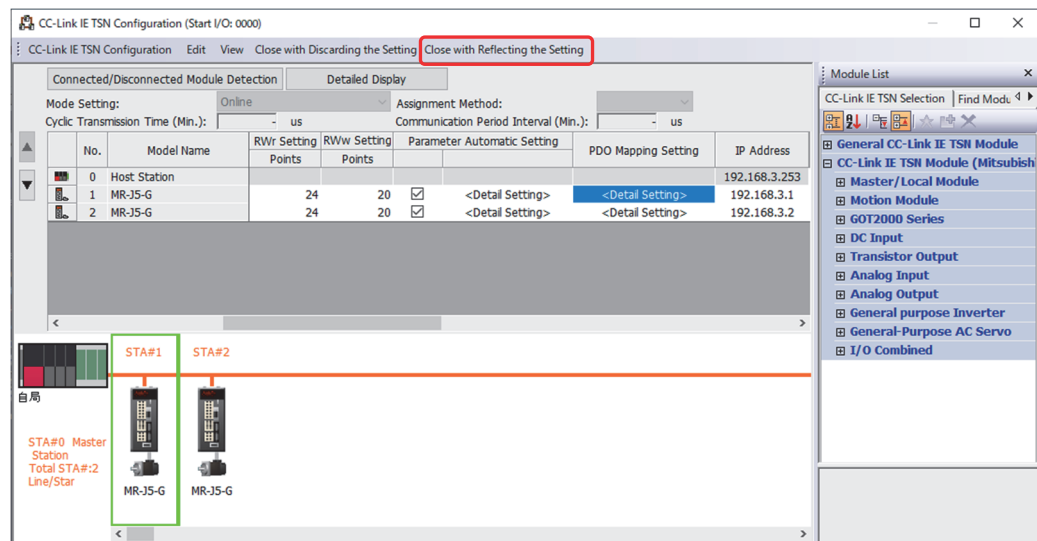


- 4) In the parameter editor (Module Parameter), click the [Apply] button to reflect the parameters of the Motion module.

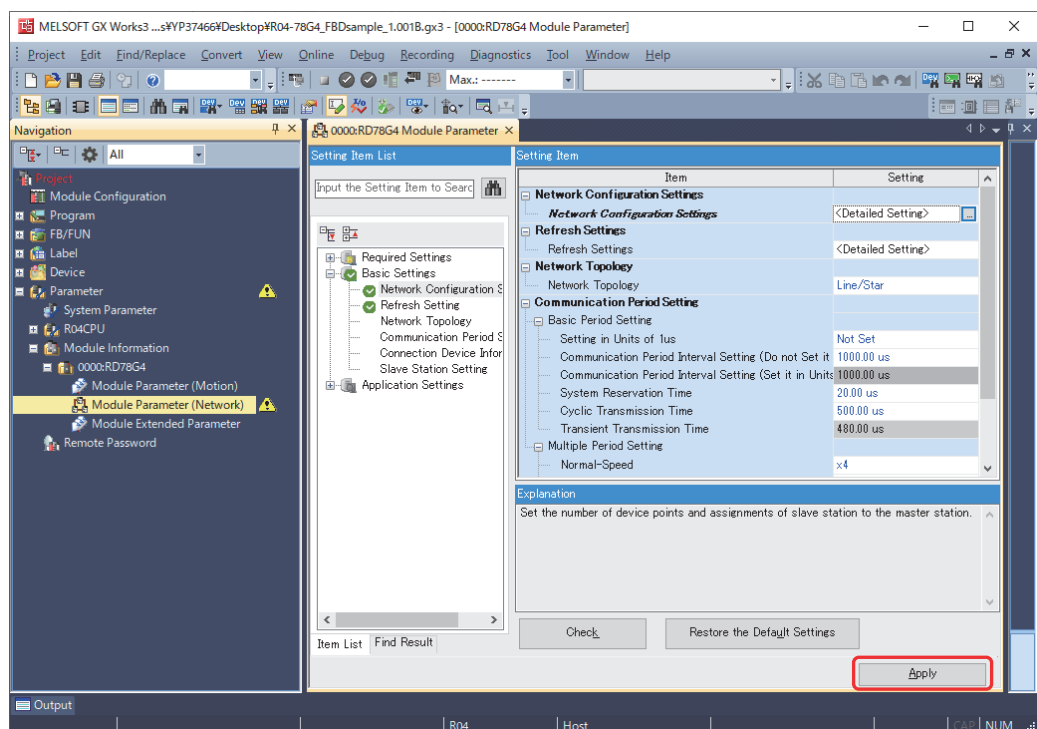


(d) Changing parameters of the Motion module

- 1) Double-click "Network I/O" in the navigation window of the motion control setting function to display the device controlled by the Motion module.

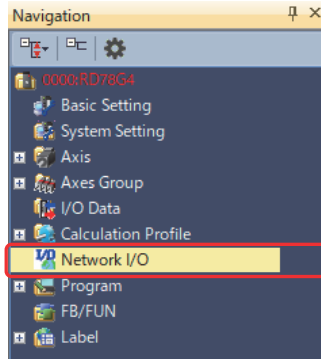


- 2) Check the "Labeling Target" checkbox of [MR_J5_G_***_DigitalInputs] (the label of the servo amplifier with the hardware stroke limit connected), and click the [Create Label] button.

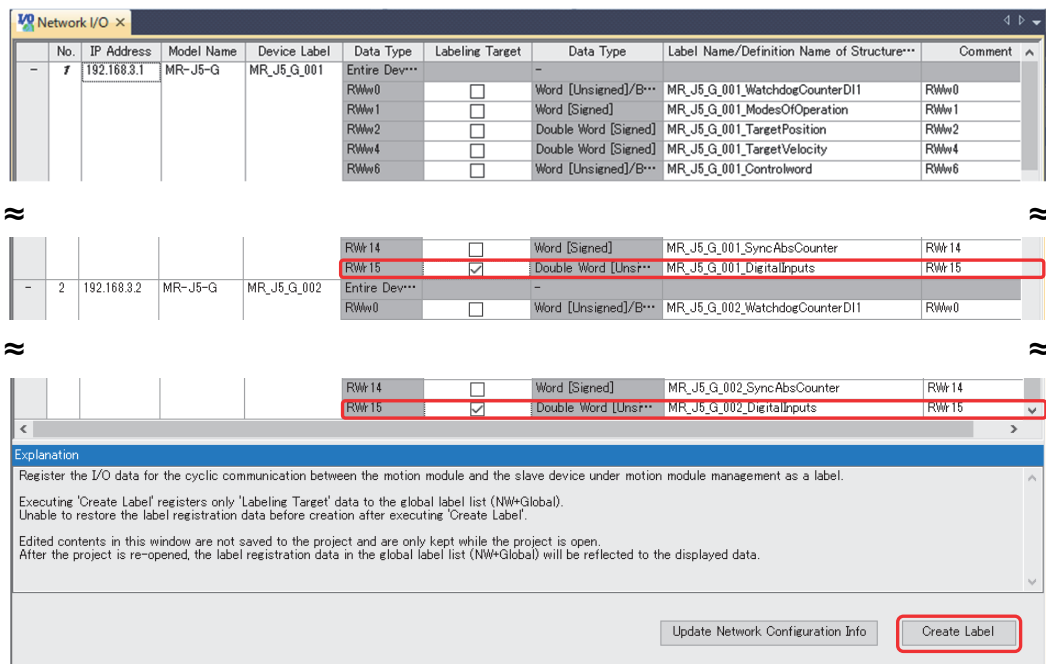

3) Click the [Yes] button on the confirmation screen.


The generated network I/O label will be stored below "NW+Global1" in "Global Label".

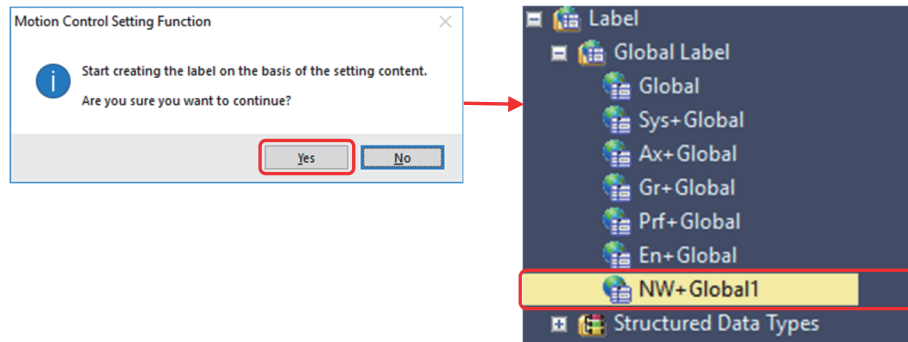

4) Open the axis parameter of the real drive axis.

From the navigation window, select "Axis", and double-click the name of the axis to be used (initial name: Axis0001).

From the "Axis Parameter Setting" window, select "Real Drive Axis" → "Upper Limit Signal", and click the [...] icon in "Target".

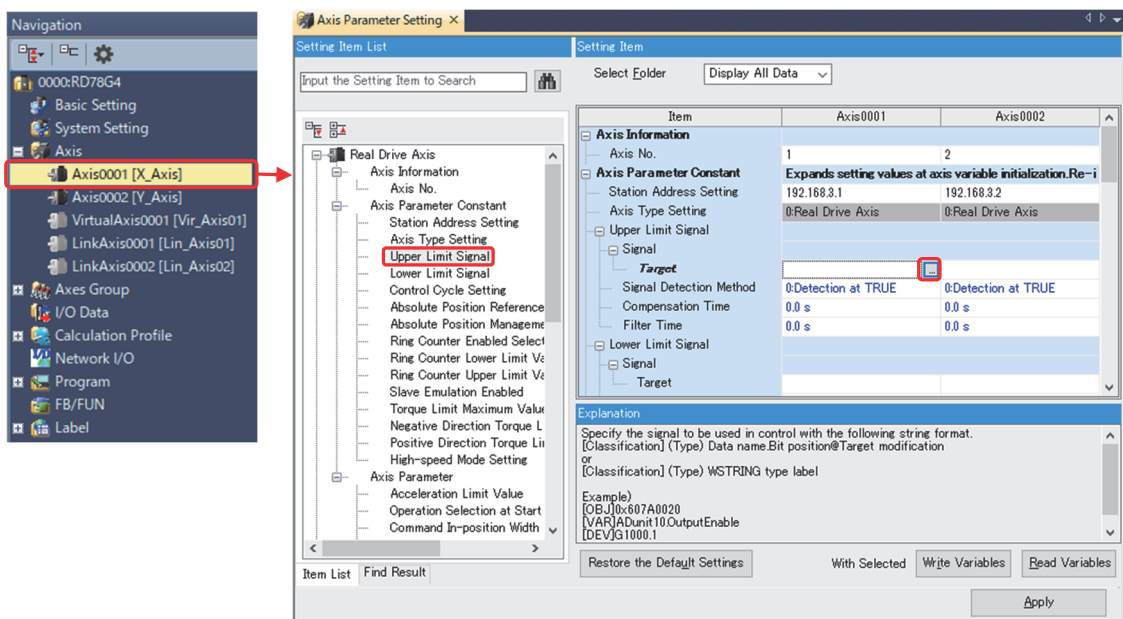

- 5) On the "Target Setting" screen, enter "MR_J5_G_***_DigitalInputs.1" in "Source".

Item	Setting
Source Type	Global Label
Source Data Type	
Source	MR_J5_G_001_DigitalInputs.1

OK Cancel

On the "Target Setting" screen of the lower stroke limit, enter "MR_J5_G_***_DigitalInputs.0" in "Source".

Item	Setting
Source Type	Global Label
Source Data Type	
Source	MR_J5_G_001_DigitalInputs.0

OK Cancel

Set as above for all axes that use hardware limit signals connected to the servo amplifier. Make sure that the relation between the axis label and the actual servo amplifier is correct. Change the signal detection method to "1: Detection at FALSE" because the normally closed contact is used.

Setting Item		
Select Folder	Display All Data	
Item	Axis0001	Axis0002
Axis Information		
Axis No.	1	2
Axis Parameter Constant	Expands setting values at axis variable initialization.Re-importing to the	
Station Address Setting	192.168.3.1	192.168.3.2
Axis Type Setting	0:Real Drive Axis	0:Real Drive Axis
Upper Limit Signal		
Signal		
Target	[VAR]MR_J5_G_001_DigitalInputs.1	[VAR]MR_J5_G_002_DigitalInputs.1
Signal Detection Method	1:Detection at FALSE	1:Detection at FALSE
Compensation Time	0.0 s	0.0 s
Filter Time	0.0 s	0.0 s
Lower Limit Signal		
Signal		
Target	[VAR]MR_J5_G_001_DigitalInputs.0	[VAR]MR_J5_G_002_DigitalInputs.0
Signal Detection Method	1:Detection at FALSE	1:Detection at FALSE
Compensation Time	0.0 s	0.0 s
Filter Time	0.0 s	0.0 s
Control Cycle Setting	0:Operate in the First Operation Cycle	0:Operate in the First Operation Cyc
Absolute Position Reference Se	3:Feed Machine Position	3:Feed Machine Position

The setting is completed. Convert all the program.

(e) Operation check

Write the program, and check whether ON/OFF of each signal can be monitored with "Upper limit signal status" and "Lower limit signal status" of the axis monitor.

To restore the value within the limit range, perform an error reset once, and then move the axis to the direction within the range with JOG operation, etc.

(2) Homing with the DOG signal

This section explains how to use the DOG signal of the servo amplifier for Homing Switch, such as using the proximity dog type homing.

(a) Servo parameters

Set the homing method and the polarity of the proximity dog signal with the following parameters.


No.	Item
Pr. PT29.0	Device input polarity 1
Pr. PT45	Home position return method

Set the necessary parameters in the following table according to the homing method.
(The parameters that require setting vary with the homing method.)

No.	Item
Pr. PT05	Homing speed
Pr. PT06	Creep speed
Pr. PT07	Home position shift distance
Pr. PT08	Homing position data
Pr. PT09	Travel distance after proximity dog
Pr. PT55.0	Homing deceleration time constant selection
Pr. PT56	Homing acceleration time constant
Pr. PT57	Homing deceleration time constant

(b) Program

For programs that use the DOG signal of the servo amplifier, the AbsSwitch input of MC_Home is omitted.

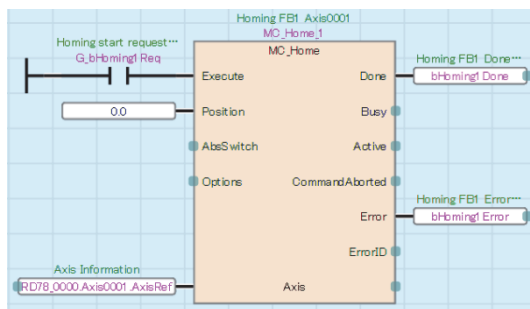

[FBD program]

```
//原点復帰, Homing
MC_Home_1(
  Axis      := Axis0001.AxisRef ,
  Execute   := G_bHoming1CMD ,
  Position  := 0.0 ,
  Done      => bHoming1Done,
  Error     => bHoming1Error
);
```


[ST program]

(c) Operation check

Write the program, and make sure that homing is correctly executed with the specified homing method.

APPENDIX 1.2 Using the input signal of the PLC CPU module

This section explains the case where the PLC CPU module input signal is used for the hardware stroke limit signals and the proximity dog signal.

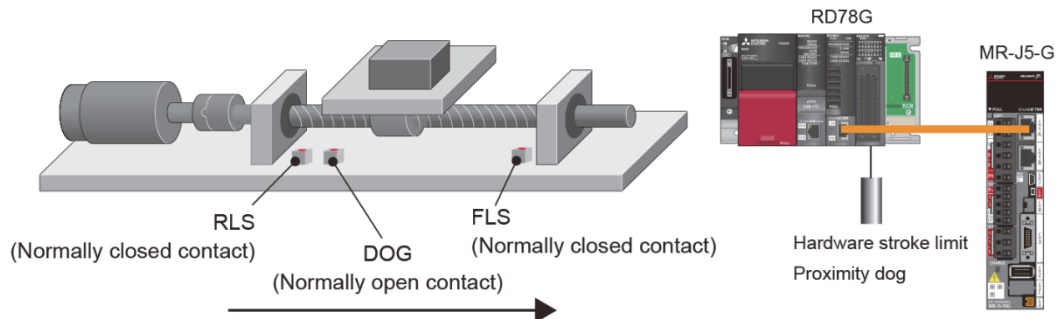

(1) Hardware stroke limit

The negative logic (normally closed contact) is recommended for wiring of the hardware stroke limit.

[CAUTION]

If the positive logic (normally open contact) is used for the wiring of the hardware stroke limit, it may cause a serious accident at sensor failure or disconnection.

In this example, X20 is used as FLS, and X21 as RLS.

(a) The location of the sensors

Set the upper stroke limit (FLS) to the positioning address increasing side, and the lower stroke limit (RLS) to the positioning address decreasing side.

(b) Servo parameters


Set the following servo parameters as shown below:

No.	Item	Setting value
Pr. PD41.2	Limit switch enabled status selection	1: Only enabled in home position return mode
Pr. PD41.3	Sensor input method selection	1: Input from controller

I/O				Selected Items Write	Axis Writing
No.	Abbr.	Name	Unit	Setting range	Station1
Digital I/O					
Device setting					Setting
PD03.0-1	*	Device selection DI1		00-7F	0A
PD04.0-1	*	Device selection DI2		00-7F	0B
PD05.0-1	*	Device selection DI3		00-7F	22
PD51.0-1	*	Device selection DI3-2		00-7F	62
PD38.0-1	*	Device selection DI4		00-7F	2C
PD39.0-1	*	Device selection DI5		00-7F	2D
PD07.0-1	*	Device selection DO1		00-7F	05
PD08.0-1	*	Device selection DO2		00-7F	04
PD09.0-1	*	Device selection DO3		00-7F	03
Device assignment					Setting
PD01.0-7	*DIA1	Input signal automatic on selection 1		0000000-00000FF0	00000000
Input filter					
PD11.0	*	Input signal filter selection		0-8	7 : 3.500ms
ALM output					
PD14.1	*	Selection of output device at warning occurrence		0-1	0 : WNG signal turn ON
Analog output					
Analog monitor					
PC09.0-1		Analog monitor 1 output selection		00-1F	00 : Servo motor speed (
PC11	MO1	Analog monitor 1 offset		-999-999	0
PC10.0-1		Analog monitor 2 output selection		00-1F	01 : Torque or thrust (±8
PC12	MO2	Analog monitor 2 offset		-999-999	0
Stroke limit function					
Stroke limit function					
PC19.0	*	[AL. 099 Stroke limit warning] selection		0-1	0 : Enabled
PD41.2	*	Limit switch enabled status selection		0-1	1 : Only enabled in ho
PD41.3	*	Sensor input method selection		0-1	1 : Input from control

(c) Program of the PLC CPU module

 The ON/OFF status of X20 and X21 is copied to the public label or the buffer memory and transmitted to the Motion module. The following shows a program when the ON/OFF status is copied to the buffer memory.





X20→U□\G11478000.0
X21→U□\G11478000.1

[POINTS]


The user setting area of the buffer memory is 11478000 to 11997999.

(d) Parameters of the Motion module

On the "Axis Parameter Setting" window, set "Upper Limit Signal" and "Lower Limit Signal" as follows:

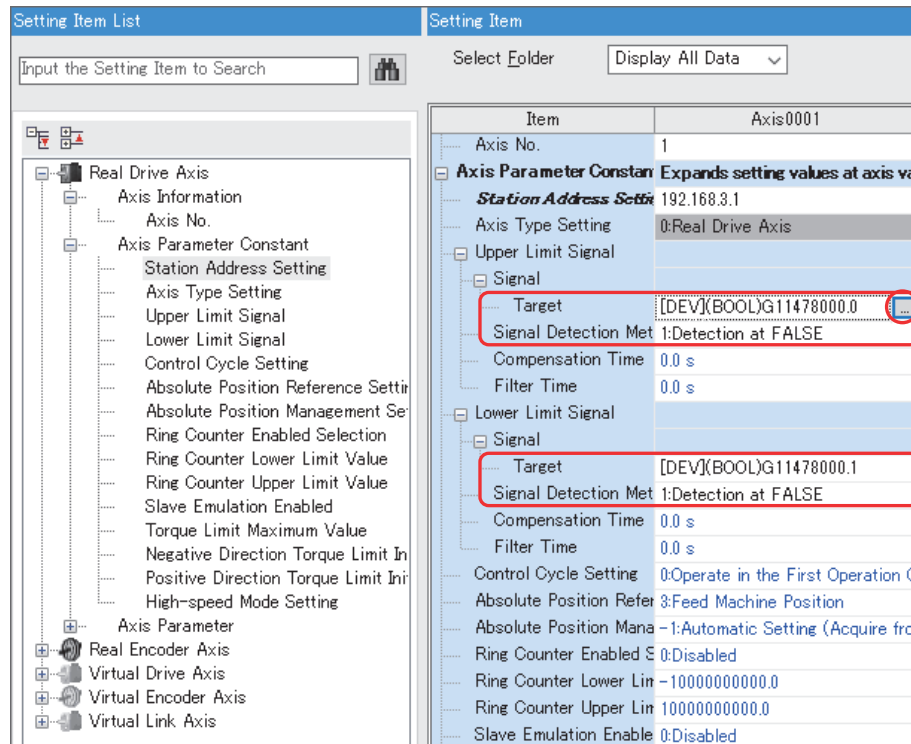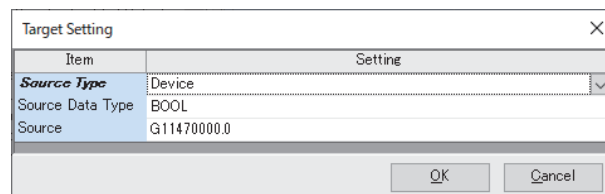

(Note) When the public label is used, set as follows:

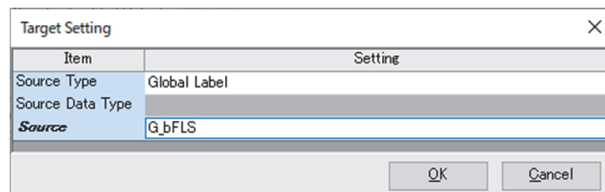

Set as above for all axes that use hardware limit signals.

Change the signal detection method to "1: Detection at FALSE" because the normally closed contact is used.

(e) Operation check

Write the program, and check whether ON/OFF of each signal can be monitored with "Upper limit signal status" and "Lower limit signal status" of the axis monitor.

To restore the value within the limit range, perform an error reset once, and then move the axis to the direction within the range with JOG operation, etc.

(2) Homing with the DOG signal

In this example, X22 is used as a DOG signal.

(a) Servo parameters

Set the homing method and the polarity of the proximity dog signal with the following parameters.

No.	Item
Pr. PT29.0	Device input polarity 1
Pr. PT45	Home position return method


Set the necessary parameters in the following table according to the homing method.
(The parameters that require setting vary with the homing method.)

No.	Item
Pr. PT05	Home position return speed
Pr. PT06	Creep speed
Pr. PT07	Home position shift distance
Pr. PT08	Home position return position data
Pr. PT09	Moving distance after proximity dog
Pr. PT55.0	Home position return deceleration time constant selection
Pr. PT56	Home position return acceleration time constant
Pr. PT57	Home position return deceleration time constant

(b) Programming with the Motion module

1) Program of the PLC CPU module

 
The ON/OFF status of X22 is copied to the public label or the buffer memory and transmitted to the Motion module. The following shows a program when the ON/OFF status is copied to the buffer memory.




X22→U011478000.2

2) Parameters of the Motion module

Right-click "I/O Data" in the navigation window of the motion control setting function, and select [Add New Data].

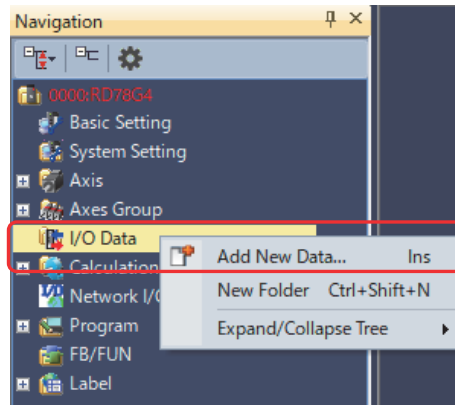

Set as follows:

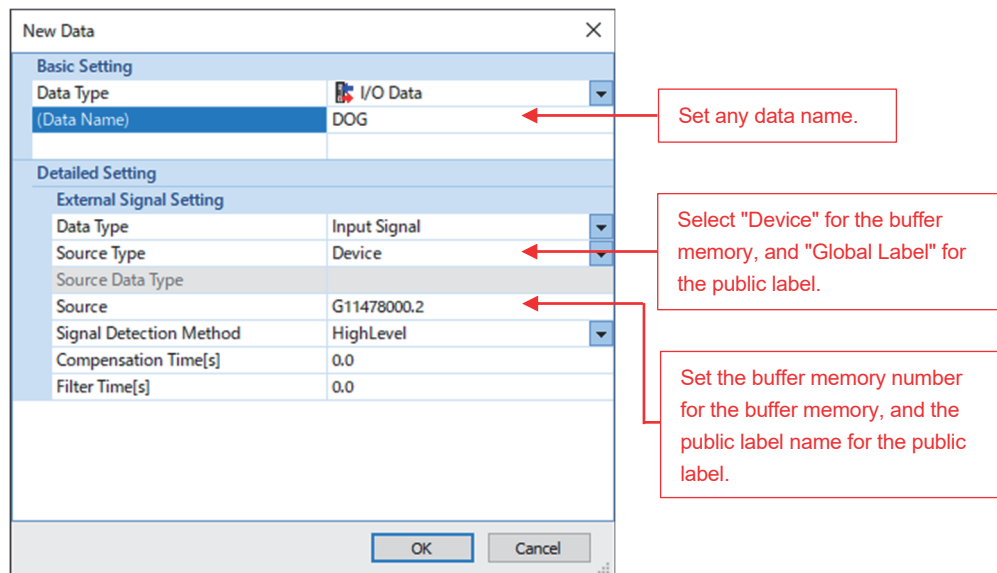

3) Program of the Motion module

Enter the I/O data name set in 2) in the AbsSwitch input of MC_Home.

```
//Homing
MC_Home_1(
  Axis:= Axis0001.AxisRef,
  Execute:= bHoming,
  Position:= 0.0,
  AbsSwitch:= DOG,
  Options:= 0,
  Done=> bHomeDone,
  Error=> bHomeError
);
```


Enter the I/O data name.

(c) Programming with the PLC CPU module


1) It is necessary to define an MC_INPUT_REF type structure to the PLC CPU module.

From the [Library] tab in the element selection window on MELSOFT GX Works3, click "Library" → "MotionControl_RD78_****" → "Structured Data Type".

Select "MC_INPUT_REF", and drag and drop it onto "Structured Data Types" under "Label" in the navigation window.

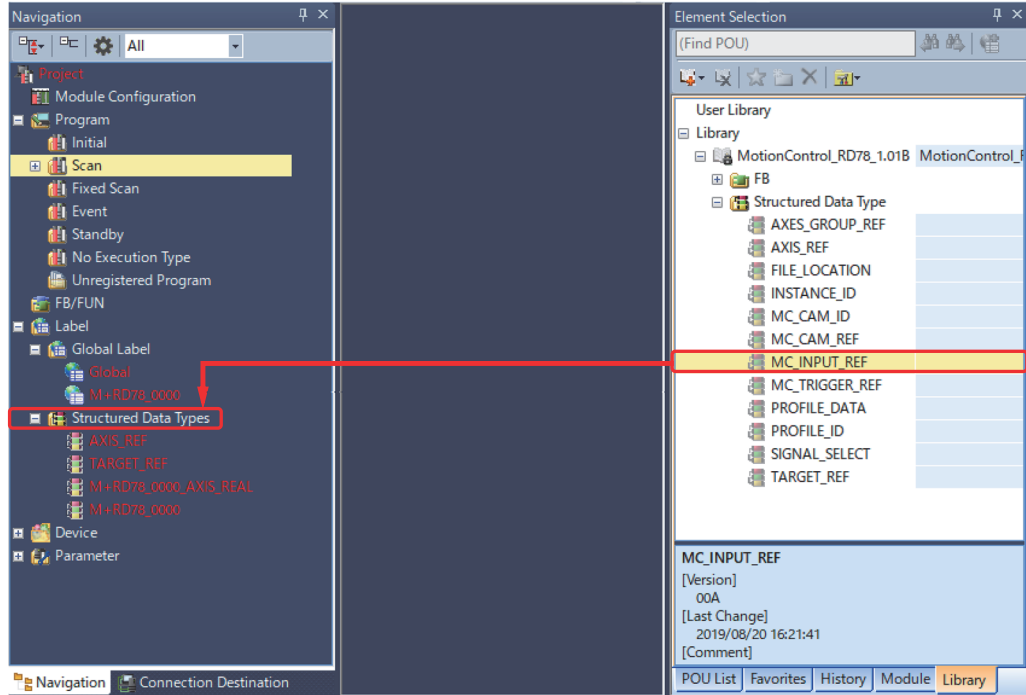


2) "MC_INPUT_REF" and the structures of the member ("TARGET_REF" and "SIGNAL_SELECT") are registered.

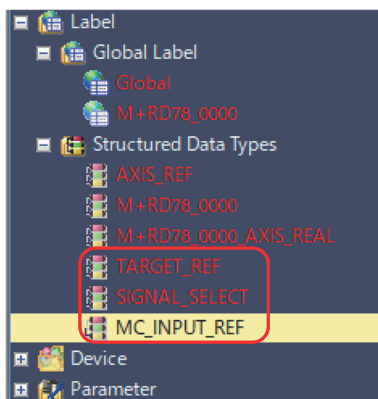


- 3) Prepare an MC_INPUT_REF type structure in the label of the PLC CPU module.
The label can be registered either as a global or public label.
The label name is "DOG" in this example.

Global [Global Label Setting]								
<Filter> Easy Display Display Setting Check								
Label Name	Data Type	Class	Assign (Device/Label)	Initial Value	Constant	English(Display Target)	Remark	
1 DOG	MC_INPUT_REF	VAR GLOBAL	Detailed Setting			Proximity dog		
2								

- 4) Set the member of the MC_INPUT_REF type structure with the program.

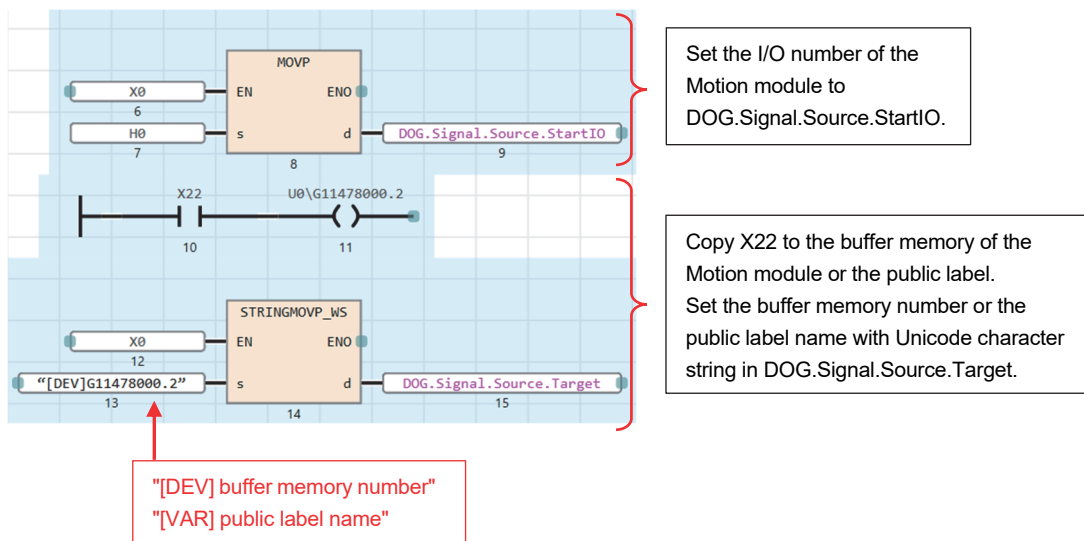

- 5) Write MC_Home to the program.

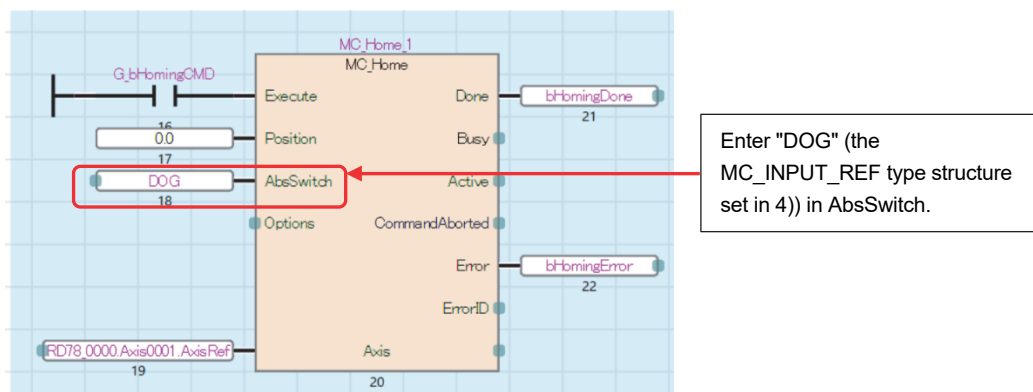


- (d) Operation check

Write the program, and make sure that homing is correctly executed with the specified homing method.

APPENDIX 1.3 Using the input signal of the remote input module

This section explains the case where the remote input module of the motion control station is used for the hardware stroke limit signal and the proximity dog signal.

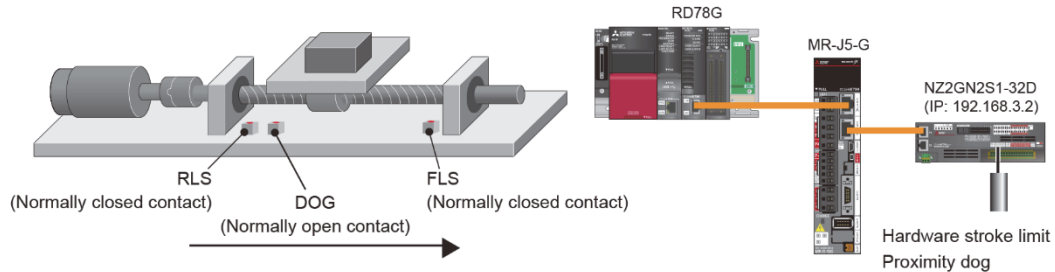

(1) Hardware stroke limit

The negative logic (normally closed contact) is recommended for the wiring of the hardware stroke limit.

[CAUTION]

If the positive logic (normally open contact) is used for the wiring of the hardware stroke limit, it may cause a serious accident at sensor failure or disconnection.

In this example, RX0 is used as FLS, and RX1 as RLS.

(a) The location of the sensors

Set the upper stroke limit (FLS) to the positioning address increasing side, and the lower stroke limit (RLS) to the positioning address decreasing side.

(b) Servo parameters

Set the following servo parameters as shown below:

No.	Item	Setting value
Pr. PD41.2	Limit switch enabled status selection	1: Only enabled in home position return mode
Pr. PD41.3	Sensor input method selection	1: Input from controller


No.	Abbr.	Name	Unit	Setting range	Station1
Digital I/O					
Device setting					
PD03.0-1	*	Device selection DI1		00-7F	0A
PD04.0-1	*	Device selection DI2		00-7F	0B
PD05.0-1	*	Device selection DI3		00-7F	22
PD51.0-1	*	Device selection DI3-2		00-7F	62
PD38.0-1	*	Device selection DI4		00-7F	2C
PD39.0-1	*	Device selection DI5		00-7F	2D
PD07.0-1	*	Device selection DO1		00-7F	05
PD08.0-1	*	Device selection DO2		00-7F	04
PD09.0-1	*	Device selection DO3		00-7F	03
Device assignment					
PD01.0-7	*DIA1	Input signal automatic on selection 1		0000000-00000FF0	00000000
Input filter					
PD11.0	*	Input signal filter selection		0-B	7 : 3.500ms
ALM output					
PD14.1	*	Selection of output device at warning occurrence		0-1	0 : WNG signal turn ON
Analog output					
Analog monitor					
PC09.0-1		Analog monitor 1 output selection		00-1F	00 : Servo motor speed (
PC11	MO1	Analog monitor 1 offset		-999-999	0
PC10.0-1		Analog monitor 2 output selection		00-1F	01 : Torque or thrust (±8
PC12	MO2	Analog monitor 2 offset		-999-999	0
Stroke limit function					
Stroke limit function					
PC19.0	*	[AL. 099 Stroke limit warning] selection		0-1	0 : Enabled
PD41.2	*	Limit switch enabled status selection		0-1	1 : Only enabled in ho
PD41.3	*	Sensor input method selection		0-1	1 : Input from control

(c) Parameters of the Motion module

1) Setting of the network I/O

Double-click "Network I/O" in the navigation window of the motion control setting function.



On this screen, label the input signal of the remote input module. Check the checkbox of RX0 and RX1, and click the [Create Label] button.

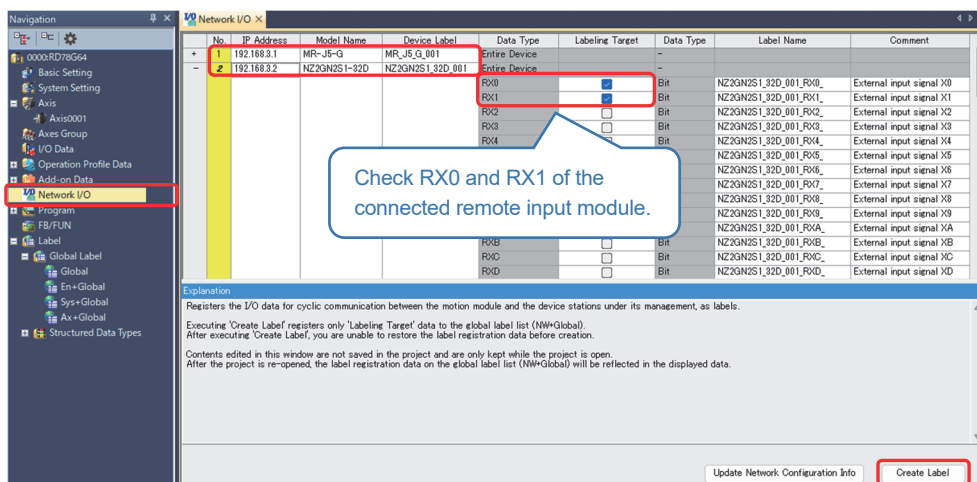

After the label is generated, the "NW+Global1" group will be added in "Global Label" in the navigation window.

2) Axis parameters

On the "Axis Parameter Setting" window, set "Target" of "Upper Limit Signal" and "Lower Limit Signal" as follows:

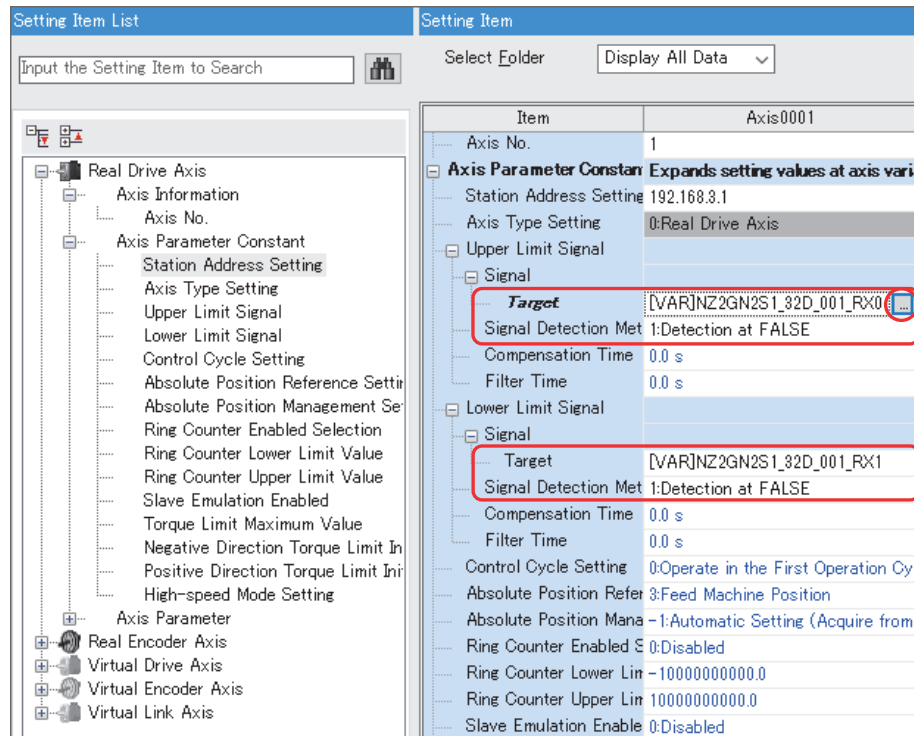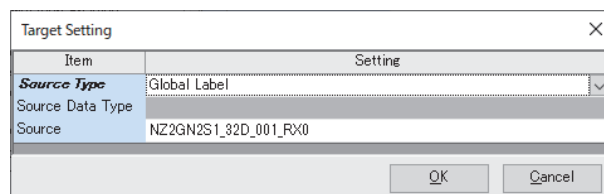

Set as above for all axes that use hardware limit signals.

Change the signal detection method to "1: Detection at FALSE" because the normally closed contact is used.

(d) Operation check

Write the program, and check whether ON/OFF of each signal can be monitored with "Upper limit signal status" and "Lower limit signal status" of the axis monitor.

To restore the value within the limit range, perform an error reset once, and then move the axis to the direction within the range with JOG operation, etc.

(2) Homing with the DOG signal

In this example, RX2 is used as a DOG signal.

(a) Servo parameters

Set the homing method and the polarity of the proximity dog signal with the following parameters.

No.	Item
Pr. PT29.0	Device input polarity 1
Pr. PT45	Home position return method


Set the necessary parameters in the following table according to the homing method.
(The parameters that require setting vary with the homing method.)

No.	Item
Pr. PT05	Home position return speed
Pr. PT06	Creep speed
Pr. PT07	Home position shift distance
Pr. PT08	Home position return position data
Pr. PT09	Moving distance after proximity dog
Pr. PT55.0	Home position return deceleration time constant selection
Pr. PT56	Home position return acceleration time constant
Pr. PT57	Home position return deceleration time constant

(b) Parameters of the Motion module (setting of the network I/O)

Double-click "Network I/O" in the navigation window of the motion control setting function.


On this screen, label the input signal of the remote input module. Check the checkbox of RX2, and click the [Create Label] button.

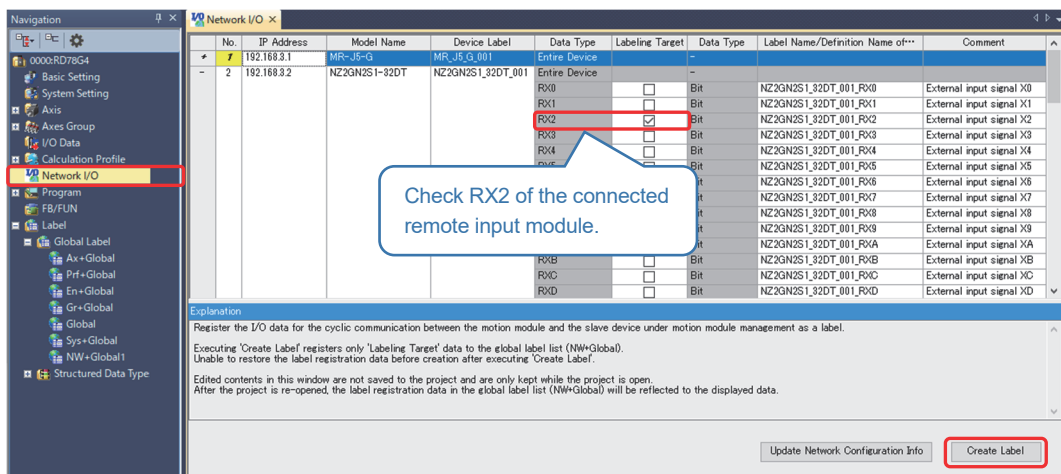


After the label is generated, the "NW+Global1" group will be added in "Global Label" in the navigation window.

(c) Programming with the Motion module

- 1) Right-click "I/O Data" in the navigation window of the motion control setting function, and select [Add New Data].

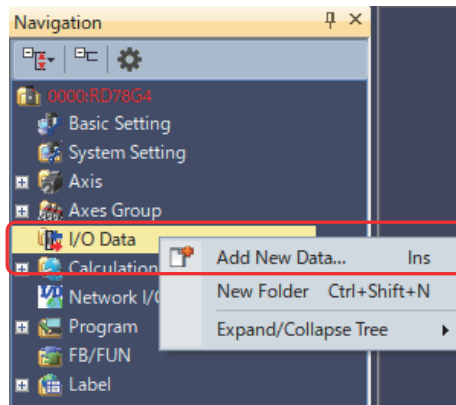

Set as follows:

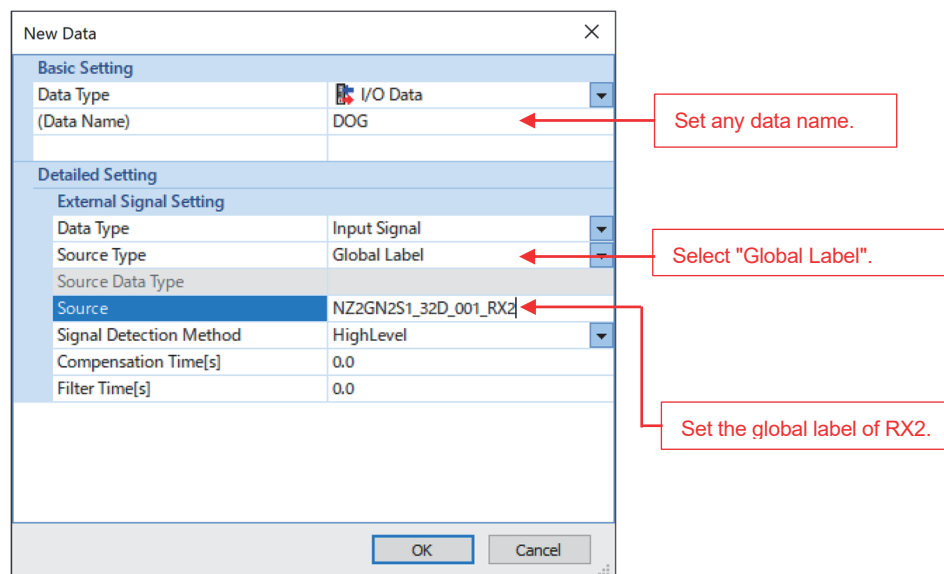

- 2) Enter the I/O data name set in (2) in the AbsSwitch input of MC_Home.

```
//Homing
MC_Home_1(
    Axis:= Axis0001.AxisRef,
    Execute:= bHoming ,
    Position:= 0.0 ,
    AbsSwitch:= DOG ,
    Options:= 0 ,
    Done=> bHomeDone ,
    Error=> bHomeError
);
```


A red arrow points to the 'AbsSwitch:= DOG' line in the code, with the annotation 'Enter the I/O data name.'

(d) Programming with the PLC CPU module


- 1) It is necessary to define an MC_INPUT_REF type structure to the PLC CPU module.

From the [Library] tab in the element selection window on MELSOFT GX Works3, click "Library" → "MotionControl_RD78_****" → "Structured Data Type".

Select "MC_INPUT_REF", and drag and drop it onto "Structured Data Types" under "Label" in the navigation window.

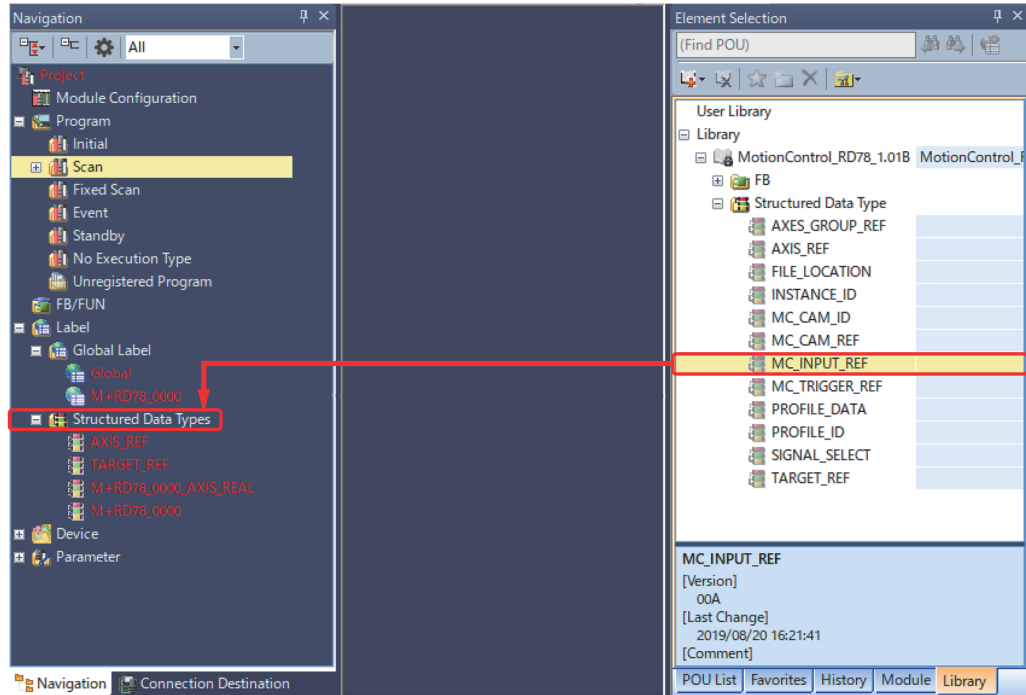


- 2) "MC_INPUT_REF" and the structures of the member ("TARGET_REF" and "SIGNAL_SELECT") are registered.

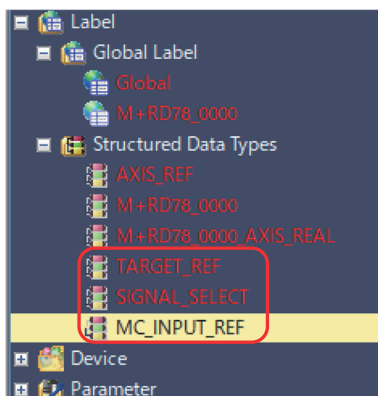


- 3) Prepare an MC_INPUT_REF type structure in the label of the PLC CPU module.
The label can be registered in either the global or public label.
The label name is "DOG" in this example.

Global [Global Label Setting]							
<Filter>		Easy Display		Display Setting		Check	
Label Name	Data Type	Class	Assign (Device/Label)	Initial Value	Constant	English (Display Target)	
1 DOG	MC_INPUT_REF	VAR_GLOBAL	Detailed Setting			DOG	
2							

- 4) Set the member of the MC_INPUT_REF type structure with the program.

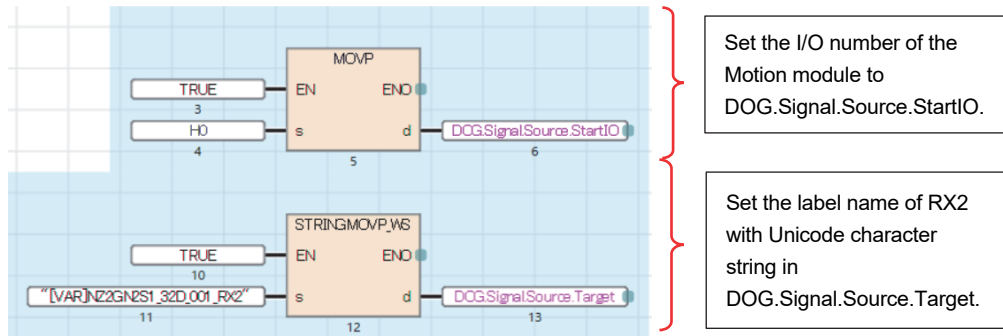

- 5) Write MC_Home to the program.

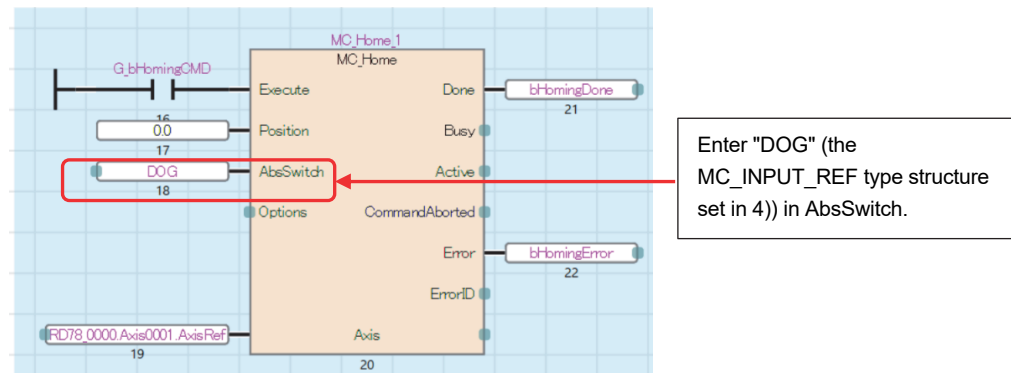

(e) Operation check

Write the program, and make sure that homing is correctly executed with the specified homing method.

APPENDIX 2 Precautions When the Absolute Position Detection is Used

When the absolute position detection system is used, be careful of the following items.

(1) Setting of the servo parameters

Change the following two servo parameters:

No.	Item	Setting value
Pr. PA03.0	Absolute position detection system selection	0: Disabled → 1: Enabled
Pr. PC29.5	[AL. 0E3 Absolute position counter warning] selection	1: Enabled → 0: Disabled

(2) At the first power-on

After the absolute position detection system is enabled, [AL. 025.1 Servo motor encoder – Absolute position erased] occurs at the first power-on of the servo amplifier.

Wait for 5 s as the alarm occurs, and then cycle the power.


After that, execute homing.

(3) Conditions that cause absolute positioning data to be erased

- Homing was not executed
- Homing is in execution
- Alarm [AL. 069 Command error] has occurred
- Alarm [AL. 025 Absolute position erased], [AL. 02B Encoder counter error], or [AL. 0E3 Absolute position counter warning] has occurred
- Electronic gear ([Pr. PA06] or [Pr. PA07]) has changed
- The settings for [Pr. PA03 Absolute position detection system] have changed
- [Pr. PA14 Travel direction selection] has changed
- [Pr. PA01.1 Operation mode selection] has changed

APPENDIX 3 Checking the Firmware Version

For the firmware version of each PLC CPU module and Motion module, confirm the firmware version using the following screen.

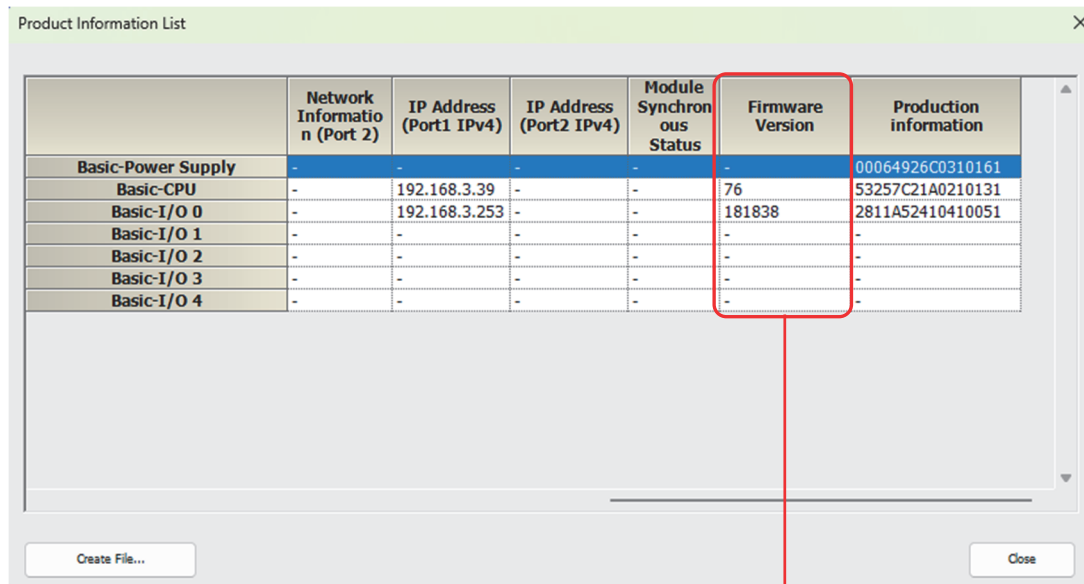

	Network Information (Port 2)	IP Address (Port1 IPv4)	IP Address (Port2 IPv4)	Module Synchronous Status	Firmware Version	Production information
Basic-Power Supply	-	-	-	-	-	00064926C0310161
Basic-CPU	-	192.168.3.39	-	-	76	53257C21A0210131
Basic-I/O 0	-	192.168.3.253	-	-	181838	2811A52410410051
Basic-I/O 1	-	-	-	-	-	-
Basic-I/O 2	-	-	-	-	-	-
Basic-I/O 3	-	-	-	-	-	-
Basic-I/O 4	-	-	-	-	-	-

[Motion module version designation]

181838

- Basic system software
- Boot software
- Network boot software

[illegible]

Microsoft and Windows are trademarks of the Microsoft group of companies.

The company names, system names and product names mentioned in this manual are either registered trademarks or trademarks of their respective companies.

In some cases, trademark symbols such as [™], [®] are not specified in this manual.

Servo System Motion Module Quick Start Guide

Country/Region	Sales office	
USA	Mitsubishi Electric Automation, Inc. 500 Corporate Woods Parkway, Vernon Hills, IL 60061, U.S.A.	Tel : +1-847-478-2100
Mexico	Mitsubishi Electric Automation, Inc. Mexico Branch Boulevard Miguel de Cervantes Saavedra 301, Torre Norte Piso 5, Int. 502, Ampliacion Granada, Miguel Hidalgo, Ciudad de Mexico, Mexico, C.P.11520	Tel : +52-55-3067-7500
Brazil	Mitsubishi Electric do Brasil Comercio e Servicos Ltda. Avenida Adelino Cardana, 293, 21 andar, Bethaville, Barueri SP, Brazil	Tel : +55-11-4689-3000
Germany	Mitsubishi Electric Europe B.V. German Branch Mitsubishi-Electric-Platz 1, 40882 Ratingen, Germany	Tel : +49-2102-486-0
UK	Mitsubishi Electric Europe B.V. UK Branch Travellers Lane, UK-Hatfield, Hertfordshire, AL10 8XB, U.K.	Tel : +44-1707-28-8780
Italy	Mitsubishi Electric Europe B.V. Italian Branch Campus, Energy Park Via Energy Park 14, Vimercate 20871 (MB) Italy	Tel : +39-039-60531
Spain	Mitsubishi Electric Europe B.V. Spanish Branch Carretera de Rubi, 76-80-Apdo. 420, E-08174 Sant Cugat del Valles (Barcelona), Spain	Tel : +34-935-65-3131
France	Mitsubishi Electric Europe B.V. French Branch 2, rue de l'Union-92565 Rueil-Malmaison Cedex-France	Tel : +33-1-55-68-55-68
Czech Republic	Mitsubishi Electric Europe B.V. Czech Branch, Prague Office Pekarska 621/7, 155 00 Praha 5, Czech Republic	Tel : +420-734-402-587
Poland	Mitsubishi Electric Europe B.V. Polish Branch ul. Krakowska 48, 32-083 Balice, Poland	Tel : +48-12-347-65-00
Sweden	Mitsubishi Electric Europe B.V. (Scandinavia) Hedvig Mollersgata 6, 223 55 Lund, Sweden	Tel : +46-8-625-10-00
Turkey	Mitsubishi Electric Turkey Elektrik Urunleri A.S. Serifali Mah. Kale Sok. No:41 Umraniye / Istanbul, Turkey	Tel : +90-216-969-2500
UAE	Mitsubishi Electric Europe B.V. Dubai Branch Dubai Silicon Oasis, P.O.BOX 341241, Dubai, U.A.E.	Tel : +971-4-3724716
South Africa	Adroit Technologies 20 Waterford Office Park, 189 Witkoppen Road, Fourways, South Africa	Tel : +27-11-658-8100
China	Mitsubishi Electric Automation (China) Ltd. Mitsubishi Electric Automation Center, No.1386 Hongqiao Road, Shanghai, China	Tel : +86-21-2322-3030
Taiwan	Mitsubishi Electric Automation (TAIWAN) Co., Ltd. 6F, No.105, Wugong 3rd Road, Wugu District, New Taipei City 248019, Taiwan	Tel : +886-2-2299-2499
Korea	Mitsubishi Electric Automation Korea Co., Ltd. 7F to 9F, Gangseo Hangang Xi-tower A, 401, Yangcheon-ro, Gangseo-Gu, Seoul, Korea	Tel : +82-2-6103-9474
Singapore	Mitsubishi Electric Asia Pte. Ltd. 307 Alexandra Road, Mitsubishi Electric Building, Singapore 159943	Tel : +65-6473-2486
Thailand	Mitsubishi Electric Factory Automation (Thailand) Co., Ltd. 101, True Digital Park Office, 5th Floor, Sukhumvit Road, Bang Chak, Prakanong, Bangkok, Thailand	Tel : +66-2092-8600
Indonesia	PT. Mitsubishi Electric Indonesia Trinity Tower 43rd Floor, Suites 09-16 & 01, Jl H R Rasuna Said Kav C22, Block II B, Karet Kuningan, Setiabudi, Jakarta Selatan, DKI Jakarta 12940, Indonesia	Tel : +62-21-5091-6608
Vietnam	Mitsubishi Electric Vietnam Company Limited 11th & 12th Floor, Viettel Tower B, 285 Cach Mang Thang Tam Street, Hoa Hung Ward, Ho Chi Minh City, Vietnam.	Tel : +84-28-3910-5945
India	Mitsubishi Electric India Pvt. Ltd. Pune Branch ICC-Devi Gaurav Technology Park, Unit no. 402, Fourth Floor, Survey no. 191-192 (P), Opp. Vallabh Nagar Bus Depot, Pune - 411018, Maharashtra, India	Tel : +91-20-4624-2100
Australia	Mitsubishi Electric Australia Pty. Ltd. 348 Victoria Road, P.O. Box 11, Rydalmere, N.S.W 2116, Australia	Tel : +61-2-9684-7777



Mitsubishi Electric's e-F@ctory concept utilizes both FA and IT technologies, to reduce the total cost of development, production and maintenance, with the aim of achieving manufacturing that is a "step ahead of the times". It is supported by the e-F@ctory Alliance Partners covering software, devices, and system integration, creating the optimal e-F@ctory architecture to meet the end users needs and investment plans.



MITSUBISHI ELECTRIC CORPORATION

HEAD OFFICE: TOKYO BLDG., 2-7-3, MARUNOUCHI, CHIYODA-KU, TOKYO 100-8310, JAPAN
NAGOYA WORKS: 1-14, YADA-MINAMI 5-CHOME, HIGASHI-KU, NAGOYA 461-8670, JAPAN